			0			
Form 3160-5 (June 2015) DEI	UNITED STATES PARTMENT OF THE INTERIC		°.0	FOR OMI Expire	M APPROVED 8 No. 1004-0137 5: January 31, 2018	
BUR	EAU OF LAND MANAGEME	INT	3010	5. Lease Serial No. NM-	033312A	
SUNDRY N	NOTICES AND REPORTS O	RWELLS 20	·	Indian, Allottee or Ti	ribe Name	
Do not use this abandoned well.	form for proposals to drill c Use Form 3160-3 (APD) for	or to re-yoter an such proposale	ENV			
Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-toer an abandoned well. Use Form 3160-3 (APD) for such proposals. EN SUBMIT IN TRIPLICATE - Other instructions on page 2 I. Type of Well Oil Well Gas Well Other Natural Gas Storage				7. If Unit of CA/Agreement, Name and/or No.		
1. Type of Well				- 14-08-0001014277 (NMNM-70953X)		
2. Name of Operator Enstor Grama F			9. API Well No. 30-025-39922			
3a. Address 20329 State Hwy 249, Houston, TX 77070	No. (include area code 4-3050	Morrow Formation, Grama Ridge				
4. Location of Well (Footage, Sec., T.) 126' FSL and 1048' FEL of Sectio	• • •		/	11. Country or Parish, State Lea County, NM		
12. CHE	ECK THE APPROPRIATE BOX(ES) TO	O INDICATE NATURE	OF NOT	CE, REPORT OR OTHER	R DATA	
TYPE OF SUBMISSION		TY	PE OF AC	TION		
Notice of Intent		Deepen Hydraulic Fracturing		uction (Start/Resume) amation	Water Shut-Off Well Integrity	
Subsequent Report	Casing Repair	New Construction	Rece	omplete	X Other	
		Plug and Abandon	=	porarily Abandon	Possible wellhead and tubing repair	
Final Abandonment Notice	Convert to Injection	Plug Back	Wate	er Disposal	toomg repair	
a depth of 12,668', between th BLM Form 3160-5 Notice of In operationally risky and unsoun	e well was immediately shut-in. After e liner hanger and production packet tent was approved on 2/08/18; howe d. This "Amended" casing repair pro lready been informally reviewed by t 2018 Plan of Operations.	r. ever, after further revi ocedure (see attacher	ew it has i d wellbore	been determined that the schematics and work or	e repair/remediation procedure is ver procedure) is more	
*Please note that the well will r	remain shut-in pending completion o	f repairs and success	ful NMOC	D-witnessed MIT/Brade	enhead pressure test.	
		SEE	ΔΤΤΛ	CHED FOR		
SEE ATTACHED FOR CONDITIONS OF APPROVAL						
		condit	10143	OF APPROVA	L	
4. I hereby certify that the foregoing is Nick Nicodemus	certify that the foregoing is true and correct. Name (Printed/Typed) demus					
Signature Da V	1	Date	07/42/2010			
	THE SPACE FOR F	EDERAL OR ST	ATE OF	ICE USE		
Approved by		100 - A-		Engindo	r	
	en ve		oleu	m Enginee	7-15-2018	
Conditions of approval, if any, are attac certify that the applicant holds legal or o which would entitle the applicant to cor	hed. Approval of this notice does not we equitable title to those rights in the subject		sbad	Field Offic		
Title 18 U.S.C Section 1001 and Title 4 any false, fictitious or fraudulent statem			ly and will	fully to make to any depar	tment or agency of the United States	
(Instructions on page 2)	· · · · · · · · · · · · · · · · · · ·				In the second statement of the second s	

a <sup>6</sup> , . .

~


MOB/OCD 7/31/2018

## **GRAMA RIDGE WELL 8**

### **Workover Procedure**

## 7-10-2018

- 1. Move in and rig a workover rig and associated equipment.
- 2. Remove the tree valves and nipple up and test BOP's.
- 3. Perforate the 2-7/8" tubing above the production packer at 12,717'.
- 4. Circulate and kill the well with kill weight fluid through the perforations in the 2-7/8" tubing.
- 5. Pull and lay down the 4-1/2" x 2-7/8" tubing.
- 6. Mill over the production packer at 12,717'.
- 7. Run and set a retrievable bridge plug (RBP) at approximately 12,790'.
- 8. Make a test packer run to confirm the depth of the leak in the 4-1/2" liner at approximately 12,668'.
- 9. Perforate the 4-1/2" casing at the leak depth at approximately 12,668'.
- 10. Squeeze the perforations with cement.
- 11. Wait on the cement to set for at least 8 hours.
- 12. Drill out the cement and test the casing to 550 psi for 30 minutes.
- 13. Retrieve the RBP at approximately 12,790'.
- 14. Run and set the 4-1/2" production packer assembly at approximately 12,720'.
- 15. Run the 7" production packer assembly to approximately 11,000'.
- 16. Circulate an inhibited fluid into the tubing by casing annulus.
- 17. Set the 7" packer.
- 18. Run the 4-1/2" tubing and tag the 7" packer at 11,000'.
- 19. Circulate inhibited annular fluid into the tubing by casing annulus.
- 20. Land the tubing hanger in the wellhead and the tubing anchor latch in 7" production packer simultaneously.
- 21. Test the tubing by casing annulus to 550 psi for 30 minutes.
  - Record the pressure test on a chart or digitally.
- 22. Nipple down the BOP's and install the tree valves.
- 23. Clean out the wellbore with coiled tubing and acidize if necessary.
- 24. Return the well to service.

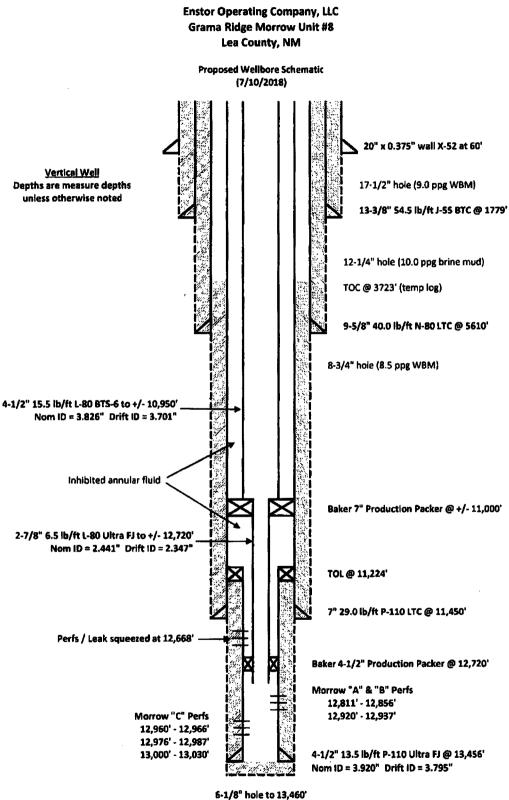


(11.3 ppg brine mud)

#### Enstor Operating Company, LLC Grama Ridge Morrow Unit #8 Lea County, NM

.

. •

(Current Wellbore Schematic)

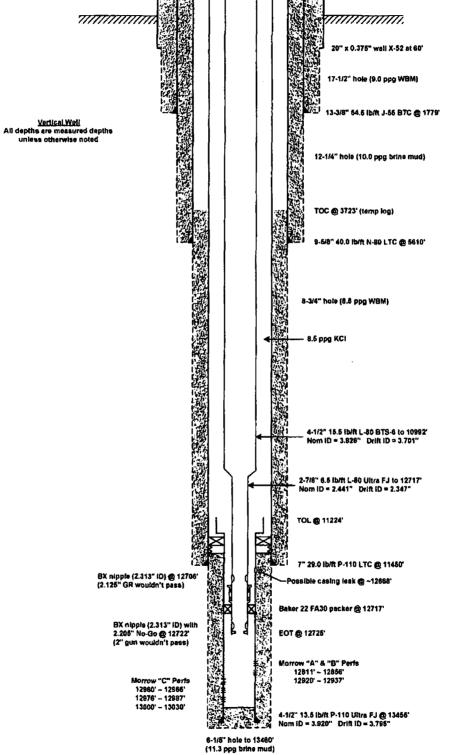

9/1**2/17** 

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## GRM UNIT 8 30-025-39922 Enstor Grama Ridge Storage and Transportation LLC

# **Conditions of Approval**

- 1. Notify BLM at 575-361-2822 (Eddy County) or 575-393-3612 (Lea County) a minimum of 24 hours prior to commencing work.
- 2. Must conduct casing integrity test (CIT) and submit results to BLM. Notify BLM if test fails. The CIT is to be performed on the production casing to 1500 psi
- 3. Subsequent sundry required detailing work done. Operator to include well bore schematic of current well condition when work is complete.

MHH 07182018

.

٠