

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-00962
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Artesia Metex Unit
8. Well Number 26
9. OGRID Number 269864
10. Pool name or Wildcat Artesia QU-GB-SA

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-10) FOR PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other	HOBBS OCD AUG 29 2018 RECEIVED
2. Name of Operator State of New Mexico formerly Canyon E&P Company	
3. Address of Operator 1625 N. French Drive Hobbs, NM 88240	
4. Well Location Unit Letter A : 330 feet from the North line and 330 feet from the East line Section 26 Township 18S Range 27E NMPM County Eddy	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHMENTS

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mark Whitaker TITLE Petroleum Engr Specialist DATE 8/29/2018

Type or print name Mark Whitaker E-mail address: _____ PHONE: 575-393-6161

For State Use Only

APPROVED BY: Maureen Brown TITLE AO/I DATE 8/29/2018
Conditions of Approval (if any): _____

Canyon E&P Company
Artesia Metex Unit No. 26
30-015-00962
330' FNL & 330' FEL
UL – A, Sec. 26, T18S, R27E

8 5/8" 24# csg at 490' w/ 50 sx cmt.
4 1/2" 9.5# csg at 1957' w/ 250 sx cmt. TOC 1680' by T.S.
Perfs 1856' – 1951'
TD 1960'


1. MIRU plugging equipment. POOH w/ production equipment.
2. Run gauge ring. Set CIBP at 1756'. Circulate hole w/ mud laden fluid and pressure test casing to 500 psi.
3. Spot 35 sx cement.
4. Perforate at 540'. Pump sufficient cement to circulate to surface inside/outside of 4 1/2" casing.
5. Cut off wellhead 3 feet below ground level.
6. Verify cement to surface on all strings.
7. Install upright P&A marker and cut off anchors.

NOTES: Mud laden fluid consists of 9.5 ppg with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

Canyon E P Company
Artesia Metex Unit No. 26

CURRENT

30-015-00962

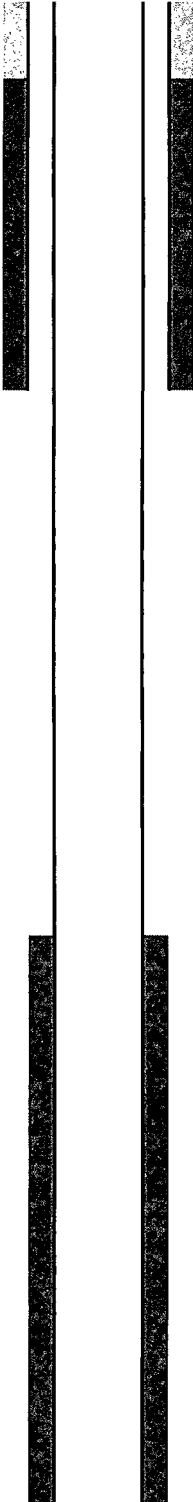

8 5/8" 24# @ 490' w/ 50 sx


NOTES:

Perfs 1856' - 1951'

4 1/2" 9.5# @ 1957' w/ 250 sx TOC 1680' (TC)

**Canyon E P Company
Artesia Metex Unit No. 26**

**PROPOSED
30-015-00962**

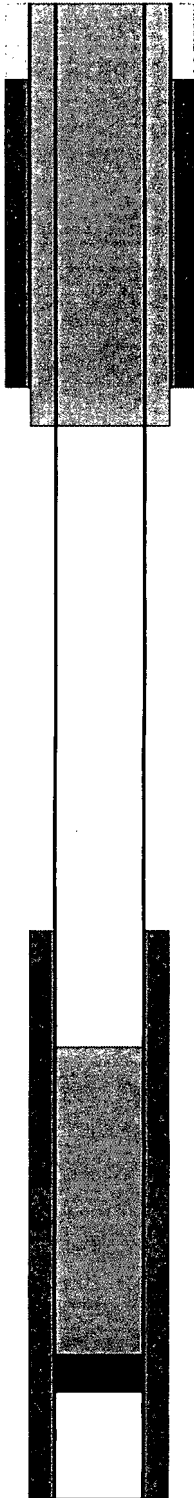

**INSTALL P&A MARKER
VERIFY CMT TO SURFACE
CUT OFF WELLHEAD 3' BELOW GL**

8 5/8" 24# @ 490' w/ 50 sx **CIRCULATE CEMENT TO SURFACE.
PERF AT 540'.**

Perfs 1856' - 1951' **SPOT 35 SX CMT
CIRC MLF. PRESSURE TEST CSG.
SET CIBP AT 1756'.**

4 1/2" 9.5# @ 1957' w/ 250 sx TOC 1680' (TC)