

**HOBBS OCD**

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

**NMOCD**

**NMOCD**

**Hobbs**

FORM APPROVED  
OMB No. 1004-0137  
Expires: July 31, 2010

**SUNDRY NOTICES AND REPORTS ON WELLS**  
**Do not use for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.**

**SUBMIT IN TRIPLICATE - Other instructions on page 2.**

1. Type of Well

☒ Oil Well

☐ Gas Well

☐ Other

2. Name of Operator  
Seely Oil Company

3a. Address  
615 W. 10th Street  
Fort Worth, TX 76102

3b. Phone No. (include area code)  
(817) 332-1377

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
Section 13 - T18S - R33E  
Unit A: 430' FNL and 900' FEL

5. Lease Serial No.  
NMLC063645

6. If Indian, Allottee or Tribe Name

7. If Unit of CA Agreement, Name and/or No.

8. Well Name and No.  
Mescalero Ridge Federal #3

9. API Well No.  
30-025-29471

10. Field and Pool or Exploratory Area  
Mescalero Escarpe Bone Spring

11. Country or Parish, State  
Lea County, NM

**12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

MI & RU CU. TOH w/ rods & tbg  
Set CIBP @ 8500' w/ 35' cmt on top. *missing plugs See COAs*  
Set CIBP @ 5000' (above Grayburg / San Andres) w/ 35' cmt on top.  
Performate from 4384 - 4390' w/ 2 spf. TIH w/ tbg & pkr.  
Acidize w/ 750 gallons 7 1/2 % MCA.  
Fracture treat w/ 20,000 gals. gelled KCL w/ 35,000lbs sand.  
Recover load. TOH w/ tbg & pkr.  
TIH w/ rods & tbg. Return well to production.

**SEE ATTACHED FOR  
CONDITIONS OF APPROVAL**

*Plugs added see COAs*

14. I hereby certify that the foregoing is true and correct.

Name (Printed/Typed)

David L. Henderson

Title President

Signature

*David L. Henderson*

Date 08/16/2016

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

Title

Office

**DEC**

**6/2016**

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

## WELL COMPLETION SKETCHES SLN-5036-4-A

WELL

MESCALERO RIDGE FED. No. 3 MESCALERO - ESCARPE

DATE

5 AUG. 1986



PRESENT COMPLETION



SUGGESTED COMPLETION


## PERMANENT WELL BORE DATA

13 3/8", 48#, H-40, STC  
 SURFACE CSG. CS ± 336.  
 CMT'D W/ 375 SKS. CIRC 88  
 SKS TO SURFACE.

8 5/8", 24 # 32#, K-55, STC  
 INTERMEDIATE CSG. CS ± 331.  
 CMT'D W/ 1000 SKS CMT. DID  
 NOT CIRC. TEMP SURVEY TOC  
 ± 25' FROM SURFACE.

TOC ± 800 VIA TEMP SURVEY

5 1/2", 15.5 # 17#, K-55,  
 STC CSG. CS ± 9200'.  
 FC ± 9150, SC ± 7026.  
 1<sup>ST</sup> STAGE 500 SKS, 2<sup>ND</sup>  
 STAGE 900 SKS. TOC ±  
 800 VIA TEMP SURVEY.

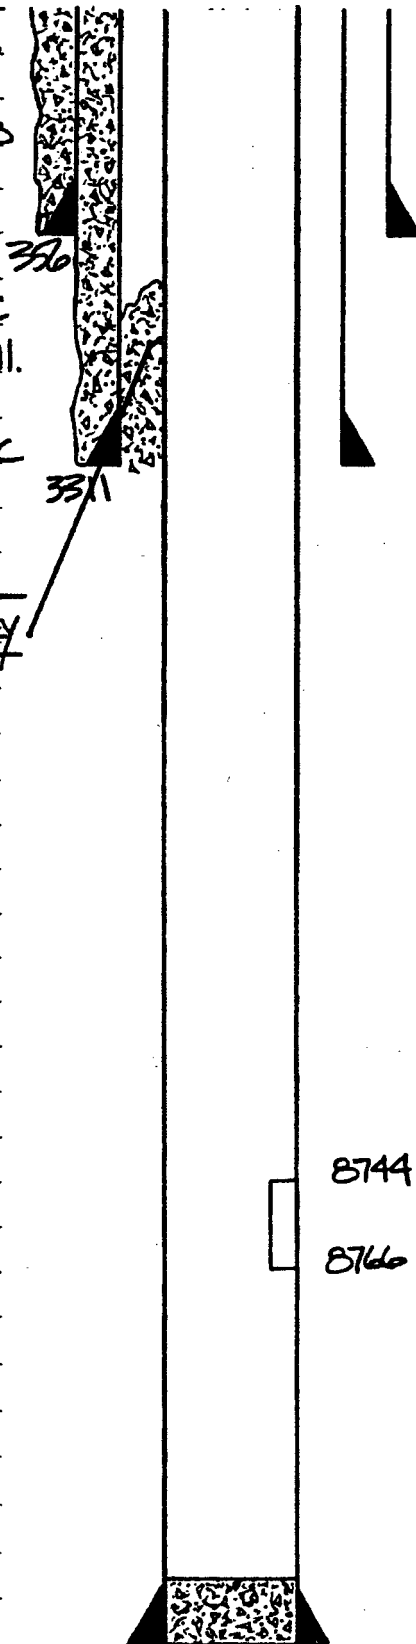

## DATA ON THIS COMPLETION

KB: 4063

CL: 4050

BONE SPRING SET I

8744 - 8766. 2 JBPF

TOTAL 45 HOLES.

FISD: 9146

9200

**Mescalero Ridge Federal 3  
30-025-29471  
Seely Oil Company  
December 06, 2016  
Conditions of Approval**

**Notify BLM at 575-393-3612 a minimum of 24 hours prior to commencing work.**

**Work to be completed by March 06, 2017.**

- 1. Operator shall place CIBP at 8,644' (50'-100' above top most perf) and place 35' of Class H cement on top as proposed. WOC and tag.**
- 2. Operator shall place a solid Class C Cement plug from 6,966'-6,796' to seal the top of the Bone Spring formation.**
- 3. Operator shall place a solid Class C Cement plug from 5,962'-5,802' to seal the top of the Delaware formation.**
- 4. Operator shall place a CIBP at 5,000' with 35' Class C Cement on top as proposed. WOC and tag.**
- 5. Must conduct a casing integrity test before perforating and fracturing. Submit results to BLM. The CIT is to be performed on the production casing to max treating pressure. Notify BLM if test fails**
- 6. Before casing or a liner is added or replaced, prior BLM approval of the design is required. Use notice of intent Form 3160-5.**
- 7. Surface disturbance beyond the originally approved pad must have prior approval.**
- 8. Closed loop system required.**
- 9. All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.**
- 10. Operator to have H2S monitoring equipment on location.**

11. A minimum of a **3000 (3M) BOP** to be used. All blowout preventer (BOP) and related equipment (BOPE) shall comply with reasonable well control requirements. A two ram system with a blind ram and a pipe ram designed for the size of the work string shall be adequate. Tapered work strings will require an additional pipe ram. The manifold shall comply with Onshore Oil and Gas Order #2 Attachment I (3M Diagrams of Choke Manifold Equipment). The accumulator system shall have an immediately available power source to close the rams and retain 200 psi above pre-charge. The pre-charge test shall follow requirements in Onshore Order #2.
12. **Subsequent sundry required detailing work done, C-102 form, and completion report with the new formation. Operator to include well bore schematic of current well condition when work is complete.**
13. **See attached for general requirements.**

**JAM 120616**

**BUREAU OF LAND MANAGEMENT**  
**Carlsbad Field Office**  
**620 East Greene Street**  
**Carlsbad, New Mexico 88220**  
**575-234-5972**

**Permanent Abandonment of Production Zone Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from this approval.

**If you are unable to plug back the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.**

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. For wells in Eddy County, call 575-361-2822. For wells in Lea County, call 575-393-3612

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class "C"**, for up to 7,500 feet of depth or **Neat Class "H"**, for deeper than 7,500 feet plugs.

6. **Subsequent Plug back Reporting:** Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date work was completed.**

7. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.