

Formy 3160-5 (June 2015)	UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT			OCD Hobbs		FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No.		
SUNDRY NOTICES AND REPORTS ON WELLS HOBBS O Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on page 2						7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well				REG	EIVE	8. Well Name and No. FEDERAL USA L	11	
2. Name of Operator	DERSON		9. API Well No.					
COG OPERAT	es.com		30-025-35913-00-S1					
3a. Address ONE CONCHO MIDLAND, TX	0. (include area code) 80-7161		10. Field and Pool or Exploratory Area TONTO					
4. Location of Well			11. County or Parish, State					
Sec 14 T19S F		LEA COUNTY, NM						
12. C	HECK THE AF	PPROPRIATE BOX(ES) TO	INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA	
TYPE OF SUI	BMISSION	-	TYPE OF	E OF ACTION				
Notice of Inte	ent	C Acidize	🗖 Dee	•	— .	ion (Start/Resume)	Uwater Shut-Off	
Subsequent R	Report	 Alter Casing Casing Repair 		raulic Fracturing Construction	□ Reclam		Well Integrity Other	
Final Abandonment Notice		Change Plans		g and Abandon		arily Abandon		
		Convert to Injection Du		Back 🔲 Water Disposal				
2. Spot 25 sx o 3. Spot 30 sx o 4. Spot 25 sx o	cmt @ 3150-295 cmt @ 1700-147 cmt @ 60' to sur	ressure test csg. Circ hole w 50'. WOC & Tag (B/Salt) 70'. WOC & Tag (T/Salt & 8 5 rface. t to surface, weld on Below C	5/8" Shoe)		8615-3415'			
					055 4		_	
	SEE ATTACHED FOR							
				CONDITIONS OF APPROVAL				
Below	910ur	d level d	14	hole r	Lat Ker	(requir	e ol	
14. I hereby certify t	hat the foregoing is	Electronic Submission #447	/ 916 verifie	d by the BLM Wel	I Information	n System		
For COG OPERATING LLC, sent to the Hobbs Committed to AFMSS for processing by DEBORAH MCKINNEY on 12/17/2018 (19DLM0194SE)								
Name (Printed/Typed) ABIGAIL ANDERSON Title AGENT								
Signature	(Electronic S	Submission)		Date 12/17/20	018			
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
Approved By	ames	C. anno		Title 50	ET	والمرابية ومراجع فمراجع فمرجع فالمراجع	12-19-18 Date	
Conditions of approval certify that the applican which would entitle the	Office CFO							
Title 18 U.S.C. Section	1001 and Title 43	U.S.C. Section 1212, make it a crin statements or representations as to a	ne for any po ny matter w	rson knowingly and ithin its jurisdiction.	willfully to ma	ake to any department or	agency of the United	
(Instructions on page 2)) ** BIM DE\//	ISED ** BLM REVISED **					D **	
		R RECORD O		- 1		OCD 1		

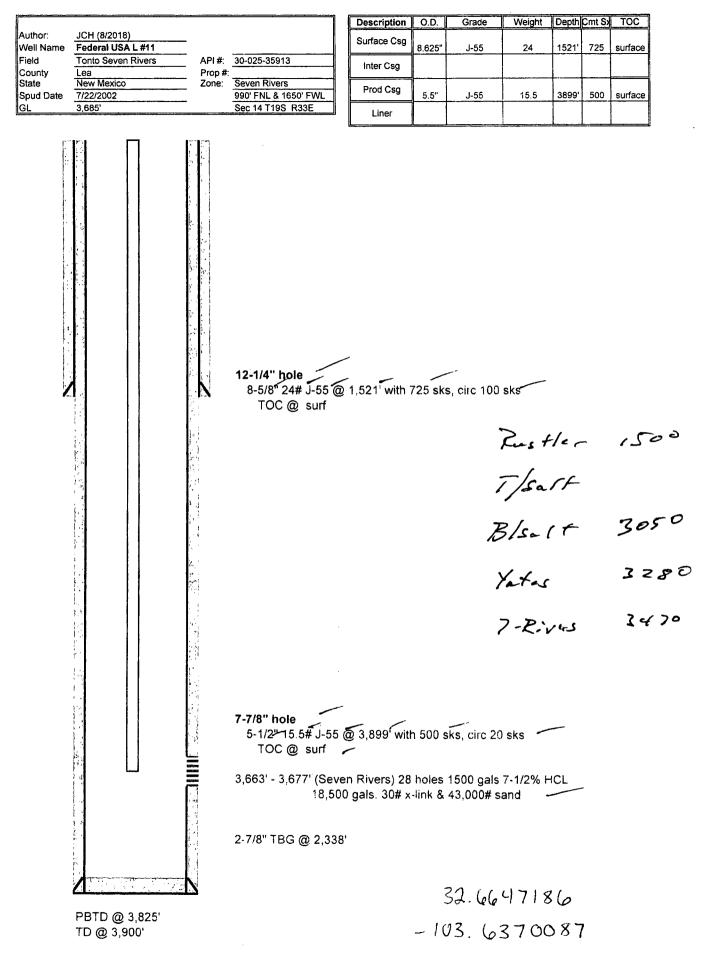

C:/Users/BCM/AppDatalc.ocal/Microsoft/Windows/INetCache/Conten: Outlock/KOU/YNCQ/Federal USA L 11 - WED

1

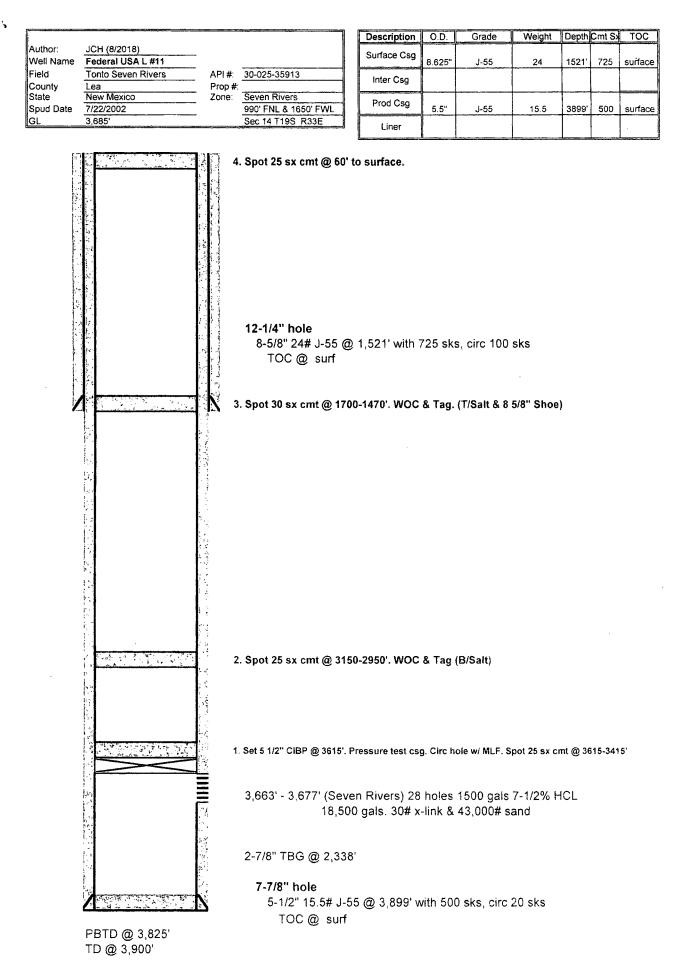

C:\Scans\COG Basin Project\Copy of Federal USA L 11 - WBD

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted