

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENTFORM APPROVED  
OMB NO. 1004-0137  
Expires: January 31, 2018**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.***SUBMIT IN TRIPLICATE - Other instructions on page 2**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other		5. Lease Serial No. NMNM89820	
2. Name of Operator COG OPERATING LLC		6. If Indian, Allottee or Tribe Name	
Contact: ABIGAIL ANDERSON E-Mail: abbyam@bcmadassociates.com		7. If Unit or CA/Agreement, Name and/or No.	
3a. Address ONE CONCHO CENTER 600 W ILLINOIS AVENUE MIDLAND, TX 79701-4287		8. Name and No. TUNTO FEDERAL 02	
3b. Phone No. (include area code) Ph: 432-580-7161		9. API Well No. 30-025-33590-00-S1	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 12 T19S R32E NESE 1980FSL 660FEL		10. Field and Pool or Exploratory Area TUNTO	
		11. County or Parish, State LEA COUNTY, NM	

**12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize <input type="checkbox"/> Deepen <input type="checkbox"/> Production (Start/Resume) <input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing <input type="checkbox"/> Hydraulic Fracturing <input type="checkbox"/> Reclamation <input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair <input type="checkbox"/> New Construction <input type="checkbox"/> Plug and Abandon <input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans <input type="checkbox"/> Plug Back
	<input type="checkbox"/> Convert to Injection

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface location and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

- Set 5 1/2" CIBP @ 7200'. Circulate hole w/ MLF. Pressure test csg. Spot 35 sx cmt @ 7200-6850'. WOC & Tag
- Spot 25 sx cmt @ 5950-5780'. WOC & Tag (Delaware)
- Spot 40 sx cmt @ 3500-3445'. WOC & Tag (Yates & Shoe) 3500' - 3115'
- Perf & Sqz 50 sx cmt @ 2855-2755'. WOC & Tag 2855' - 2727'
- Perf & Sqz 50 sx cmt @ 1700-1600'. WOC & Tag (T/Salt) 1700' - 1580'
- Perf & Sqz 120 sx cmt @ 560'-Surface.
- Cut off well head, verify cmt to surface, weld on Below Ground Dry Hole Marker.

**Carlsbad Field Office  
Operator Copy**

14. I hereby certify that the foregoing is true and correct. Electronic Submission #501814 verified by the BLM Well Information System For COG OPERATING LLC, sent to the Hobbs Committed to AFMSS for processing by DEBORAH MCKINNEY on 02/04/2020 (20DLM0254SE)	
Name (Printed Typed) ABIGAIL ANDERSON	Title AGENT
Signature (Electronic Submission)	Date 02/03/2020

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved By Long Vo [Signature]	Title Petroleum Engineer	Date 2/8/20
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office CFO

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*


**FOR RECORD ONLY**

XZ NMOC 3-11-20

Ref No	MRLS (7/2017)	Well No	#2
Well Name	Tonto Federal	API #	30 025 33500
County	Lca	Prop #	13589
State	New Mexico	Zone	009200e
Spud Date	7/5/1996		1900 FEL & 000 FEL
Well	3 661"		Sec 12 T19S R32E

Description	O D	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	13.375	J-55	48	509'	475	surface
Inter Csg	8.625	J-55	32 & 24	3,169'	1,000	surface
Prod Csg	5.5	J-55	17	7,597'	1,700	3,000
Lines						

Originally at  
Inter Resol  
Endurance P  
NOG task by

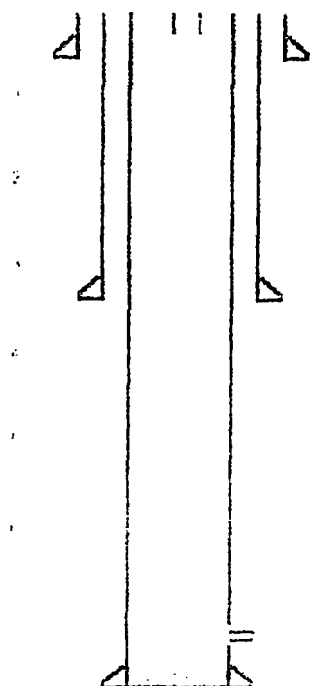

17 1/2" hole  
13 3/8" (48#) @ 509' with 48 sks. circ with 150 sks  
TOC @ surf

12 1/4" hole  
8 5/8" (24# & 32#) @ 3,169' with 1,000 sks. circ with 200 sks  
TOC @ surf

7 7/8" hole  
5 1/2" (17#) @ 7,597' with 1,700 sks  
Dis Tool @ 7,500' 700 sks. circ 1,000 sks  
TOC @ 7,500' 700 sks. circ 1,000 sks


Formation 1  
Top of Sap  
Bottom of 10  
Yates  
Queer  
Deaware  
Bou-Spring

11/10/96  
P. 10/1/96

1. 10/1/96 11/10/96 12/5/96 1/2/97 2/2/97 3/2/97 4/2/97 5/2/97 6/2/97 7/2/97 8/2/97 9/2/97 10/2/97 11/2/97 12/2/97 1/2/98 2/2/98 3/2/98 4/2/98 5/2/98 6/2/98 7/2/98 8/2/98 9/2/98 10/2/98 11/2/98 12/2/98 1/2/99 2/2/99 3/2/99 4/2/99 5/2/99 6/2/99 7/2/99 8/2/99 9/2/99 10/2/99 11/2/99 12/2/99 1/2/00 2/2/00 3/2/00 4/2/00 5/2/00 6/2/00 7/2/00 8/2/00 9/2/00 10/2/00 11/2/00 12/2/00 1/2/01 2/2/01 3/2/01 4/2/01 5/2/01 6/2/01 7/2/01 8/2/01 9/2/01 10/2/01 11/2/01 12/2/01 1/2/02 2/2/02 3/2/02 4/2/02 5/2/02 6/2/02 7/2/02 8/2/02 9/2/02 10/2/02 11/2/02 12/2/02 1/2/03 2/2/03 3/2/03 4/2/03 5/2/03 6/2/03 7/2/03 8/2/03 9/2/03 10/2/03 11/2/03 12/2/03 1/2/04 2/2/04 3/2/04 4/2/04 5/2/04 6/2/04 7/2/04 8/2/04 9/2/04 10/2/04 11/2/04 12/2/04 1/2/05 2/2/05 3/2/05 4/2/05 5/2/05 6/2/05 7/2/05 8/2/05 9/2/05 10/2/05 11/2/05 12/2/05 1/2/06 2/2/06 3/2/06 4/2/06 5/2/06 6/2/06 7/2/06 8/2/06 9/2/06 10/2/06 11/2/06 12/2/06 1/2/07 2/2/07 3/2/07 4/2/07 5/2/07 6/2/07 7/2/07 8/2/07 9/2/07 10/2/07 11/2/07 12/2/07 1/2/08 2/2/08 3/2/08 4/2/08 5/2/08 6/2/08 7/2/08 8/2/08 9/2/08 10/2/08 11/2/08 12/2/08 1/2/09 2/2/09 3/2/09 4/2/09 5/2/09 6/2/09 7/2/09 8/2/09 9/2/09 10/2/09 11/2/09 12/2/09 1/2/10 2/2/10 3/2/10 4/2/10 5/2/10 6/2/10 7/2/10 8/2/10 9/2/10 10/2/10 11/2/10 12/2/10 1/2/11 2/2/11 3/2/11 4/2/11 5/2/11 6/2/11 7/2/11 8/2/11 9/2/11 10/2/11 11/2/11 12/2/11 1/2/12 2/2/12 3/2/12 4/2/12 5/2/12 6/2/12 7/2/12 8/2/12 9/2/12 10/2/12 11/2/12 12/2/12 1/2/13 2/2/13 3/2/13 4/2/13 5/2/13 6/2/13 7/2/13 8/2/13 9/2/13 10/2/13 11/2/13 12/2/13 1/2/14 2/2/14 3/2/14 4/2/14 5/2/14 6/2/14 7/2/14 8/2/14 9/2/14 10/2/14 11/2/14 12/2/14 1/2/15 2/2/15 3/2/15 4/2/15 5/2/15 6/2/15 7/2/15 8/2/15 9/2/15 10/2/15 11/2/15 12/2/15 1/2/16 2/2/16 3/2/16 4/2/16 5/2/16 6/2/16 7/2/16 8/2/16 9/2/16 10/2/16 11/2/16 12/2/16 1/2/17 2/2/17 3/2/17 4/2/17 5/2/17 6/2/17 7/2/17 8/2/17 9/2/17 10/2/17 11/2/17 12/2/17 1/2/18 2/2/18 3/2/18 4/2/18 5/2/18 6/2/18 7/2/18 8/2/18 9/2/18 10/2/18 11/2/18 12/2/18 1/2/19 2/2/19 3/2/19 4/2/19 5/2/19 6/2/19 7/2/19 8/2/19 9/2/19 10/2/19 11/2/19 12/2/19 1/2/20 2/2/20 3/2/20 4/2/20 5/2/20 6/2/20 7/2/20 8/2/20 9/2/20 10/2/20 11/2/20 12/2/20 1/2/21 2/2/21 3/2/21 4/2/21 5/2/21 6/2/21 7/2/21 8/2/21 9/2/21 10/2/21 11/2/21 12/2/21 1/2/22 2/2/22 3/2/22 4/2/22 5/2/22 6/2/22 7/2/22 8/2/22 9/2/22 10/2/22 11/2/22 12/2/22 1/2/23 2/2/23 3/2/23 4/2/23 5/2/23 6/2/23 7/2/23 8/2/23 9/2/23 10/2/23 11/2/23 12/2/23 1/2/24 2/2/24 3/2/24 4/2/24 5/2/24 6/2/24 7/2/24 8/2/24 9/2/24 10/2/24 11/2/24 12/2/24 1/2/25 2/2/25 3/2/25 4/2/25 5/2/25 6/2/25 7/2/25 8/2/25 9/2/25 10/2/25 11/2/25 12/2/25 1/2/26 2/2/26 3/2/26 4/2/26 5/2/26 6/2/26 7/2/26 8/2/26 9/2/26 10/2/26 11/2/26 12/2/26 1/2/27 2/2/27 3/2/27 4/2/27 5/2/27 6/2/27 7/2/27 8/2/27 9/2/27 10/2/27 11/2/27 12/2/27 1/2/28 2/2/28 3/2/28 4/2/28 5/2/28 6/2/28 7/2/28 8/2/28 9/2/28 10/2/28 11/2/28 12/2/28 1/2/29 2/2/29 3/2/29 4/2/29 5/2/29 6/2/29 7/2/29 8/2/29 9/2/29 10/2/29 11/2/29 12/2/29 1/2/30 2/2/30 3/2/30 4/2/30 5/2/30 6/2/30 7/2/30 8/2/30 9/2/30 10/2/30 11/2/30 12/2/30 1/2/31 2/2/31 3/2/31 4/2/31 5/2/31 6/2/31 7/2/31 8/2/31 9/2/31 10/2/31 11/2/31 12/2/31 1/2/32 2/2/32 3/2/32 4/2/32 5/2/32 6/2/32 7/2/32 8/2/32 9/2/32 10/2/32 11/2/32 12/2/32 1/2/33 2/2/33 3/2/33 4/2/33 5/2/33 6/2/33 7/2/33 8/2/33 9/2/33 10/2/33 11/2/33 12/2/33 1/2/34 2/2/34 3/2/34 4/2/34 5/2/34 6/2/34 7/2/34 8/2/34 9/2/34 10/2/34 11/2/34 12/2/34 1/2/35 2/2/35 3/2/35 4/2/35 5/2/35 6/2/35 7/2/35 8/2/35 9/2/35 10/2/35 11/2/35 12/2/35 1/2/36 2/2/36 3/2/36 4/2/36 5/2/36 6/2/36 7/2/36 8/2/36 9/2/36 10/2/36 11/2/36 12/2/36 1/2/37 2/2/37 3/2/37 4/2/37 5/2/37 6/2/37 7/2/37 8/2/37 9/2/37 10/2/37 11/2/37 12/2/37 1/2/38 2/2/38 3/2/38 4/2/38 5/2/38 6/2/38 7/2/38 8/2/38 9/2/38 10/2/38 11/2/38 12/2/38 1/2/39 2/2/39 3/2/39 4/2/39 5/2/39 6/2/39 7/2/39 8/2/39 9/2/39 10/2/39 11/2/39 12/2/39 1/2/40 2/2/40 3/2/40 4/2/40 5/2/40 6/2/40 7/2/40 8/2/40 9/2/40 10/2/40 11/2/40 12/2/40 1/2/41 2/2/41 3/2/41 4/2/41 5/2/41 6/2/41 7/2/41 8/2/41 9/2/41 10/2/41 11/2/41 12/2/41 1/2/42 2/2/42 3/2/42 4/2/42 5/2/42 6/2/42 7/2/42 8/2/42 9/2/42 10/2/42 11/2/42 12/2/42 1/2/43 2/2/43 3/2/43 4/2/43 5/2/43 6/2/43 7/2/43 8/2/43 9/2/43 10/2/43 11/2/43 12/2/43 1/2/44 2/2/44 3/2/44 4/2/44 5/2/44 6/2/44 7/2/44 8/2/44 9/2/44 10/2/44 11/2/44 12/2/44 1/2/45 2/2/45 3/2/45 4/2/45 5/2/45 6/2/45 7/2/45 8/2/45 9/2/45 10/2/45 11/2/45 12/2/45 1/2/46 2/2/46 3/2/46 4/2/46 5/2/46 6/2/46 7/2/46 8/2/46 9/2/46 10/2/46 11/2/46 12/2/46 1/2/47 2/2/47 3/2/47 4/2/47 5/2/47 6/2/47 7/2/47 8/2/47 9/2/47 10/2/47 11/2/47 12/2/47 1/2/48 2/2/48 3/2/48 4/2/48 5/2/48 6/2/48 7/2/48 8/2/48 9/2/48 10/2/48 11/2/48 12/2/48 1/2/49 2/2/49 3/2/49 4/2/49 5/2/49 6/2/49 7/2/49 8/2/49 9/2/49 10/2/49 11/2/49 12/2/49 1/2/50 2/2/50 3/2/50 4/2/50 5/2/50 6/2/50 7/2/50 8/2/50 9/2/50 10/2/50 11/2/50 12/2/50 1/2/51 2/2/51 3/2/51 4/2/51 5/2/51 6/2/51 7/2/51 8/2/51 9/2/51 10/2/51 11/2/51 12/2/51 1/2/52 2/2/52 3/2/52 4/2/52 5/2/52 6/2/52 7/2/52 8/2/52 9/2/52 10/2/52 11/2/52 12/2/52 1/2/53 2/2/53 3/2/53 4/2/53 5/2/53 6/2/53 7/2/53 8/2/53 9/2/53 10/2/53 11/2/53 12/2/53 1/2/54 2/2/54 3/2/54 4/2/54 5/2/54 6/2/54 7/2/54 8/2/54 9/2/54 10/2/54 11/2/54 12/2/54 1/2/55 2/2/55 3/2/55 4/2/55 5/2/55 6/2/55 7/2/55 8/2/55 9/2/55 10/2/55 11/2/55 12/2/55 1/2/56 2/2/56 3/2/56 4/2/56 5/2/56 6/2/56 7/2/56 8/2/56 9/2/56 10/2/56 11/2/56 12/2/56 1/2/57 2/2/57 3/2/57 4/2/57 5/2/57 6/2/57 7/2/57 8/2/57 9/2/57 10/2/57 11/2/57 12/2/57 1/2/58 2/2/58 3/2/58 4/2/58 5/2/58 6/2/58 7/2/58 8/2/58 9/2/58 10/2/58 11/2/58 12/2/58 1/2/59 2/2/59 3/2/59 4/2/59 5/2/59 6/2/59 7/2/59 8/2/59 9/2/59 10/2/59 11/2/59 12/2/59 1/2/60 2/2/60 3/2/60 4/2/60 5/2/60 6/2/60 7/2/60 8/2/60 9/2/60 10/2/60 11/2/60 12/2/60 1/2/61 2/2/61 3/2/61 4/2/61 5/2/61 6/2/61 7/2/61 8/2/61 9/2/61 10/2/61 11/2/61 12/2/61 1/2/62 2/2/62 3/2/62 4/2/62 5/2/62 6/2/62 7/2/62 8/2/62 9/2/62 10/2/62 11/2/62 12/2/62 1/2/63 2/2/63 3/2/63 4/2/63 5/2/63 6/2/63 7/2/63 8/2/63 9/2/63 10/2/63 11/2/63 12/2/63 1/2/64 2/2/64 3/2/64 4/2/64 5/2/64 6/2/64 7/2/64 8/2/64 9/2/64 10/2/64 11/2/64 12/2/64 1/2/65 2/2/65 3/2/65 4/2/65 5/2/65 6/2/65 7/2/65 8/2/65 9/2/65 10/2/65 11/2/65 12/2/65 1/2/66 2/2/66 3/2/66 4/2/66 5/2/66 6/2/66 7/2/66 8/2/66 9/2/66 10/2/66 11/2/66 12/2/66 1/2/67 2/2/67 3/2/67 4/2/67 5/2/67 6/2/67 7/2/67 8/2/67 9/2/67 10/2/67 11/2/67 12/2/67 1/2/68 2/2/68 3/2/68 4/2/68 5/2/68 6/2/68 7/2/68 8/2/68 9/2/68 10/2/68 11/2/68 12/2/68 1/2/69 2/2/69 3/2/69 4/2/69 5/2/69 6/2/69 7/2/69 8/2/69 9/2/69 10/2/69 11/2/69 12/2/69 1/2/70 2/2/70 3/2/70 4/2/70 5/2/70 6/2/70 7/2/70 8/2/70 9/2/70 10/2/70 11/2/70 12/2/70 1/2/71 2/2/71 3/2/71 4/2/71 5/2/71 6/2/71 7/2/71 8/2/71 9/2/71 10/2/71 11/2/71 12/2/71 1/2/72 2/2/72 3/2/72 4/2/72 5/2/72 6/2/72 7/2/72 8/2/72 9/2/72 10/2/72 11/2/72 12/2/72 1/2/73 2/2/73 3/2/73 4/2/73 5/2/73 6/2/73 7/2/73 8/2/73 9/2/73 10/2/73 11/2/73 12/2/73 1/2/74 2/2/74 3/2/74 4/2/74 5/2/74 6/2/74 7/2/74 8/2/74 9/2/74 10/2/74 11/2/74 12/2/74 1/2/75 2/2/75 3/2/75 4/2/75 5/2/75 6/2/75 7/2/75 8/2/75 9/2/75 10/2/75 11/2/75 12/2/75 1/2/76 2/2/76 3/2/76 4/2/76 5/2/76 6/2/76 7/2/76 8/2/76 9/2/76 10/2/76 11/2/76 12/2/76 1/2/77 2/2/77 3/2/77 4/2/77 5/2/77 6/2/77 7/2/77 8/2/77 9/2/77 10/2/77 11/2/77 12/2/77 1/2/78 2/2/78 3/2/78 4/2/78 5/2/78 6/2/78 7/2/78 8/2/78 9/2/78 10/2/78 11/2/78 12/2/78 1/2/79 2/2/79 3/2/79 4/2/79 5/2/79 6/2/79 7/2/79 8/2/79 9/2/79 10/2/79 11/2/79 12/2/79 1/2/80 2/2/80 3/2/80 4/2/80 5/2/80 6/2/80 7/2/80 8/2/80 9/2/80 10/2/80 11/2/80 12/2/80 1/2/81 2/2/81 3/2/81 4/2/81 5/2/81 6/2/81 7/2/81 8/2/81 9/2/81 10/2/81 11/2/81 12/2/81 1/2/82 2/2/82 3/2/82 4/2/82 5/2/82 6/2/82 7/2/82 8/2/82 9/2/82 10/2/82 11/2/82 12/2/82 1/2/83 2/2/83 3/2/83 4/2/83 5/2/83 6/2/83 7/2/83 8/2/83 9/2/83 10/2/83 11/2/83 12/2/83 1/2/84 2/2/84 3/2/84 4/2/84 5/2/84 6/2/84 7/2/84 8/2/84 9/2/84 10/2/84 11/2/84 12/2/84 1/2/85 2/2/85 3/2/85 4/2/85 5/2/85 6/2/85 7/2/85 8/2/85 9/2/85 10/2/85 11/2/85 12/2/85 1/2/86 2/2/86 3/2/86 4/2/86 5/2/86 6/2/86 7/2/86 8/2/86 9/2/86 10/2/86 11/2/86 12/2/86 1/2/87 2/2/87 3/2/87 4/2/87 5/2/87 6/2/87 7/2/87 8/2/87 9/2/87 10/2/87 11/2/87 12/2/87 1/2/88 2/2/88 3/2/88 4/2/88 5/2/88 6/2/88 7/2/88 8/2/88 9/2/88 10/2/88 11/2/88 12/2/88 1/2/89 2/2/89 3/2/89 4/2/89 5/2/89 6/2/89 7/2/89 8/2/89 9/2/89 10/2/89 11/2/89 12/2/89 1/2/90 2/2/90 3/2/90 4/2/90 5/2/90 6/2/90 7/2/90 8/2/90 9/2/90 10/2/90 11/2/90 12/2/90 1/2/91 2/2/91 3/2/91 4/2/91 5/2/91 6/2/91 7/2/91 8/2/91 9/2/91 10/2/91 11/2/91 12/2/91 1/2/92 2/2/92 3/2/92 4/2/92 5/2/92 6/2/92 7/2/92 8/2/92 9/2/92 10/2/92 11/2/92 12/2/92 1/2/93 2/2/93 3/2/93 4/2/93 5/2/93 6/2/93 7/2/93 8/2/93 9/2/93 10/2/93 11/2/93 12/2/93 1/2/94 2/2/94 3/2/94 4/2/94 5/2/94 6/2/94 7/2/94 8/2/94 9/2/94 10/2/94 11/2/94 12/2/94 1/2/95 2/2/95 3/2/95 4/2/95 5/2/95 6/2/95 7/2/95 8/2/95 9/2/95 10/2/95 11/2/95 12/2/95 1/2/96 2/2/96 3/2/96 4/2/96 5/2/96 6/2/96 7/2/96 8/2/96 9/2/96 10/2/96 11/2/96 12/2/96 1/2/97 2/2/97 3/2/97 4/2/97 5/2/97 6/2/97 7/2/97 8/2/97 9/2/97 10/2/97 11/2/97 12/2/97 1/2/98 2/2/98 3/2/98 4/2/98 5/2/98 6/2/98 7/2/98 8/2/98 9/2/98 10/2/98 11/2/98 12/2/98 1/2/99 2/2/99 3/2/99 4/2/99 5/2/99 6/2/99 7/2/99 8/2/99 9/2/99 10/2/99 11/2/99 12/2/99 1/2/100 2/2/100 3/2/100 4/2/100 5/2/100 6/2/100 7/2/100 8/2/100 9/2/100 10/2/100 11/2/100 12/2/100 1/2/101 2/2/101 3/2/101 4/2/101 5/2/101 6/2/101 7/2/101 8/2/101 9/2/101 10/2/101 11/2/101 12/2/101 1/2/102 2/2/102 3/2/102 4/2/102 5/2/102 6/2/102 7/2/102 8/2/102 9/2/102 10/2/102 11/2/102 12/2/102 1/2/103 2/2/103 3/2/103 4/2/103 5/2/103 6/2/103 7/2/103 8/2/103 9/2/103 10/2/103 11/2/103 12/2/103 1/2/104 2/2/104 3/2/104 4/2/104 5/2/104 6/2/104 7/2/104 8/2/104 9/2/104 10/2/104 11/2/104 12/2/104 1/2/105 2/2/105 3/2/105 4/2/105 5/2/105 6/2/105 7/2/105 8/2/105 9/2/105 10/2/105 11/2/105 12/2/105 1/2/106 2/2/106 3/2/106 4/2/106 5/2/106 6/2/106 7/2/106 8/2/106 9/2/106 10/2/106 11/2/106 12/2/106 1/2/107 2/2/107 3/2/107 4/2/107 5/2/107 6/2/107 7/2/107 8/2/107 9/2/107 10/2/107 11/2/107 12/2/107 1/2/108 2/2/108 3/2/108 4/2/108 5/2/108 6/2/108 7/2/108 8/2/108 9/2/108 10/2/108 11/2/108 12/2/108 1/2/109 2/2/109 3/2/109 4/2/109 5/2/109 6/2/109 7/2/109 8/2/109 9/2/109 10/2/109 11/2/109 12/2/109 1/2/110 2/2/110 3/2/110 4/2/110 5/2/110 6/2/110 7/2/110 8/2/110 9/2/110 10/2/110 11/2/110 12/2/110 1/2/111 2/2/111 3/2/111 4/2/111 5/2/111 6/2/111 7/2/111 8/2/111 9/2/111 10/2/111 11/2/111 12/2/111 1/2/112 2/2/112 3/2/112 4/2/112 5/2/112 6/2/112 7/2/112 8/2/112 9/2/112 10/2/112 11/2/112 12/2/112 1/2/113 2/2/113 3/2/113 4/2/113 5/2/113 6/2/113 7/2/113 8/2/113 9/2/113 10/2/113 11/2/113 12/2/113 1/2/114 2/2/114 3/2/114 4/2/114 5/2/114 6/2/114 7/2/114 8/2/114 9/2/114 10/2/114 11/2/114 12/2/114 1/2/115 2/2/115 3/2/115 4/2/115 5/2/115 6/2/115 7/2/115 8/2/115 9/2/115 10/2/115 11/2/115 12/2/115 1/2/116 2/2/116 3/2/116 4/2/116 5/2/116 6/2/116 7/2/116 8/2/116 9/2/116 10/2/116 11/2/116 12/2/116 1/2/117 2/2/117 3/2/117 4/2/117 5/2/117 6/2/117 7/2/117 8/2/117 9/2/117 10/2/117 11/2/117 12/2/117 1/2/118 2/2/118 3/2/118 4/2/118 5/2/118 6/2/118 7/2/118 8/2/118 9/2/118 10/2/118 11/2/118 12/2/118 1/2/119 2/2/119 3/2/119 4/2/119 5/2/119 6/2/119 7/2/119 8/2/119 9/2/119 10/2/119 11/2/119 12/2/119 1/2/120 2/2/120 3/2/120 4/2/120 5/2/120 6/2/120 7/2/120 8/2/120 9/2/120 10/2/120 11/2/120 12/2/120 1/2/121 2/2/121 3/2/121 4/2/121 5/2/121 6/2/121 7/2/121 8/2/121 9/2/121 10/2/121 11/

Author: MRM (7/2017)  
 Well Name: Tonto Federal Well No. #2  
 Field: \_\_\_\_\_ API #: 30-025-33590  
 County: Lea Prop #: 13189  
 State: New Mexico Zone: Delaware  
 Spud Date: 7/5/1996 1980 FSL & 660 F  
 GL: 3,641' Sec 12 T19S R32E  
 KB

Description	O.D.	Grade	Weight	Depth	Cmt Sk	TOC
Surface Csg	13.375"	J-55	48	509'	475	surface
Inter Csg	8.625"	J-55	32 & 24	3,169'	1,000	surface
Prod Csg	5.5"	J-55	17	7,597'	1,700	3,000'
Liner						

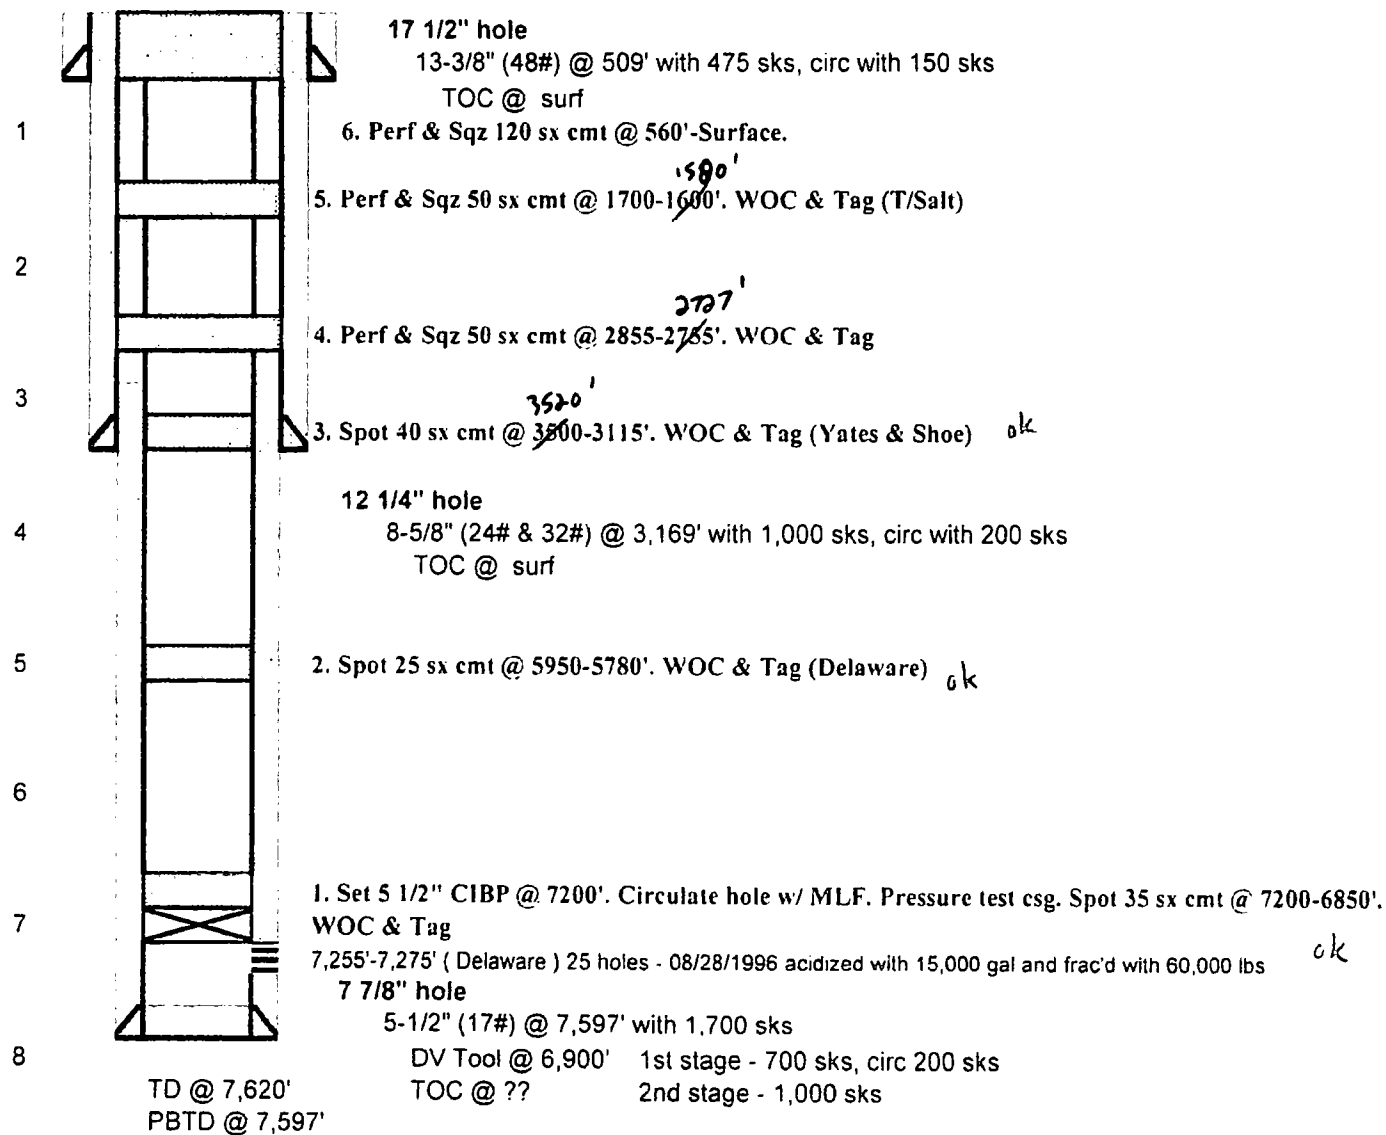

**BUREAU OF LAND MANAGEMENT**  
**Carlsbad Field Office**  
**620 East Greene Street**  
**Carlsbad, New Mexico 88220**  
**575-234-5972**

**Permanent Abandonment of Federal Wells**  
**Conditions of Approval (LPC Habitat)**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

**If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.**

**The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.**

2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

**Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:**

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



# United States Department of the Interior

## BUREAU OF LAND MANAGEMENT

Carlsbad Field Office  
620 E. Greene St.  
Carlsbad, New Mexico 88220-6292  
[www.blm.gov/nm](http://www.blm.gov/nm)



In Reply Refer To: 1310

### Reclamation Objectives and Procedures

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos  
Supervisory Petroleum Engineering Tech  
575-234-5909, 575-361-2648 (Cell)

• Arthur Arias  
Environmental Protection Specialist  
575-234-6230

Henryetta Price  
Environmental Protection Specialist  
575-234-5951

Shelly Tucker  
Environmental Protection Specialist  
575-234-5979

Trishia Bad Bear, Hobbs Field Station  
Natural Resource Specialist  
575-393-3612