SUNDRY	UNITED STATES DEPARTMENT OF THE INT BUREAU OF LAND MANAGE SUNDRY NOTICES AND REPORT Do not use this form for proposals to dr bandoned well. Use form 3160-3 (APD)		Operato r	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM19859 6. If Indian, Allottee or Tribe Name			
SUBMIT IN	7. If Unit or CA/Agreement, Name and/or No.						
1. Type of Well Oil Well Gas Well Oth	8. Well Name and No. GILA 4 DEEP 01						
2. Name of Operator COG OPERATING LLC	9. API Well No. 30-025-30872-00-S1						
3a. Address ONE CONCHO CENTER 60 MIDLAND, TX 79701-4287	0 W ILLINOIS AVENUE	3b. Phone No. (include are Ph: 575-748-6946	•	10. Field and Pool or JOHNSON RA			
4. Location of Well (Footage, Sec., 7	11. County or Parish,	State					
Sec 4 T25S R33E SWNE 197 32.161398 N Lat, 103.575182	LEA COUNTY, NM						
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICATE PAY	F NOTICE	, REPORT, OR OT	HER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION						
☐ Notice of Intent	☐ Acidize ☐ Deepen ☐ Produ		tion (Start/Resume)	☐ Water Shut-Off			
	Alter Casing	☐ Hydraulic Fract	turing 🔲 Reclan	nation	■ Well Integrity		
Subsequent Report	Casing Repair	□ New Construction	ion 🔲 Recom	plete	C Other		
☐ Final Abandonment Notice	Change Plans	Plug and Aband	lon 🔲 Tempo	rarily Abandon			
	Convert to Injection	Injection Plug Back Wate		Disposal			
13. Describe Proposed or Completed Op If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involved testing has been completed. Final Al determined that the site is ready for	ally or recomplete horizontally, rk will be performed or provide I operations. If the operation re bandonment Notices must be fil	give subsurface locations and the Bond No. on file with BI sults in a multiple completion	i measured and true v LM/BIA Required so or recompletion in a	rertical depths of all perti- absequent reports must be new interval, a Form 316	nent markers and zones, e filed within 30 days 60-4 must be filed once		
01/23/20 MIRU plugging equi well head, picked up buttress survey to 14,162'. Began RIH break circulation. Spotted 35, not set 4 1/2" CIBP @ 12,863	tbg, NU well head. 01/28 w/ tbg. 01/30/20 Tagged ax class H cmt @ 14,162 . POH & RD Rotary Wire	/20 POH w/ tbg, 01/29/2 existing CIBP @ 14,16; 13,627', 01/31/20 RU ro line, RIH w/ tbg & tagge	O Completed gyn 2', Pump'd 80 BBI otary wireline. Cou d out @ 13.109'	o La to uld Could	MATION PROCEDURE ATTACHED		
not work past 13,109', Spotter WOC. 02/03/20 Tagged plug. Spotted 40 sx class H cmt @ Perfd cso @ 9270', Set 7" pa H cmt @ 9320-9013', WOC. 01500 PSt. Spotted 45 sx class 5300', Pressured up on perfs.	1 40 sx class H cmt @ 13 @ 12.803*. Circulated hol 12.803-12.576*. Spotted cker @ 1500*& pressure 2/06/20 Tagged plug @ 9 5 C cmt @ 8650-6374*. W	, 109-12, 498' per Jim Ac e w/ MLF. Pressure tesi 40 sx class H. cmf @ 12 1 up on perfs to 1500 Pt 9053'. Perf d csg @ 66 OC. 02/07/20 Tagged p	nos w/ BLMs req ed csg. held 600 260-12 033: 024 SI. Spotled 50 sx 0'. Pressured up luc @ 6405: Per	vest. RE Est. ALZO Class on perfs to rd cso 60	CLAMATIO		

14. I hereby certify that the	ne foregoing is true and correct. Electronic Submission #506216 verific For COG OPERATING Committed to AFMSS for processing by PR	LLC. se	nt to the Hobbs	3	•				
Name (Printed/Typed)	DELILAH FLORES	Title	REGULATOR	RY TECH	IIVIS	AFOTED	ΓΛ	ם מרס	200
Signature	(Electronic Submission)	Date	03/09/2020		AU	CEPTEU	TU	K KEU	טאט
THIS SPACE FOR FEDERAL OR STATE OFFICE US						MAR	10	2020	
Approved By		Title		F _		SUREAU OF L CARLSBA	ודטווא		NT _
certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon		Office		<i>0</i>	20				

(Instructions on page 2) ** BLM REVISED **

27 Nm00D 3-27-20

Additional data for EC transaction #506216 that would not fit on the form


32. Additional remarks, continued

w/ wireline, perfd csg @ 3761' & tagged plug @ 4895' Established an Injection rate of 2 SPM @ 1500 PSI. Sqz'd 50 sx class C cmt w/ 2% CACL @ 3761-3800' WOC. Tagged plug @ 3615' Perfd csq @ 1400' Established an injection rate of 2-3 BPM @ 400 PSI. Sqz'd 70-sx class C cmt @ 1400-1225' WOC.02/11/20)Tagged plug @ 1195' Perfd csq @ 700', Pressured up on parfs Perfd csq @ 698'. Established injection rate of 2-3 BPM @ 600 PSI. Sqz'd 50 sx class C cmt @ 698-575' WOC. Tagged plug @ 590'. Perfd csq @ 100'. Established injection rate of 2-3 BPM @ 300 PSI. Sqz'd 50 sx class C cmt @ 698-575' WOC. Tagged plug @ 590'. Perfd csq @ 100'. Established injection rate of 2-3 BPM @ 300 PSI. Sqz'd 50 sx class C cmt @ 100' & circualted to surface. Rigged down & moved off.

Welder, Began to cut off well head but ran out of oxygen. Stopped job. 02/18/20 Cut off well head and verified cmt to surface. Welded on "Below Ground Dry Hole Marker". Backfilled cellar cut off deadmen, cleaned location, and moved off.



Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm

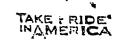

In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1 The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1
- 2 For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3 The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4 Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan
Environmental Protection Specialist
575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

BUREAU OF LAND MANAGEMENT

Carisbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Notice of Change to Procedure - Please Read

To All Operators,

This is to notify you that the Bureau of Land Management (BLM) Carlsbad Field Office will no longer be supplying copies of <u>sundries</u> (3160-5), <u>applications for permit to drill (APDs)</u>, <u>or completion reports</u> (3160-4) to the New Mexico Oil Conservation Division (NMOCD).

Effective immediately, to be in compliance with C-104 requirements, the NMOCD is requiring operators to submit a copy of any sundries, APDs, or completion reports processed by the BLM. This change will affect all BLM sundries, APDs, and completion reports in Eddy and Lea counties.

If a copy of a previously processed sundry, APD, or completion report is needed for submission to NMOCD, the Carlsbad Field Office will send a copy to the operator.

If you have any questions, please contact Jonathon Shepard (BLM) 575-234-2237.

Thank you

Note: This notice is being included in multiple communications from the BLM Carlsbad Field Office and you may receive multiple copies.