

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 811 South First, Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-025-24976
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other	7. Lease Name or Unit Agreement Name: Caldonia
	8. Well No. #1
2. Name of Operator Hanson Operating Company, Inc.	9. Pool name or Wildcat Eidson Queen
3. Address of Operator P. O. Box 1515, Roswell, NM 88202-1515	

4. Well Location
 Unit Letter N : 660 feet from the South line and 1980 feet from the West line
 Section 11 Township 16S Range 34E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 4082.9 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

02/11/2002: TIH with CIBP and set at 3990'. Top with 7 sacks cement. PU tubing to 2900'.
 Mix 114 sacks of salt gel.
 Set Plug #2 at 2900'-2800' with 15 sacks cement.
 Set Plug #3 at 1800'-1700' with 15 sacks cement.
 Perf 2 holes at 420'. Squeeze with 35 sacks cement. Tag at 365' in 4 hours.
 Set Surface Plug at 60' to Surface with 9 sacks cement.

02/14/2002: Cut off wellhead and anchors. Set Dry Hole Marker. Well is Plugged and Abandoned.

02/18/2002: Cleaned, leveled and reclaimed location. Location is ready for final inspection.

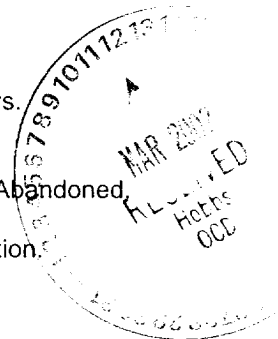

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carol J. Garcia TITLE Production Analyst DATE 3/11/02

Type or print name Carol J. Garcia Telephone No. (505) 622-7330

APPROVED BY Billy E. Pruhar TITLE COMPLIANCE OFFICER DATE 3/11/02

Conditions of approval, if any: gd

JCS
 BWW