

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N.M. Oil & Gas Division  
1625 N. French Dr.  
Hobbs, NM 88240

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

Lease Designation and Serial No.  
LC062391

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Saga Petroleum LLC

3. Address and Telephone No.

415 W. Wall, Suite 1900, Midland, TX 79701 (915) 684-4293

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

990' FSL & 330' FWL  
Sec 34 (M) T-17-S R33E

T17S

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Wyatt "A" Fed #2

9. API Well No.

30-025-01394

10. Field and Pool, or Exploratory Area

Corbin Queen

11. County or Parish, State

Lea, New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION


- ☒ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other

- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

11-26-02 Mix mud & circ. hole.  
11-26-02 Spot 25 sx cmt. on CIBP @ 3890'.  
11-26-02 Perf 4 holes @ 2050', set pkr. @ 1800', pressure up to 1000 PSI, held.  
11-26-02 Spot 25 sx cmt. @ 2100'.  
11-27-02 Tag plug @ 1945'.  
11-27-02 Cut 7" csg. @ 1450'.  
12-02-02 Spot 60 sx cmt. @ 1500', tag in the AM.  
12-03-02 Tagged plug @ 1302', perf. 4 holes @ 350', set pkr. @ 30', pumped 200 sx cmt.  
12-04-02 Tag plug @ 170'. Perf 4 holes @ 50', set pkr. @ 3', pump 50 sx cmt. tag @ 3'.  
12-04-02 Cut off wellhead, install dry hole marker, clean location, RDMO.

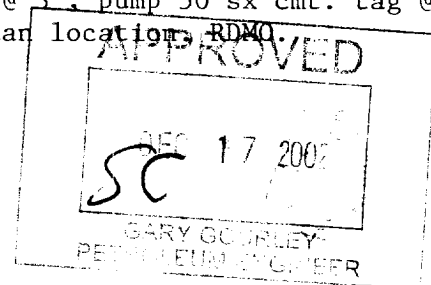

14. I hereby certify that the foregoing is true and correct

Signed \_\_\_\_\_ Title Agent Date 12/11/02

(This space for Federal or State office use)

Approved by \_\_\_\_\_ Title \_\_\_\_\_ Date \_\_\_\_\_  
Conditions of approval, if any