

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO 30-025-02108
Indicate Type of Lease STATE ☒ FEE ☐
State Oil & Gas Lease No

Lease Name or Unit Agreement Name Bridges State
Well No. 24W
Pool name or Wildcat Vacuum Field

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
Type of Well OIL WELL ☐ GAS WELL ☐ OTHER Injection ☐	
Name of Operator Mobil Exploration & Producing U.S., Inc. Permian Oil	
Address of Operator P.O. Box 833, 500 W. Illinois, Midland, Texas 79705	
Well Location Unit Letter <u>M</u> : <u>660</u> Feet From The <u>FWL</u> Line and <u>660</u> Feet From The <u>FSL</u> Line Section <u>13</u> Township <u>T-17-S</u> Range <u>R-34-E</u> NMPM <u>Lea</u> County	
Elevation (Show whether DF, RKB, RT, GR, etc.) 4021'	

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐
 OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
 CASING TEST AND CEMENT JOB ☐
 OTHER: ☐

Describe Proposed or Completed Operations: (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1) Notify OCD of intent to plug
- 2) MIRU, NU/BOP
- 3) Set CIBP @ 4400' and cap w/ 25 sx cement
- 4) Mix and circulate 10# mud
- 5) Spot 30 sx cement across liner top (4149) fm 4100-4200, WOC/tag
- 6) Spot 25 sx cement fm 2800-2900 (base of salt)
- 7) Spot 25 sx cement fm 1750-1850 (top of salt)
- 8) Spot 25 sx cement fm 778-878 (shoe) WOC/tag - PERF 878' 50' IN + OUT
- 9) Spot 10 sx cement fm 50 to surface
- 10) RDMO, cut off well head, install dry hole marker, cut off anchors, clean location

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Prod. Foreman DATE 1/24/00

TYPE OR PRINT NAME [Signature] TELEPHONE NO. [Blank]

(This space for State Use)

APPROVED BY [Signature] TITLE [Blank] DATE [Blank]

CONDITIONS OF APPROVAL, IF ANY [Blank]

1718


May 2000
Received
Pittman
Ga

1718

01110100


VIII. WELLBORE DIAGRAMS

A. CURRENT CONFIGURATION

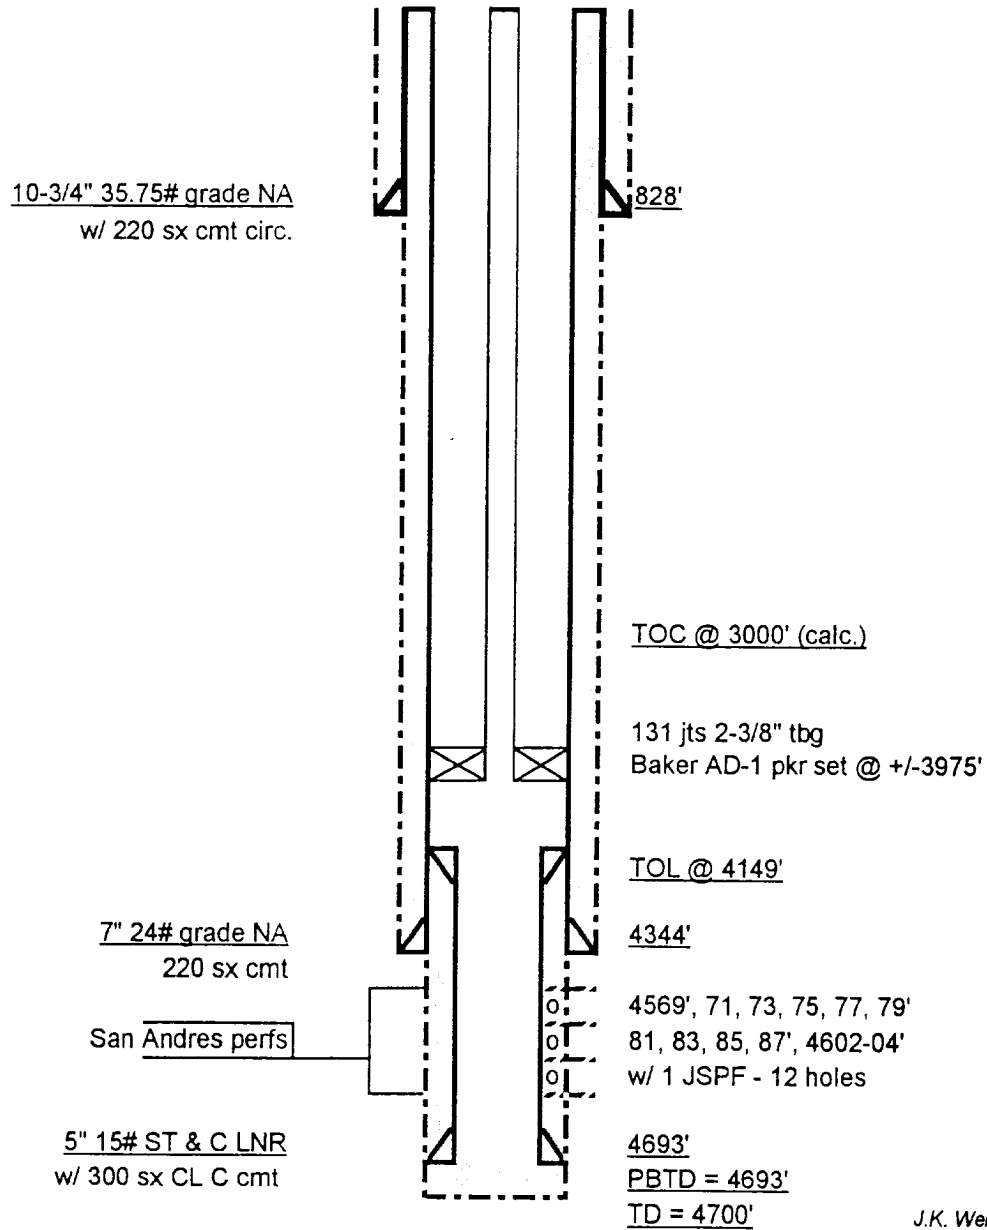

J.K. Wells
8/13/99

B. PROPOSED CONFIGURATION

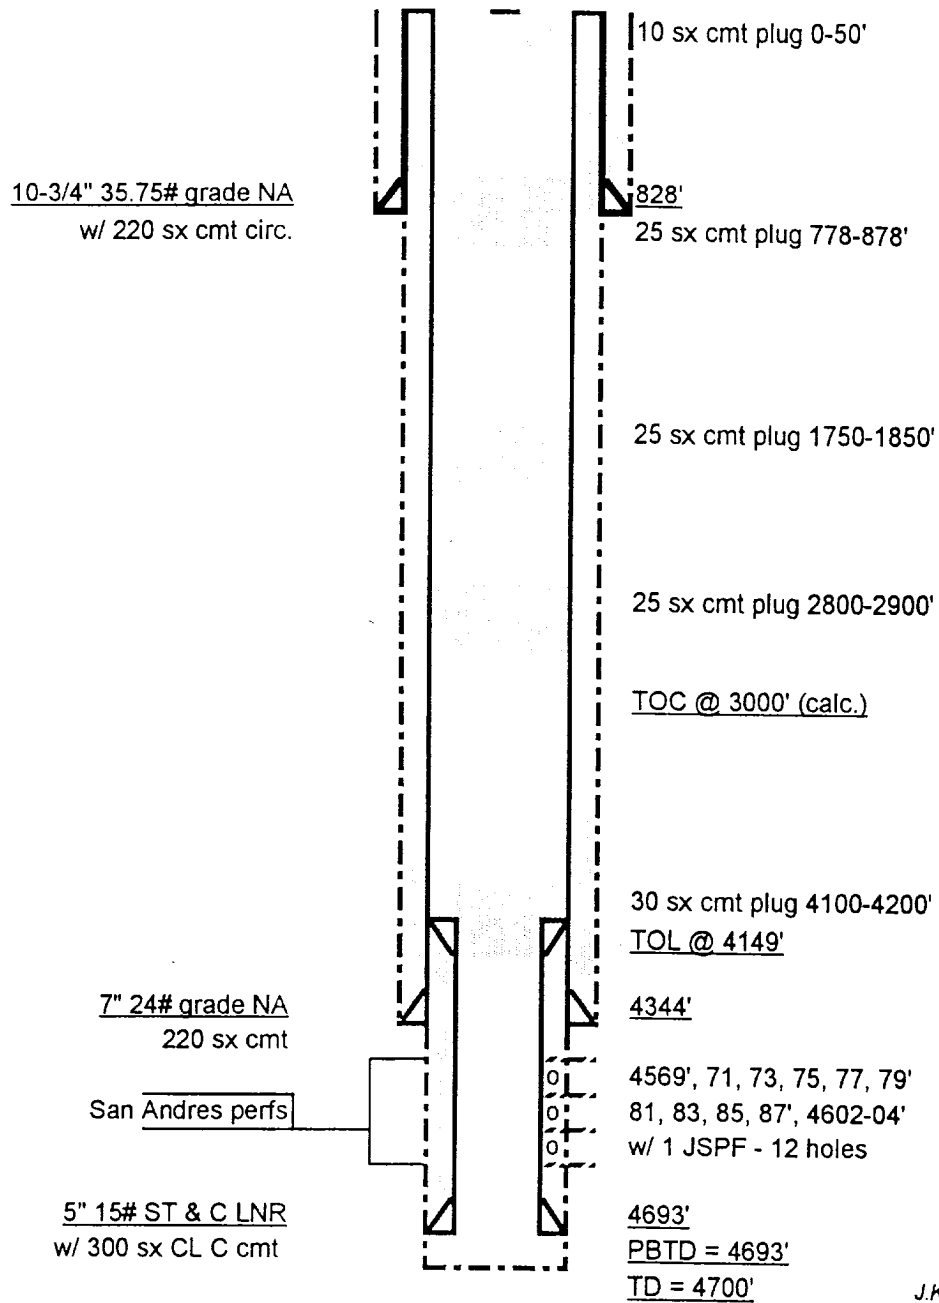

J.K. Wells
8/13/99