

Submit 3 Copies To Appropriate District Office  
 District I  
 1625 N. French Dr., Hobbs, NM 87240  
 District II  
 811 South First, Artesia, NM 87210  
 District III  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV  
 2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

Form C-103  
 Revised March 25, 1999

OIL CONSERVATION DIVISION  
 2040 South Pacheco  
 Santa Fe, NM 87505

WELL API NO. <b>30-025-05756</b>
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: <b>Elliott State</b>
8. Well No. <b>4</b>
9. Pool name or Wildcat <b>Eumont; Y. SR. On</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other
2. Name of Operator <b>Marathon Oil Company</b>
3. Address of Operator <b>PO Box 2490 Hobbs, NM 88240</b>
4. Well Location Unit Letter <b>P</b> : <b>660</b> feet from the <b>South</b> line and <b>660</b> feet from the <b>East</b> line Section <b>30</b> Township <b>19-S</b> Range <b>37-E</b> NMPM County <b>Lea</b>
10. Elevation (Show whether DR, RKB, RT, GR, etc.) <b>GL 3606' KB 3615'</b>

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK  PLUG AND ABANDON   
 TEMPORARILY ABANDON  CHANGE PLANS   
 PULL OR ALTER CASING  MULTIPLE COMPLETION

SUBSEQUENT REPORT OF:

- REMEDIAL WORK  ALTERING CASING   
 COMMENCE DRILLING OPNS.  PLUG AND ABANDONMENT   
 CASING TEST AND CEMENT JOB


OTHER:  OTHER: **Set Plug and Test Upper Eumont**

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

**This well was previously shut-in.**

- 10/3 RU pulling unit. ND wellhead. NU BOP. Attempt to rel pkr at 3078'. RIH w/chemical cutter, cut 8' above pkr. POOH w/tbg. Make several attempts to retrieve pkr.  
 10/8 Recover pkr. POOH. RIH, clean out to 3610' (CIBP). POOH.  
 10/10 RIH w/production assy. Blanking plug run in place w/sliding sleeve open to test upper Eumont. Swabbed. Well would not flow. ND BOP. Set pkr at 3089'. NU wellhead. RD pulling unit.  
 10/19 RU wireline. Pulled plug from F Nipple. Placed well on production.

Sliding Sleeve at 3081'  
 Pkr at 3089'  
 SN at 3343'  
 Btm of tbg 3347'

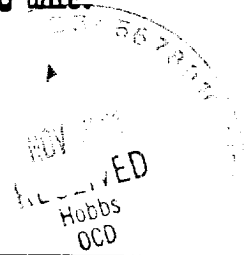

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kelly Cook TITLE Admin. Assistant DATE Oct. 29, 2001

Type or print name Kelly Cook Telephone No. 393-7106

(This space for State use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

Conditions of approval, if any: