

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

SHACKELFORD OIL COMPANY

3. Address and Telephone No.

P. O. BOX 10665 MIDLAND, TX 79702

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

SW/NE SECTION 23 T20S R33E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

**TYPE OF SUBMISSION**

☒ Notice of Intent  
☒ Subsequent Report  
☐ Final Abandonment Notice


**TYPE OF ACTION**

☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☒ Other \_\_\_\_\_  
☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all mearkers and zones pertinent to thei work.)\*

SEE ATTACHED REPORT

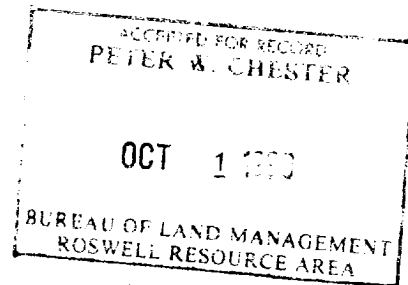

14. I hereby certify that the foregoing is true and correct

Signed

Title

PRESIDENT

Date

AUGUST 12, 1999

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

RECEIVED

AUG 16 '99

BLM  
ROSWELL, NM

**South Teas Federal #1  
Well Report**

- 8/09/99**      **Move rig in, Rig Up. POOH w/rods. Rod parted at 66 jts. GIH w/fishing tool. Could not get below 200'. POOH, paraffin on tool. GIH w/knife on wireline, unable to get through. GIH w/knife on rods, got through, went to 2000'. POOH w/knife, paraffin thick on last 600'. GIH w/fishing tool. Got on bottom, unseated pump. Reseated pump. Hooked up pump truck, tested tubing. Held at 150 Psi. Tubing OK. Hot oil down tubing w/20 BBLS. Hot oil down casing w/50 BLS. POOH w/rods and pump. Take pump to Hobbs to test. SDFD**
- 8/10/99**      **Changed ball and seats on pump. Pump back to location. Haul 2 rods and 2 jts. Of tubing to location. GIH w/pump and rods. Load tubing. Put well back to pumping. Well pumped up. Rig down Key Well Service.**
- 5