

Submit 1 Copy To Appropriate District Office  
District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources  
OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505  
RECEIVED  
NOV 19 2012

Form C-103  
Revised August 1, 2011

WELL API NO. <b>30-025-03636</b>	
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name <b>Pray SWD</b>	
8. Well Number <b>002</b>	
9. OGRID Number <b>21566</b>	
10. Pool name or Wildcat <b>SWD; Devonian</b>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

**Stearns propose to plug and abandon as follows**  
Clean out as needed to 12195' x Spot 25sx cmt plug x Pull tubing x WOC x Tag cmt plug x 12095' or above x Displace well with gelled brine water x Spot 25sx cmt plug at 10765' x Pull tubing x Perforate at 7470' x Squeeze w/ 35 sx cmt x WOC X tag plug Cut and pull 5 1/2" casing from 4185' or - x Spot 50 sx cmt at 4135' (Casing stub and Intermediate Shoe plug)  
WOC x tag plug 4085' or above x Pull tubing to 2770' (Base of Salt) x spot 30sx cmt plug x Pull tubing to 2270' (Top of Salt) Spot 30sx cmt plug x Pull tubing to 1375' (8 5/8" casing stub) Spot 45sx cmt x Pull tubing x WOC x tag plug at 1275' or above Pull tubing to 382' (Surface casing shoe) x Spot 50sx cmt x Pull tubing x WOC x tag plug at 282' or above  
Pull tubing to 60' x Circulate cement to surface x 30sx cmt  
Cut off well head and service unit anchors x Clean and level location for release  
Enclosed before and after well diagrams x C144 CLEZ

Oil Conservation Division - Hobbs office: **Must be Notified 24 hours prior** to the beginning of Plugging Operations begin.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*Billy E. Prichard*

TITLE Agent for Stearns

DATE 11/15/2012

Type or print name **Billy E. Prichard**  
For State Use Only

E-mail address: [billy@pwlcc.net](mailto:billy@pwlcc.net)

PHONE: 432-934-7680

APPROVED BY:

*[Signature]*

TITLE

*Dist. Mgr.*


DATE 11-20-2012

Conditions of Approval (if any):

NOV 29 2012

*Chm*

John R. Stearns dba Stearns  
 Pray SWD # 2  
 API # 30-025-03636  
 660 FNL X 1980 FWL  
 Unit Letter C, Section 5, T10S, R36E  
 Lea County, New Mexico  
 Prior to Plug and Abandonment

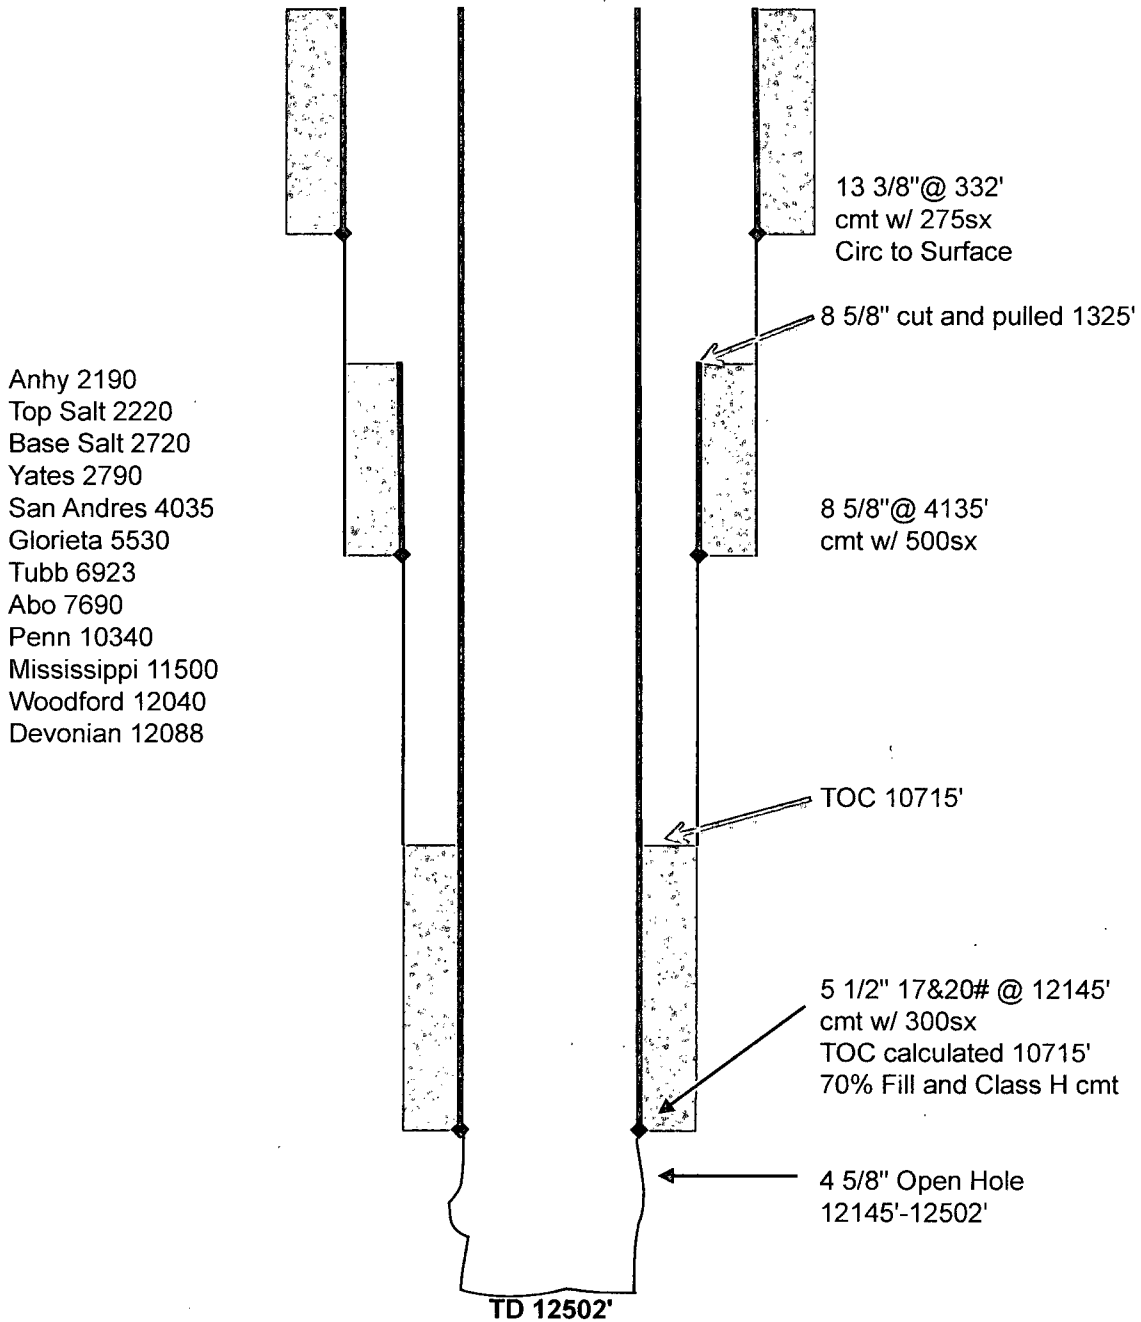


Drawing not to scale

BEP

[www.pwllc.net](http://www.pwllc.net)

John R. Stearns dba Stearns  
 Pray SWD # 2  
 API # 30-025-03636  
 660 FNL X 1980 FWL  
 Unit Letter C, Section 5, T10S, R36E  
 Lea County, New Mexico  
 After Plug and Abandonment

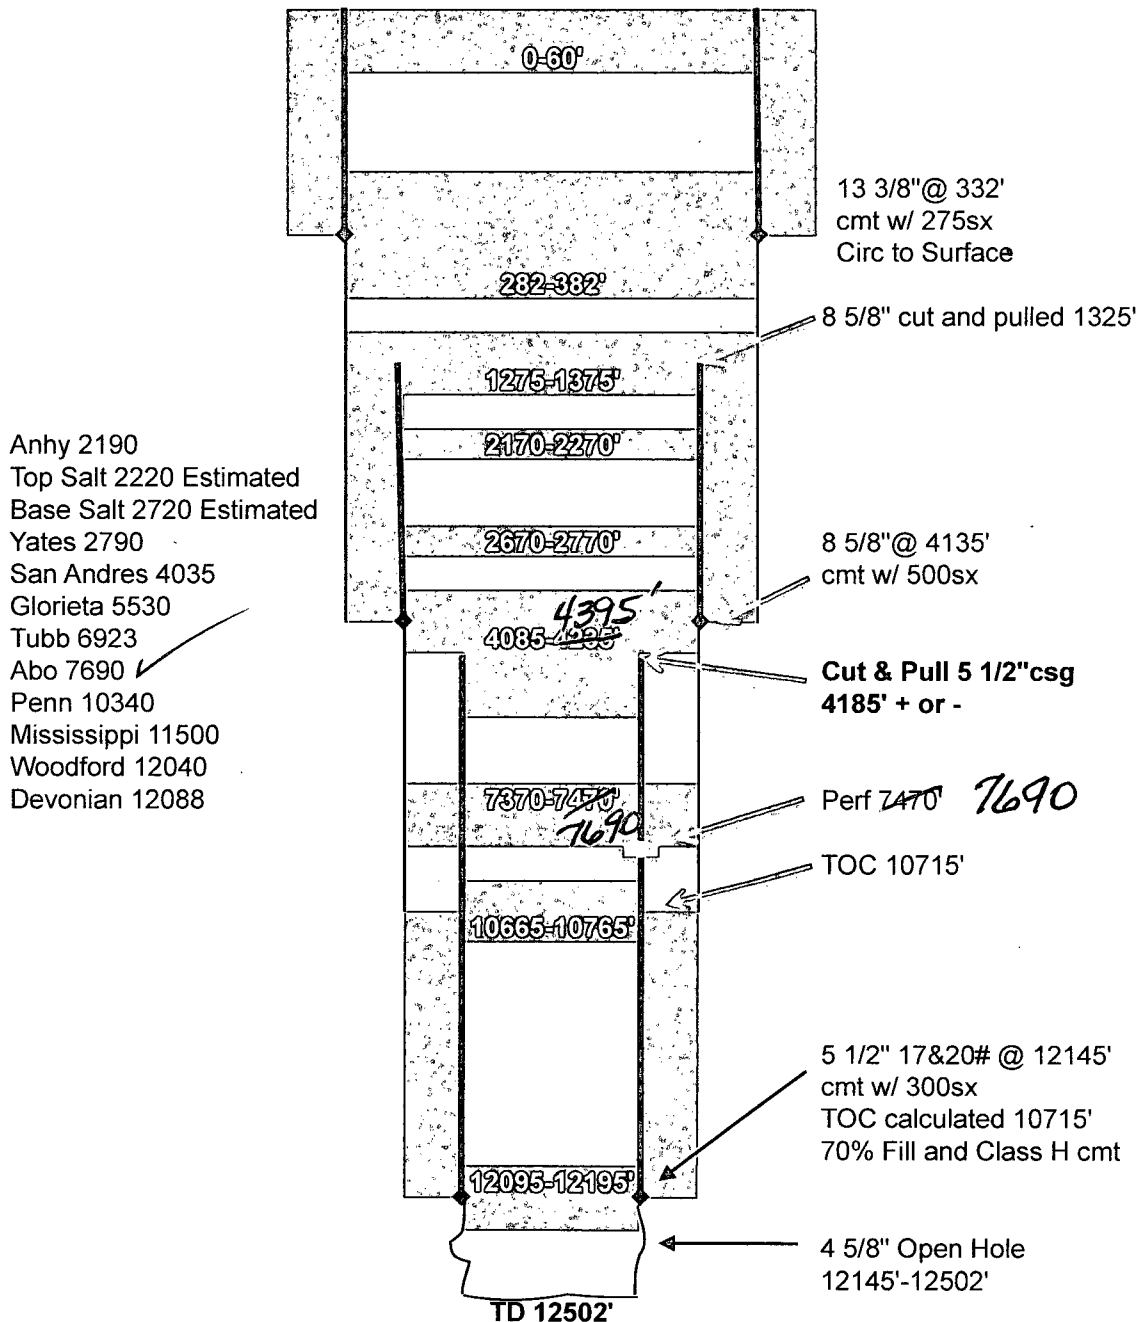

Drawing not to scale

BEP

[www.pwllc.net](http://www.pwllc.net)