Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

Expires: July 31,
Lease Serial No.
NMNM7488

5.

SUNDRY N	OTICES AND	REPORTS (ON WELLS
Do not use this	form for propo	sals to drill o	r to re-enter an
abandoned well.	Use form 3160	0-3 (APD) for .	such proposals

6. If Indian, Allottee or Tribe Name

abandoned we	n. Use lottii 3100-3 (Ar.	D) IOI SUCII	oroposais.				
SUBMIT IN TRIPLICATE - Other instructions on reverse side.				7. If Unit or CA/Agree	ment, Name and/or No.		
1. Type of Well ☑ Gas Well ☑ Øther					8. Well Name and No. MYERS LANGLIE	MATTIX UNIT 267	
2. Name of Operator Contact: DAVID STEWART OXY USA WTP LP E-Mail: david_stewart@oxy.com					9. API Well No. 30-025-32591		
3a. Address 3b. Phone No. P.O. BOX 50250 Ph: 432-68 MIDLAND, TX 79710 Fx: 432-68					10. Field and Pool, or Exploratory LANGLIE MATTIX 7R QN GB		
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)	· · · · · · · · · · · · · · · · · · ·		11. County or Parish, a	and State	
Sec 6 T24S R37E NWNE 190 32.253060 N Lat, 103.198180			LEA COUNTY, NM				
12. CHECK APPR	ROPRIATE BOX(ES) TO	DINDICATE	E NATURE OF N	NOTICE,	REPORT, OR OTHER	RDATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent □ □ □ □ □ □ □	☐ Acidize ☐ Alter Casing	☐ Dee	pen cture Treat	☐ Produ	uction (Start/Resume) nmation	☐ Water Shut-Off ☐ Well Integrity	
☐ Subsequent Report	□ Casing Repair	□ Nev	v Construction	☐ Reco	mplete	☐ Other	
☐ Final Abandonment Notice	□ Change Plans	s 💆 Plug and Abandon 🗖 T		☐ Temp	oorarily Abandon		
	□ Convert to Injection	onvert to Injection		■ Wate	r Disposal		
If the proposal is to deepen directiona Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab determined that the site is ready for fi TD-3882' PBTD-3825' Pe 8-5/8" 24# csg @ 396' w/ 260s 5-1/2" 15.5# csg @ 3881' w/ 9 10# MLF between plugs 1. RIH & set CIBP @ 3483' M& 2. M&P 35sx cmt @ 2990-275 3. M&P 25sx cmt @ 1275-112 4. M&P 65sx @ 446' to surface	k will be performed or provide operations. If the operation resonandonment Notices shall be file half inspection.) erfs-3533-3808' exts. 12-1/4" hole, TOC-Sur 00sx, 7-7/8" hole, TOC-S &P 40sx cmt to 3225' 0' WOC-Tag 5' WOC-Tag	the Bond No. o sults in a multiped only after all	n file with BLM/BIA le completion or reco requirements, including HOBBS OC JUL 0 5 20 RECEIVEL	Required in pletion in ing reclama: SE 13 CC	subsequent reports shall be fa new interval, a Form 3160 tion, have been completed, a SE ATTACHED FOR INDITIONS OF RECLAMATION PROATTACHED	FILED WITHIN 30 days 1-4 shall be filed once and the operator has FOR APPROVAL OCEDURE	
Name(Printed/Typed) DAVID ST	For OX' Committed to AFMSS for	/ USA WTP L	P, sent to the Hob by KURT SIMMOI	bs NS on 06/1	•		
Signature (Electronic S	ubmission)		Date 06/13/20)13			
	THIS SPACE FO	R FEDERA	L OR STATE (OFFICE	USE		
Approved By James a- Como			Title SE	PS		7-1-13 Date	
conditions of approval, if any, are attached. Approval of this notice does not warrant or errify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office CFT				
itle 18 U.S.C. Section 1001 and Title 43 U.S. States any false, fictitious of flaudulary st	J.S.C.—Section LD, make it a catatements or representations as	crime for any pe	rson knowingly and thin its jurisdiction.	willfully to	make to any department or a	gency of the United	


OXY USA WTP LP - Proposed Myers Langlie Mattix Unit #267 API No. 30-025-32591

65sx @ 446'-Surface

25sx @ 1275-1125' WOC-Tag

35sx @ 2990-2750' WOC-Tag

CIBP @ 3483' w/ 40sx to 3225'

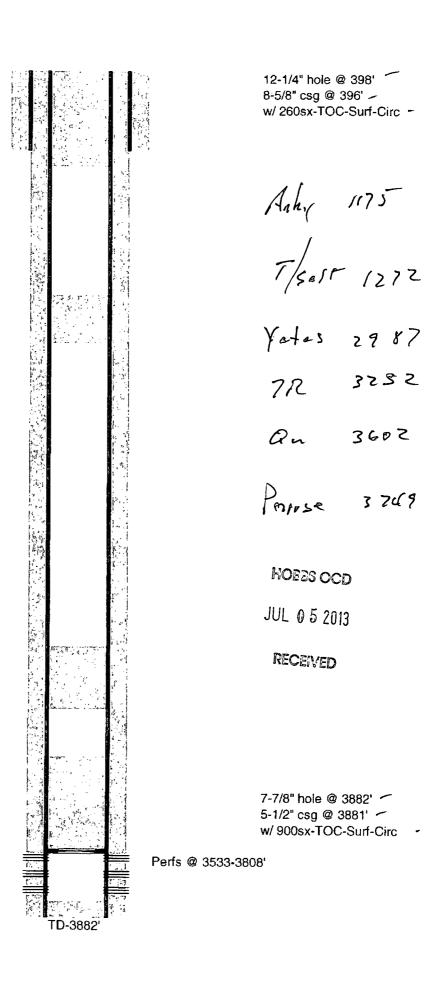

OXY USA WTP LP - Proposed Myers Langlie Mattix Unit #267 API No. 30-025-32591

65sx @ 446'-Surface

12-1/4" hole @ 398' 8-5/8" csg @ 396' w/ 260sx-TOC-Surf-Circ

HOBES OCD

JUL 0 5 2013

RECEIVED

25sx @ 1275-1125' WOC-Tag

35sx @ 2990-2750' WOC-Tag

CIBP @ 3483' w/ 40sx to 3225'



TD-3882'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

HOBES OCD

JUL 0 5 2013

RECEIVED

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

J. Amos 3/6/11

HOESS OCD

IIIL 0 5 2013

RECEIVED



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

HOESS OCD

JUL 0 5 2013

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resource While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

JUL 0 5 2013

Inspection & Enforcement

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Mike Burton Environmental Protection Specialist 575-234-2226

Jeffery Robertson Natural Resource Specialist 575-234-2230

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Doug Hoag Civil Engineering Technician 575-234-5979

Linda Denniston
Environmental Protection Specialist
575-234-5974

Realty, Compliance

Randy Pair Environmental Protection Specialist 575-234-6240

Permitting

575-234-5959

RECEIVED
Cody Layton
Natural Resource Specialist

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Tanner Nygren Natural Resource Specialist 575-234-5975

Amanda Lynch Natural Resource Specialist 575-234-5922

Leg1on Brumley Environmental Protection Specialist 575-234-5957