• Submit 1 Copy To Appropriate District	State of New Mexico	Form C-103
Submit 1 Copy To Appropriate District Office District I – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283		Revised August 1, 2011
District I – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 OCBS OCD		WELL API NO.
District II - (575) 748-1283 811 S. First St., Artesia, NM 88210 0 JOHD CONSERVATION DIVISION		30-025-09886
District III – (505) 334-6178 AUG <b>01</b> 2013 $_{1220}$ South St. Francis Dr.		5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460 Santa Fe, NM 87505		6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM RECEIVED		B1973
87505 SUNDRY NOTICES AND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A		Fast Europat Unit
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		
1. Type of Well: Oil Well 🗹 Gas Well 🗌 Other		8. Well Number 6
2. Name of Operator		9. OGRID Number 192463
OXY USA WTP Limited Partnership		10. Pool name or Wildcat
P.O. Box 50250 Midland, TX 79710		Europat Lates TR Qn
4. Well Location		
Unit Letter <u>P</u> : 330	feet from the south line and	190 feet from the east line
Section 22	Township 195 Range 37E	NMPM County Lea
11. Eleva	tion (Show whether DR, RKB, RT, GR, etc	.)
	3623'	
12 Check Appropriat	to Poy to Indicate Nature of Notice	Papart or Other Data
12. Check Appropria	te Box to Indicate Nature of Notice,	, Report of Other Data
NOTICE OF INTENTIO		BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AN	— (	
TEMPORARILY ABANDON CHANGE		
PULL OR ALTER CASING DOWNHOLE COMMINGLE	E COMPL	II JOB LI
OTHER Pont Add I Interval & Te		
	ions. (Clearly state all pertinent details, ar ULE 19.15.7.14 NMAC. For Multiple Co	nd give pertinent dates, including estimated date
proposed completion or recompletion.	OLE 19.13.7.14 NMAC. For Multiple CC	suppendits. Attach wendore diagram of
	<u>.</u> ·	
	- Acc s 1	
	iee Attached	
Spud Date:	Rig Release Date:	
L	L	
<b>X</b> 1 <b>1 20 1 20</b>		
I hereby certify that the information above is tru	e and complete to the best of my knowledge	ge and belief.
1 1A	1	
SIGNATURE	TITLE Regulatory Advisor	DATE 7/29/13
Type or print name David Stewart		
Type or print name Duvid Stewart For State Use Only	E-mail address: <u>david_stewart@</u>	oxy.com PHONE: <u>432-685-5717</u>
TOT State Ost Omy	Petroleum Enginee	ALLC 07 0040
APPROVED BY:	TITLE	
Conditions of Approval (if any):		
		ALLC A 7 1019
	1	AUG 07 2013 \

.

## EEU-061

**ノ**\*\*

OXY USA WTP LIMITED PARTNERSHIP respectfully request permission to recomplete the above mentioned well in the Upper Penrose. This recompletion will be a test to evaluate the potential of the inactive portion of the field. The detail procedure is attached along with the current and proposed wellbore diagrams for review.


## **Program**

## Seven Rivers Recompletion

- 1. MIRU PU. ND X-Mas Tree. NU BOP.
- 2. Pressure test casing.
- 3. RIH with bit on tubing and tag CIBP at 3742'.
- 4. Drill out CIBP and POH.
- 5. RIH and set new CIBP at +/- 3800'.
- 6. Pressure test casing.
- 7. Perforate Upper Penrose in the approximate interval 3765-3785'.
- 8. RIH with packer on workstring, and frac Seven Rivers perforations.
- 9. Open the well and let flow until recover frac fluid load.
- 10. Unset packer. POH.
- 11. RIH production string with seating nipple and tubing anchor.
- 12. Set tubing hanger. ND BOP. NU Rod BOP and well head.
- 13. RIH rod pump. Space out. Install polished rod. Test pump function.
- 14. RD Well Service Rig.
- 15. Put the well on production.

OXY USA WTP LP - Proposed East Eumont Unit #61 API No. 30-025-09886

ه 🖌

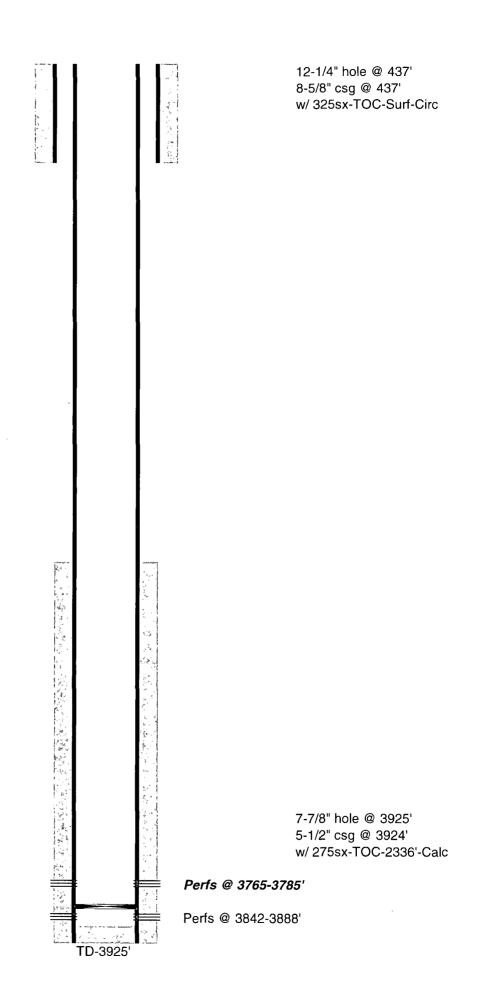

CIBP @ 3800'

OXY USA WTP LP - Current East Eumont Unit #61 API No. 30-025-09886

		12-1/4" hole @ 437' 8-5/8" csg @ 437' w/ 325sx-TOC-Surf-Circ
TD-3925'	Perfs @ 3842-388	7-7/8" hole @ 3925' 5-1/2" csg @ 3924' w/ 275sx-TOC-2336'-Calc 8'

7/92-CIBP @ 3742'