

8		NMOCD Hobbs					
5	Form 3160-5 (March 2012) HOBBS OCD UNITED STATES DEPARTMENT OF THE INTERIOR JAN 2 BUREAU OF LAND MANAGEMENT			FORM APPROVED OMB No. 1004-0137 Expires: October 31, 2014			
				5. Lease Serial No. LC-062486			
	SUNDRY NOTICES AND REPORTS ON WELLS Do not use Children for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name		
	SUBMIT IN TRIPLICATE Other instructions on page 2.				7. If Unit of CA/Agreement, Name and/or No.		
	Oil Well Gas W Ost Operator	INT		8. Well Name and No. Drickey Queen Sand Unit #805			
	Celero Énergy II, LP	Celero Énergy II, LP			30-005-00978		
	3a. Address						
	4. Location of Well (Footage, Sec., T., I (P) Sec 4, T14S, R31E	R., M., or Survey Description)	(432)686-1883		11. County or Parish, State Chaves, NM		
	<u>660' FSL & 660' FEL</u>						
12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION							
					Production (Start/Resume) Water Shut-Off		
	X Notice of Intent	Alter Casing	Deepen Fracture Tre		lamation	Well Integrity	
	Subsequent Report	Casing Repair	New Constru	action Reco	omplete	Other	
		Change Plans	Plug and Ab		porarily Abandon		
	Final Abandonment Notice 13. Describe Proposed or Completed Op	Convert to Injection	Plug Back		er Disposal		
	 following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.) DQSU #805 has future utility as a WAG injection well in the event that the RQU CO2 project to the northeast is expanded to the Drickey Queen Sand Unit. Pressure test 5-1/2" annulus to 500 psi for 30 minutes before rigging up. MIRU, install BOPE, and POOH laying down injection tubing. RU wireline and set a CIBP at 2805'. Fill casing with inhibited freshwater and pressure test. Cap CIBP with 35' of cement. Leave one joint of tubing with a valve at surface. Perform final MIT. 						
	14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)						
	Lisa Hunt		Title	Regulatory Ana	alyst		
	Signature Risa	Risa Aunt Date 01/15/2014					
	THIS SPACE FOR FEDERAL OR STATE OFFICE USE						
		D R. GLAS	PETROLEUM ENGINEER JAN 2 2 2014				
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject tasks which would entitle the applicant to conduct operational providence. We off the subject tasks which would be applicant to conduct operational providence.							
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States as fictitious or magnifications of the United States are matter within its jurisdiction. (Instructions or page 2711 AUTED FUR CONDITIONS OF APPROVAL APPROVED FOR 3							
							CONDITIONS OF APPROVAL APPROVED FOR 3 MONTH PERIOD JAN 27 2014

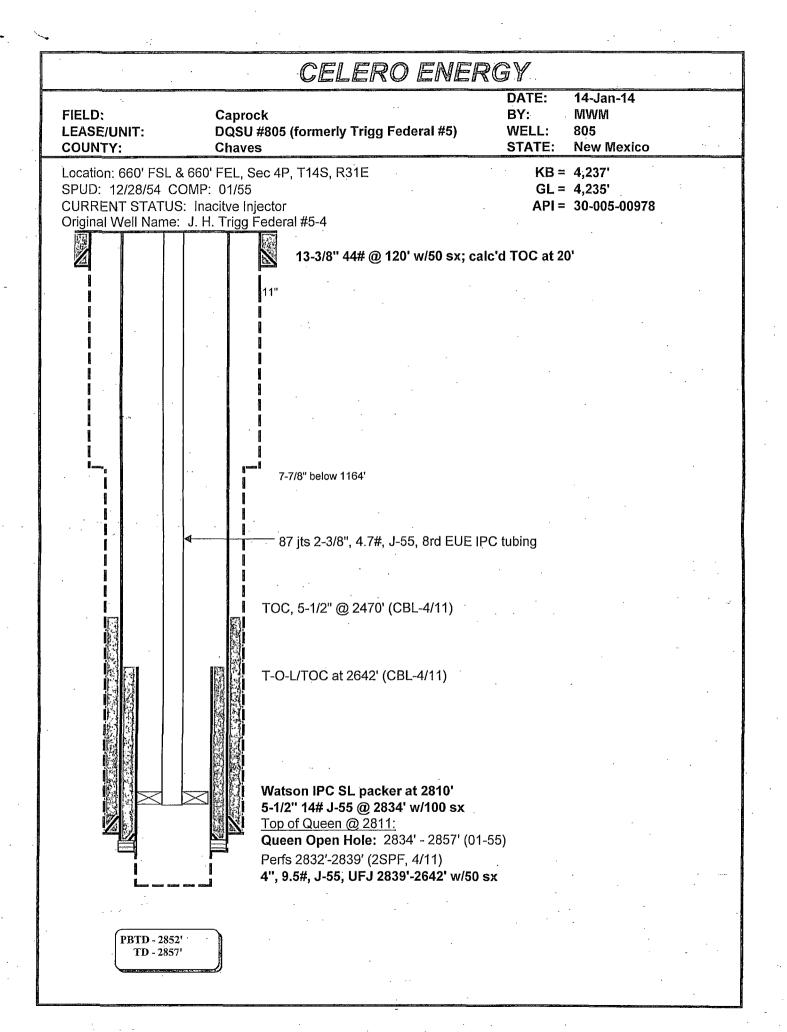

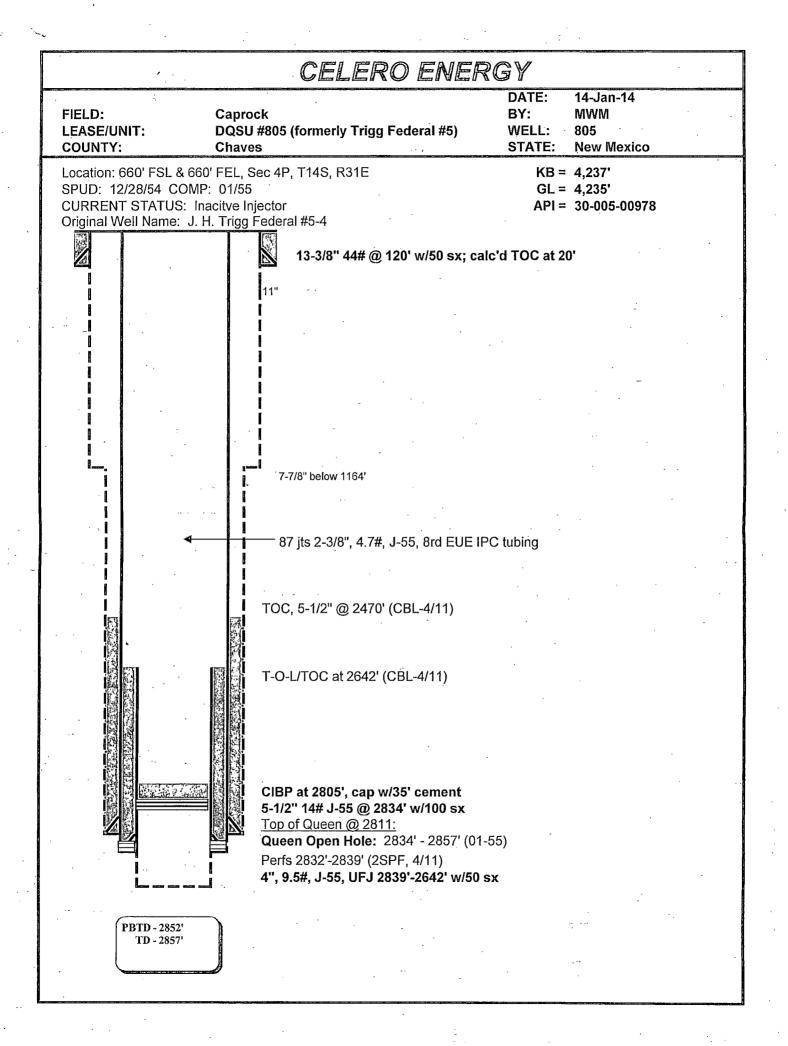

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 575-627-0272

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporary abandoned well is defined as a completion that is not capable of production in paying quantities but may have value as a service well. Pursuant to 43 CFR 3162.3-4(c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful casing integrity test as follows:

1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).

2. A description of the temporary abandonment procedure.

. 7

A. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging.

B. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes with a 10% allowable leakoff.

C. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.

D. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.

E. Contact the BLM Roswell Field Office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

Wells that successfully pass the casing integrity test may be approved for Temporary Abandonment (TA) status up to 12 months.

1. Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval.

2. Attaches a clear copy of the original pressure test chart.

3. Provided justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned.

4. Describes the temporary abandonment procedure.

The TA status could be extended without another casing integrity test provided there was no leak-off during the test and the test was witnessed by a BLM representative.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

1. A procedure to repair the casing so that a TA approval can be granted.

2. A procedure to plug and abandon the well.

Ref: IM: NM-95-022 (12/16/1994)