

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

HOBBS OGD CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

JUN 12 2014

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-38624
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator CIMAREX ENERGY CO. OF COLORADO		6. State Oil & Gas Lease No.
3. Address of Operator 600 N. MARIENFELD, SUITE 600, MIDLAND, TEXAS 79701		7. Lease Name or Unit Agreement Name PENNZOIL B 36 STATE
4. Well Location Unit Letter: A : 930 feet from the NORTH line and 660 feet from the EAST line Section 36 Township 19S Range 33E NMPM LEA County		8. Well Number 007
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3620' - GR		9. OGRID Number 162683
		10. Pool name or Wildcat APACHE RIDGE; BONE SPRING

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: WELL PLUGGED AND ABANDONED 06/07/14.


13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

05/29/14: SET 5-1/2" CIBP @ 9,400'; CIRC. WELL W/ MUD; PUMP 25 SXS. CMT. @ 9,400'-9,210'; PUMP 25 SXS. CMT. @ 8,335'.
05/30/14: DID NOT TAG CMT. PLUG; PRES. TEST CSG. TO 1,000# - HELD OK; PUMP 25 SXS. CMT. @ 8,335'; WOC.
05/31/14: DID NOT TAG CMT. PLUG; PUMP 25 SXS. CMT. @ 8,335'; WOC - DID NOT TAG CMT. PLUG; PUMP 50 SXS. CMT. W/ 2% CACL @ 8,335'; PRES. UP ON CSG. TO 500# X CWI X WOC.
06/01/14: DIG NOT TAG CMT. PLUG; SET 5-1/2" CIBP @ 8,335' (PER NMOCD); PUMP 25 SXS. CMT. @ 8,335'; WOC.
06/02/14: TAG CMT. @ 8,310'; PUMP 40 SXS. CMT. @ 8,310' (PER NMOCD); WOC.
06/03/14: TAG CMT. @ 8,175' (OK'D BY NMOCD); PUMP 25 SXS. CMT. @ 5,496'; WOC - DID NOT TAG CMT. PLUG.
06/04/14: SET CIBP @ 5,496' (PER NMOCD); PUMP 60 SXS. CMT. @ 5,496' (PER NMOCD); WOC.
06/05/14: TAG CMT. @ 5,270' (OK'D BY OCD); PUMP 25 SXS. CMT. @ 3,000'; WOC X TAG CMT. @ 2,756' (OK'D BY OCD).
06/06/14: PERF. X SQZ. 55 SXS. CMT. @ 1,458'; WOC X TAG CMT. PLUG @ 1,321' (OK'D BY NMOCD).
06/07/14: PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 100 SXS. CMT. @ 250'-3'; DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; VERIFY CMT. TO SURF.; WELD ON STEEL PLATE TO CSGS. X INSTALL DRY HOLE MARKER.

Spud Date: MIRU: 05/23/14

Rig Release Date: RDMO: 06/07/14

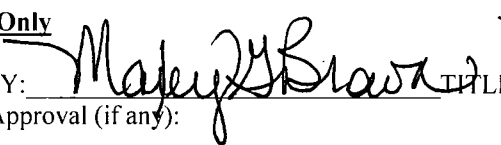
I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE: AGENT

DATE: 06/11/14

Type or print name: DAVID A. EYLER E-mail address: DEYLER@MILAGRO-RES.COM PHONE: 432.687.3033

For State Use Only

APPROVED BY:  TITLE: Dist Supervisor DATE: 6/16/2014
Conditions of Approval (if any):

JUN 16 2014