

Form 3160-5 (March 2012)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED

OMB No.	1004-01	37
Expires: Oc	tober 31,	2014

5. Lease Serial No. RECENEM 90161

SUNDRY	NOTICES AND REI	PORTS ON WE	LLS
Do not use this	form for proposals	s to drill or to i	e-enter an
abandoned well.	Use Form 3160-3	(APD) for such	n proposals

Do not use this f		o drill or to re-enter an PD) for such proposals		6. If Indian, Allottee o	or Tribe Name
SUBMIT IN TRIPLICATE – Other instructions on page 2.			7. If Unit of CA/Agre	ement, Name and/or No.	
1. Type of Well					
✓ Oil Well Gas Well Other		8. Well Name and No. Hawk B-1 #29	. (24427)		
2. Name of Operator Apache Corporation (873)		9. API Well No. 30-025-35807	/		
3a. Address 3b. Phone No. (include area code)		le)	10. Field and Pool or	_	
303 Veterans Airpark Lane, Suite 1000 Midland, TX 79705		432/818-1062		Penrose Skelly; Gra	ayburg (50350)
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description)			11. County or Parish, State		
1830' FSL & 1980' FWL UL K Sec 8, T21S, R37E			Lea Co., NM		
12. CHEC	CK THE APPROPRIATE BO	OX(ES) TO INDICATE NATURE	OF NOTIC	CE, REPORT OR OTH	ER DATA
TYPE OF SUBMISSION	TYPE OF ACTION				
✓ Notice of Intent	Deepen	Produ	uction (Start/Resume)	Water Shut-Off	
	Fracture Treat	Recla	amation	Well Integrity	
Subsequent Report Casing Repair		New Construction	Reco	mplete	Other
Change Plans	Change Plans	Plug and Abandon	✓ Tem	porarily Abandon	
Final Abandonment Notice	Convert to Injection	Plug Back	☐ Wate	er Disposal	
the proposal is to deepen direction Attach the Bond under which the v	ally or recomplete horizontal work will be performed or proved operations. If the operation Abandonment Notices must	ly, give subsurface locations and a ovide the Bond No. on file with B ion results in a multiple completion	measured ar LM/BIA. R n or recomp	nd true vertical depths of Required subsequent re- pletion in a new interval	ports must be filed within 30 days l, a Form 3160-4 must be filed once
Apache intends to TA this well, per	the following, for evaluation	on of future use within the water	rflood:		•
1. MIRU SR & cable spoolers. ND V				& DOOH BIH with a	dump bailer and dump bail

- minimum of 35' of cement on top of CIBP. WOC for 2 hours & tag top of cement w/ WL, POOH.
- 3. RIH w/ 2-7/8" tubing to +/-3700', circulate packer fluid to surface. Pre-test casing to 500 psi. POOH & LD 2-7/8" tubing. ND BOPS, NU suspension wellhead.
- 4. Pressure test casing to 500 psi for MIT (chart record test for regulatory submission).

SEE ATTACHED FOR CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)	
Reesa Fisher	Citle Sr. Staff Reg Analyst
Signature Rosa Lisher	Date 07/03/2014
THIS SPACE FOR FEDER	AL OR STATE OFFICE USE
Approved by	Title EP5 Date 1/31/15
Conditions of approval, if any, are attached. Approval of this notice does not warrant or cer that the applicant holds legal or equitable title to those rights in the subject lease which wou entitle the applicant to conduct operations thereon.	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.


(Instructions on page 2)

MOB/OCD 2/17/2015


FEB 17 2015



Current Wellbore Diagram

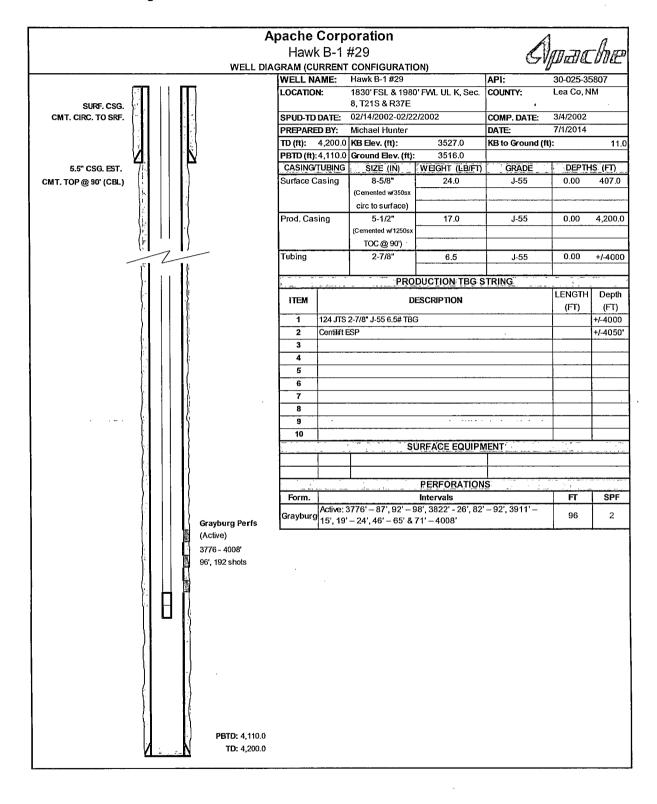

Proposed Wellbore Diagram

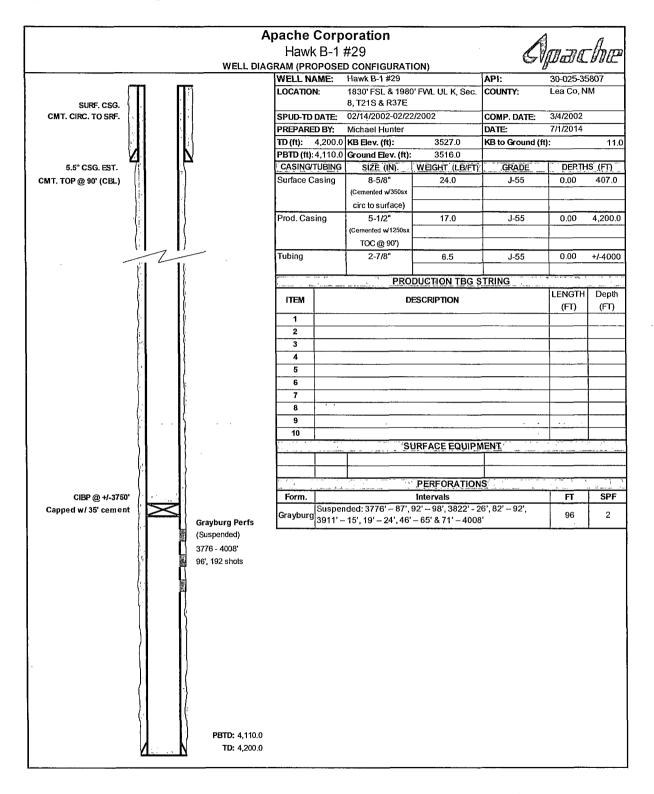

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
 - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, **placed with tubing**.
 - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
 - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
 - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
 - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval with well bore diagram with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Hawk B-1 #29

- 1. Well may be approved to be TA/SI for a period of 6 months or until 8/1/2015 after successful MIT and subsequent report is submitted.
- 2. This will be the last TA approval for this well.
- 3. Contact BLM 24 Hrs. prior to setting of plugs so as it may be witnessed.