UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs


FORM APPROVED OMB NO. 1004-0135


Expires: July 31, 2010

_	
5	Lease Serial No.
**	
	NMNM3622
	LAIAILAIGOCEE

-	THE PART OF THE PA	-	-	_
6	If Indian	Allottee	or Tribe	Name

	RY NOTICES AND REPO		NMNM3622
Do not use abandoned	6. If Indian, Allottee or Tribe Name		
SUBMIT IN	FRIPLICATE - Other instruc	ctions on reverse side. OBBS	7. If Unit or CA/Agreement, Name and/or No
. Type of Well ☑ Oil Well ☐ Gas Well ☐	Other	DEC 0 1	8. Well Name and No. SCOUT 18 FEDERAL 013
. Name of Operator		DAVID A EYLER MILAGRO-RES.COM	9. API Well No. 30-025-38048
a. Address 600 N. MARIENFELD, SU MIDLAND, TX 79701	TE 1118	3b. Phone No. (include area code) Ph: 432-687-3033	10. Field and Pool, or Exploratory QUAIL RIDGE
. Location of Well (Footage, Se	c., T., R., M., or Survey Description	1)	11. County or Parish, and State
Sec 18 T19S R34E SWNV	/ 1980FNL 510FWL		LEA COUNTY, NM
12. CHECK A	PPROPRIATE BOX(ES) TO	O INDICATE NATU CO	PERMITTING SWD
TYPE OF SUBMISSION		Peepen CSNC	VVERSION SWD
■ Notice of Intent	☐ Acidize	Deepen INT	DE WIFE Of
	☐ Alter Casing	Fracture Treat	PARENVIRO TA UMS TON
☐ Subsequent Report	☐ Casing Repair	■ New Construction	D. P&A CV
☐ Final Abandonment Notice	Change Plans	Plug and Abandon	Temporarity . A NR CHG LOO
☐ Final Abandonment Notice	Change Plans		Do -01.
Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the invo- testing has been completed. Final determined that the site is ready	Operation (clearly state all pertinentionally or recomplete horizontally, work will be performed or provide lived operations. If the operation real Abandonment Notices shall be file for final inspection.)	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. sults in a multiple completion or reconded only after all requirements, including	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once greclamation, have been completed, and the operator has
Describe Proposed or Completed If the proposal is to deepen direc Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. N 2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF V DURING THIS PROCEDU	Convert to Injection Operation (clearly state all pertinentionally or recomplete horizontally, work will be performed or provide lived operations. If the operation real Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ WELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA. 70 SXS.CMT. @ 544'-3'. WELLHEAD 3' B.G.L.; WELD	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. esults in a multiple completion or reconled only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHORALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS.	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once greclamation, have been completed, and the operator has
Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. V.2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF V.DURING THIS PROCEDUTHE REQUIRED DISPOS	Operation (clearly state all pertinentionally or recomplete horizontally, work will be performed or provide lived operations. If the operation real Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ VELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA-70 SXS.CMT. @ 544'-3'. VELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. esults in a multiple completion or reconled only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHORALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS.	date of any proposed work and approximate and and true vertical depths of all pertinent markers and ed and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once agreclamation, have been completed, and the operator has E, T/YATES,B/SALT; WOC X X INSTALL DRY HOLE MARKER. A STEEL TANK AND HAUL CONTENTS TO
Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. V.2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF V DURING THIS PROCEDUTHE REQUIRED DISPOS	Convert to Injection Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation re all Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ WELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA .70 SXS.CMT. @ 544'-3'. WELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. esults in a multiple completion or reconled only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHORALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS.	date of any proposed work and approximate and and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once agreclamation, have been completed, and the operator has a T/YATES,B/SALT; WOC X X INSTALL DRY HOLE MARKER. A STEEL TANK AND HAUL CONTENTS TO
Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. V.2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF V. DURING THIS PROCEDUTHE REQUIRED DISPOS	Convert to Injection Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation re all Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ WELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA .70 SXS.CMT. @ 544'-3'. WELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE	nt details, including estimated starting, give subsurface locations and measure the Bond No. on file with BLM/BIA. soults in a multiple completion or reconled only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHOBALT); WOC X TAG CMT. PLUGALT); WOC X TAG CMT. PLUGALT); CON STEEL PLATE TO CSGS. CLOSED-LOOP SYSTEM W/17.	date of any proposed work and approximate and and true vertical depths of all pertinent markers and ed and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once agreclamation, have been completed, and the operator has E, T/YATES,B/SALT; WOC X X INSTALL DRY HOLE MARKER. A STEEL TANK AND HAUL CONTENTS TO
Describe Proposed or Completed If the proposal is to deepen direc Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. V.2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF V. DURING THIS PROCEDUTHE REQUIRED DISPOS RECLAMATION PROACTION OF ATTACHED	Convert to Injection Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation re all Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ WELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA 70 SXS.CMT. @ 544'-3'. WELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. esults in a multiple completion or reconled only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHORALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS.	date of any proposed work and approximate and and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once agreclamation, have been completed, and the operator has a T/YATES,B/SALT; WOC X X INSTALL DRY HOLE MARKER. A STEEL TANK AND HAUL CONTENTS TO
Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. V. 2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF. 4) DIG OUT X CUT OFF V. DURING THIS PROCEDUTHE REQUIRED DISPOS RECLAMATION PROCEDUTATION PROCEDUTION OF COMPLETED COMPLE	Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation real Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ NELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA. 70 SXS.CMT. @ 544'-3'. VELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE OCEDURE Ing is true and correct/ Electronic Submission # For CIMAREX ENI	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. salts in a multiple completion or reconsed only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHORALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS. CLOSED-LOOP SYSTEM W/17.	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once in the reclamation, have been completed, and the operator has a street tank and the operator has a street tank and haut contents to the Hobbs
Describe Proposed or Completed If the proposal is to deepen direc Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. No. 2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF V DURING THIS PROCEDUTHE REQUIRED DISPOS RECLAMATION PROCEDUTION OF THE REQUIRED DISPOS RECLAMATION PROCEDUTION OF THE REQUIRED DISPOS RECLAMATION PROCEDUTION OF THE REQUIRED DISPOS	Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation real Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ NELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA. 70 SXS.CMT. @ 544'-3'. VELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE OCEDURE Ing is true and correct/ Electronic Submission # For CIMAREX ENI	nt details, including estimated starting, give subsurface locations and measure the Bond No. on file with BLM/BIA. soults in a multiple completion or reconled only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHOBALT); WOC X TAG CMT. PLUGALT); WOC X TAG CMT.	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once in the reclamation, have been completed, and the operator has a street tank and the operator has a street tank and haut contents to the Hobbs
Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the involtesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. No. 12) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF (1) DIG OUT X CUT OFF (2) DURING THIS PROCEDUTHE REQUIRED DISPOSON RECLAMATION PROCEDUTHE REQUIRED DISPOSON RECLAMATION PROCEDUTION OF THE REQUIRED DISPOSON OF THE REQUIRED DISPOSO	Convert to Injection Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation re all Abandonment Notices shall be fill for final inspection.) 50'; PUMP 60 SXS.CMT. @ WELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA 70 SXS.CMT. @ 544'-3'. WELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE or is true and correct. Electronic Submission # For CIMAREX ENI Committed to AFMSS 1	nt details, including estimated starting, give subsurface locations and measure the Bond No. on file with BLM/BIA. soults in a multiple completion or reconfed only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHOBALT); WOC X TAG CMT. PLUGALT); WOC X TAG CMT.	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days appletion in a new interval, a Form 3160-4 shall be filed once in the report of the recommendation, have been completed, and the operator has a strength of the recommendation o
In Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the involvesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. No. No. 12 PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF (4) DIG OUT X CUT OFF (5) DURING THIS PROCEDUTHE REQUIRED DISPOS RECLAMATION PROCEDUTION OF THE REQUIRED DISPOS (ATTACHE) ATTACHED Name (Printed/Typed) DAVID	Convert to Injection Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation re all Abandonment Notices shall be file for final inspection.) 50'; PUMP 60 SXS.CMT. @ VELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA 70 SXS.CMT. @ 544'-3'. VELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE OCEDURE Ing is true and correct Electronic Submission # For CIMAREX ENI Committed to AFMSS 1 A EYLER Inic Submission)	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. salts in a multiple completion or reconsed only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHORALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS. CLOSED-LOOP SYSTEM W/17. Salts 15 verified by the BLM Well ERGY CO OF COLORADO, sent for processing by LINDA JIMENE Title AGENT	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days in pletion in a new interval, a Form 3160-4 shall be filed once agreclamation, have been completed, and the operator has a first transport of the complete of the co
B. Describe Proposed or Completed If the proposal is to deepen direct Attach the Bond under which the following completion of the invotesting has been completed. Find determined that the site is ready: 1) SET 5-1/2" CIBP @ 3,7 TAG CMT. PLUG; CIRC. No. 2) PUMP 25 SXS.CMT. @ 3) MIX X CIRC. TO SURF 4) DIG OUT X CUT OFF VD URING THIS PROCEDUTHE REQUIRED DISPOS RECLAMATION PROCEDUTATION PROCEDUTION OF ATTACHED 4. I hereby certify that the foregoin Name (Printed/Typed) DAVID	Convert to Injection Operation (clearly state all pertiner tionally or recomplete horizontally, work will be performed or provide lived operations. If the operation re all Abandonment Notices shall be file for final inspection.) 50'; PUMP 60 SXS.CMT. @ VELL W/ PXA FLUID. 1,644'-1,524'(T/ANHY.,T/SA 70 SXS.CMT. @ 544'-3'. VELLHEAD 3' B.G.L.; WELD RE WE PLAN TO USE THE AL, PER OCD RULE 19.15.1 OCEDURE OCEDURE Ing is true and correct Electronic Submission # For CIMAREX ENI Committed to AFMSS 1 A EYLER Inic Submission)	nt details, including estimated starting give subsurface locations and measure the Bond No. on file with BLM/BIA. soults in a multiple completion or reconsed only after all requirements, including 3,750'-3,340'(8-5/8"CSG.SHOBALT); WOC X TAG CMT. PLUG ON STEEL PLATE TO CSGS. CLOSED-LOOP SYSTEM W/17. **S18815 verified by the BLM Well ERGY CO OF COLORADO, sent for processing by LINDA JIMENE Title AGENT	date of any proposed work and approximate and true vertical depths of all pertinent markers and Required subsequent reports shall be filed within 30 days in pletion in a new interval, a Form 3160-4 shall be filed once agreclamation, have been completed, and the operator has a first transport of the complete of the co

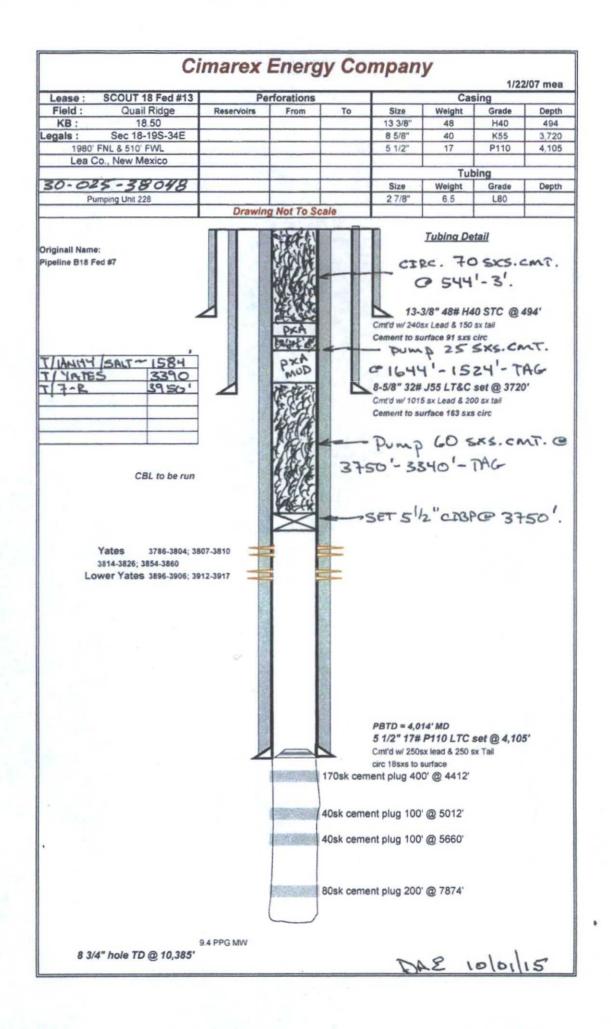

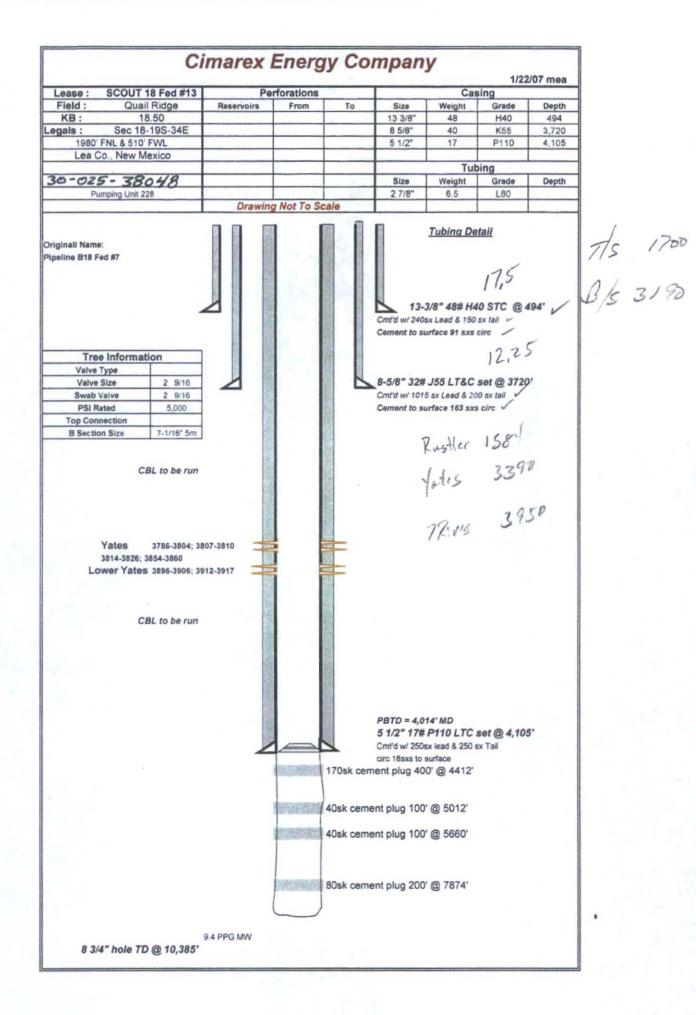

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979