4 HOBBS OCD **NMOCD** Form 3160-5 FORM APPROVED **UNITED STATES** (August 2007) AUG 1 5 2DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT OMB NO. 1004-0135 Hobbs Expires: July 31, 2010 5. Lease Serial No. SUNDRY NOTICES AND REPORTS ON WELLS NMNM03210 Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. 6. If Indian, Allottee or Tribe Name 7. If Unit or CA/Agreement, Name and/or No. SUBMIT IN TRIPLICATE - Other instructions on reverse side. 8910084860 1. Type of Well 8. Well Name and No. WEST CAP QUEEN SAND UNIT 3 ☑ Oil Well ☐ Gas Well ☐ Other API Well No. Name of Operator Contact: LAURA PINA 30-005-01094-00-S1 LEGACY RESERVES OPERATING E-Mail: lpina@legacylp.com 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory Ph: 432-689-5200 CAPROCK-QUEEN PO BOX 10848 MIDLAND, TX 79702-7848 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, and State Sec 17 T14S R31E NWSE Tract 7 1982FNL 1979FEL CHAVES COUNTY, NM 33.104892 N Lat, 103.841906 W Lon 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION INT TO PA PMX □ Acidize ☐ Production (Start/Re ☐ Deepen Notice of Intent P&A NR ☐ Alter Casing ☐ Fracture Treat ☐ Reclamation ☐ Subsequent Report P&AR Casing Repair ■ New Construction ☐ Recomplete ☐ Final Abandonment Notice ☐ Change Plans □ Plug and Abandon □ Temporarily Aband □ Convert to Injection ☐ Plug Back ■ Water Disposal 13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.) NOTE: All plugs to be minimum 25 sacks of cement. FOR RECORD ONLY Proposed P&A Procedure: MIRU. Lay down rod string and tubing string. Pick up work string.
 RIH and set CIBP @ 2700'. Spot 25 sx of cement on top of CIBP.
 Circulate minimum 9.5 ppg P&A mud to surface.

4. Pressure test and isolate leak if any.

5. TOOH. Perforate @ 1940'.
6. RIH with PKR to 1750'. Pump into perf @ 1940' w/minimum 35 sx cement. WOC, POOH w/packer, RIH

w/opened ended tubing and tag TOC at/above 1840'.

7. TOOH. Perforate @ 1060'.



Signature (Electronic Submission)	Date 08/09/2016	
THIS SPACE FOR FEDERA	L OR STATE OFFICE USE	
Approved By /S/ DAVID R. GLASS	Title PETROLEUM ENGINEER	A WG 0 9 2016
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office	

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** SEE ATTACHED FOR

APPROVED FOR 3 MONTH PERIOD NOV 0 9 2016

CONDITIONS OF APPROVAL


Additional data for EC transaction #347161 that would not fit on the form

32. Additional remarks, continued

RIH with PKR to 1050'. Pump into perf @ 1060' w/minimum 35 sx cement. WOC, POOH w/packer, RIH w/opened ended tubing and tag TOC at/above 960'.
 TOOH. Perforate @ 250'.
 Circulate cement from 250' to surface.
 POOH, top off casing, remove WH, set P&A marker, clean and reclaim location.

Current & proposed wellbore diagrams attached.

Legacy Reserves LP

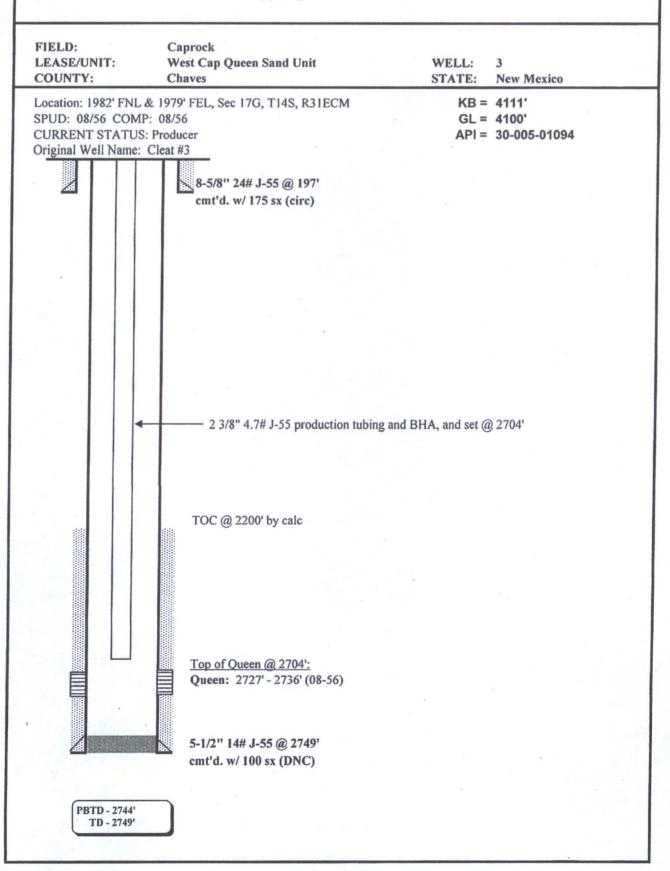

Legacy Reserves LP

FIELD: Caprock LEASE/UNIT: West Cap Queen Sand Unit WELL: COUNTY: Chaves STATE: **New Mexico** Location: 1982' FNL & 1979' FEL, Sec 17G, T14S, R31ECM KB = 4111' SPUD: 08/56 COMP: 08/56 GL = 4100' **CURRENT STATUS: Producer** API = 30-005-01094 Original Well Name: Cleat #3 8-5/8" 24# J-55 @ 197' cmt'd. w/ 175 sx (circ) 250 Rustler 1058' Yates 1940' 960' 1060 1840' 1940' TOC @ 2200' by calc 2600' Top of Queen @ 2704': Queen: 2727' - 2736' (08-56) 5-1/2" 14# J-55 @ 2749" cmt'd. w/ 100 sx (DNC) PBTD - 2744' TD - 2749'

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.
- 2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. Monument: Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. Timing Limitation Lease Stipulation / Condition of Approval For Lesser Prairie-Chicken: Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1 through June 15 annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D seismic operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 feet from the source of the noise.
- 8. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.