Form 3160-5 (August 2007) HOBBS OCD


UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0135
Expires: July 31, 2010

IODDO OOD BO	5. Lease Serial No.								
SUNDRY NOTICES AND REPORTS ON WELLS OCD Hobbs DEC 0 9 2016 Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						NMNM12568A 6. If Indian, Allottee or Tribe Name			
RECEIVE BMIT IN TRI	PLICATE - Other instruc	erse side.		7. If Un	it or CA/Agreement,	Name and/or No.			
Type of Well ☐ Gas Well ☐ Oth	8. Well Name and No. BONDURANT FED 09								
Name of Operator CIMAREX ENERGY COMPAN	ER S.COM		9. API Well No. 30-025-31439-00-S1						
3a. Address 202 S CHEYENNE AVE. SUIT TULSA, OK 74103	3b. Phone No. Ph: 432-68		include area code) 10. Field and Pool, or Exploratory BUFFALO VALLEY			ratory			
4. Location of Well (Footage, Sec., T.			11. Cou	nty or Parish, and St	ate				
Sec 1 T19S R32E SENW 165		LEA COUNTY, NM							
12. CHECK APPE	ROPRIATE BOX(ES) TO	O INDICATE	NATURE (OF NOTICE, I	REPORT,	OR OTHER DA	TA		
TYPE OF SUBMISSION TYPE OF ACTIO									
Notice of Intent ■	☐ Acidize	☐ Deep	pen	□ Produ	ction (S	INT TO PA	Anx:		
	☐ Alter Casing	☐ Frac	ture Treat	☐ Reclar	mation	INT TO PA P&A NR _	3		
☐ Subsequent Report	□ Casing Repair	□ New	Construction	☐ Recon	nplete	P&A R	X		
☐ Final Abandonment Notice	☐ Change Plans		and Abandon						
	☐ Convert to Injection	Plug	Back	☐ Water	Disposa				
13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.) 3400-3260 1) SET 5-1/2" CIBP @ 3,450'; PUMP 25 SXS.CMT. @ 3,450'-3,330'(T/YATES,B/SALT).									
2) CIRC. WELL W/ PXA MUD; PRES. TEST 5-1/2" CSG. TO 500# X HOLD. 3) PUMP 50 SXS.CMT. @ 1,684'-1,380'(T/SALT, T/ANHY.); WOC X TAG CMT. PLUG. 4) MIX X CIRC. TO SURF. 80 SXS.CMT. @ 650'-3'. 5) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD ON STEEL PLATE TO CSGS. X INSTALL GROUND LEVEL DRY HOLE MARKER.									
DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM W/ A STEEL TANK AND HAUL CONTENTS TO THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17.									
SEE ATTACHED	FOR								
CONDITIONS O	FAPPROVAL								
14. I hereby certify that the foregoing is	true and correct. Electronic Submission # For CIMAREX EN	NERGY COMP	NY OF CO,	sent to the Hob	bs				
Name (Printed/Typed) DAVID A I		ENT		•					
Signature (Electronic S	Date 08/	10/2016							
Signature (Electronic S	THIS SPACE FO	OR FEDERA			USE				
A1./	11						1 . / /.		
Approved By Walls				ng			Date 11/24/16		
Conditions of approval, if any, are attached certify that the applicant holds legal or equal which would entitle the applicant to condu-	iitable title to those rights in the	Office (CFU						
Title 10 II C C Castian 1001 and Title 42	II C C Section 1212 make it a	anima fan anu na	mon knowin al-	and willfully to	make to ann	department or come	of the United		

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Cimarex Energy Co. of Colorado CIMARE Bondurant Federal 9 API: 30-025-31439 Property: 309563-034.01 1650' FNL & 2210' FWL Sec. 1 T-19-S, R-32-E, Lea Co. NM M. Ketter 3/24/11 Updated 6/23/2016 by S.Hanford **Tubing Detail** Bondurant Federal 9 **KB** Correction Ran (8/08) Setting Depth Quantity Description Length 3554.82 2-7/8" J-55 Tbg 114 3570.92 2-7/8" Perf Sub 2-7/8" BPMA 4.10 3575.02 3606.17 Rod Detail Bondurant Federal 9 KB Correction 8 5/8" 28# K55 csg @ 600" Ran (8/08) Cmt w/ 400 sx, cmt circ. Quantity Description Length Setting Depth 1-1/4" PR w/ 7/8" pion 7/8" D Rods 22.00 3522.00 22.00 3500.00 140 RH Release Tool 1.00 3523.00 1" Guided Lift Sub 1.00 3524.00 25x125x24 BHBC 24.00 3548.00 Yates Perfs 3461' - 3482' Yates Perfs. Sqz'd with 100 sxs cement 3560' - 3568' 5 1/2" 17# K55 csg @ 3720' Cmt w/ 872 sx, cmt circ PBTD @ 3570' TD @ 3720'

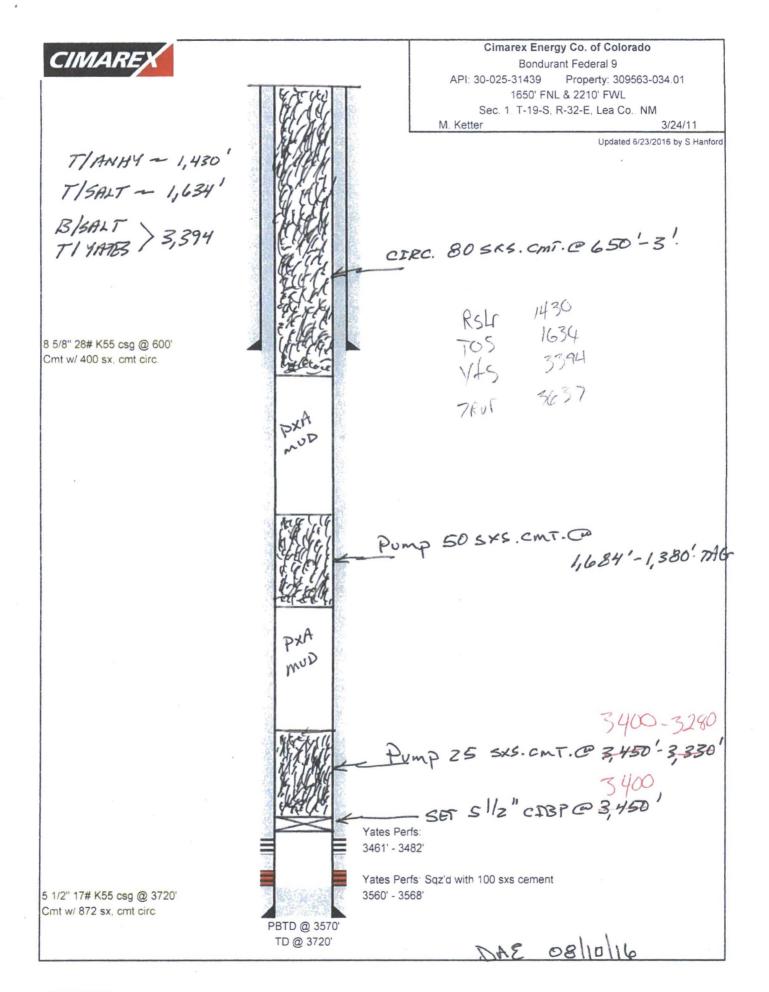

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted