	HOBBS OCT							
ł	JANIE							
el -		UNITED STATES	TERIOR		FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018			
	SUNDRY NOTICES AND REPORTS ON WELLS					5. Lease Serial No. NMLC068282B		
	Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name		
	SUBMIT IN	SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agree	ement, Name and/or No.	
	1. Type of Well S Oil Well Gas Well Other					8. Well Name and No. GOLDEN SPUR 25 FBS 3H		
	2. Name of Operator Contact: ASHLEY BERGEN CONOCOPHILLIPS COMPANY E-Mail: ashley.bergen@conocophillips.com					9. API Well No. 30-015-41230-00-S1		
	3a. Address MIDLAND, TX 79710 1810	3b. Phone No. (include area code) Ph: 432-688-6938			10. Field and Pool or Exploratory Area WC 015 G 05 S263125N			
	4. Location of Well (Footage, Sec., 7	4. Location of Well (Foolage, Sec., T., R., M., or Survey Description)				11. County or Parish, State		
	Sec 25 T26S R31E SWSW 48	Sec 25 T26S R31E SWSW 465FSL 530FWL				EDDY COUNTY, NM		
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA							
	TYPE OF SUBMISSION , TYPE OF ACTION							
	X Notice of Intent		Deepe		_	ion (Start/Resume)	□ Water Shut-Off	
	Subsequent Report	 Alter Casing Casing Repair 		 Hydraulic Fracturing New Construction 		Reclamation Well Integrity Recomplete Other		
	Final Abandonment Notice	Change Plans	Plug and Abandon			arily Abandon		
		Convert to Injection		D Plug Back		ater Disposal		
	13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 31604 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.							
	2018, when market conditions in status that expires 1/1/17. C	ConocoPhillips respectfully request to TA this wellbore to preserve it for a potential sidetrack in 2018, when market conditions improve and target identified. The well is currently in approved shut in status that expires 1/1/17. COP would like to bring a rig on December 12-22,2016 to complete the TA prior to Christmas. This work will be done in accordance to IM-NM-2016-017.						
	The procedure for the TA of this well is as follows: 1. Test Anchors as needed. 2. Notify Champion we will be RU on well. 3. Review JSA prior to RU on well. 4. Mi & RU WSU. 5. Kill well, function test BOP. ND wellhead, NU BOP. 6. POOH & LD tubing with gas lift mandrels/valves. Send tubing and gas lift mandrels/valves in for							
	14. I hereby certify that the foregoing is true and correct. Electronic Submission #359412 verified by the BLM Well Information System							
		For CONCOPHILIPS COMPANY, sent to the Carlsbad Committed to AFMSS for processing by JENNIFER SANCHEZ on 12/13/2016 (17JAS0121SE) Name (Printed/Typed) ASHLEY BERGEN Title REGULATORY SPECIAL ST						
	Signature (Electronic S	I	Date 11/30/2016			IK I A		
		THIS SPACE FO	OR STATE C	OFFICE USE PROVED				
	<u>Approved By</u> Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu	d. Approval of this notice does utable title to those rights in the ct operations thereon.	not warrant or subject lease	Title 4 Office		DEC. 1 4 1016	Date Date	
	Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfull to hake the territory of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.							
	(Instructions on page 2) ** BLM REVISED **							
		MUS	loca 1,	15/20	17	/	V	

Additional data for EC transaction #359412 that would not fit on the form

32. Additional remarks, continued


inspection. 7. RIH with bit, scraper, and tubing down to +/- 8,850?.
8.COOH with tubing, scraper, and bit.
9.TIH with CIBP (5.5?, 17lb/ft, P-110) and tubing. Set CIBP @ +/- 8,800? (KOP @ 8,830?). Shear off CIBP. POOH with tubing.
10.Dump 30 sacks cement on top of the CIBP.
11.RU pump truck to casing. Load casing with produced water. Test casing to 600 psi for 30 minutes. Circulate packer fluid. Estimated total volume of casing with CIBP set will be an estimated 204 bbls.


 s^{\dagger}

bbls. 12. Top off casing with packer fluid. 13.ND BOP. Secure wellhead. RD WSU. 14. Notify BLM 48 hours prior to test. 15. Chart well @ 550# for 30 minutes. 16.A MIT chart will be submitted to Regulatory for BLM submittal.

The current and proposed wellbore diagrams are attached.

Subsequent report with test results will be submitted as required following the TA completion.

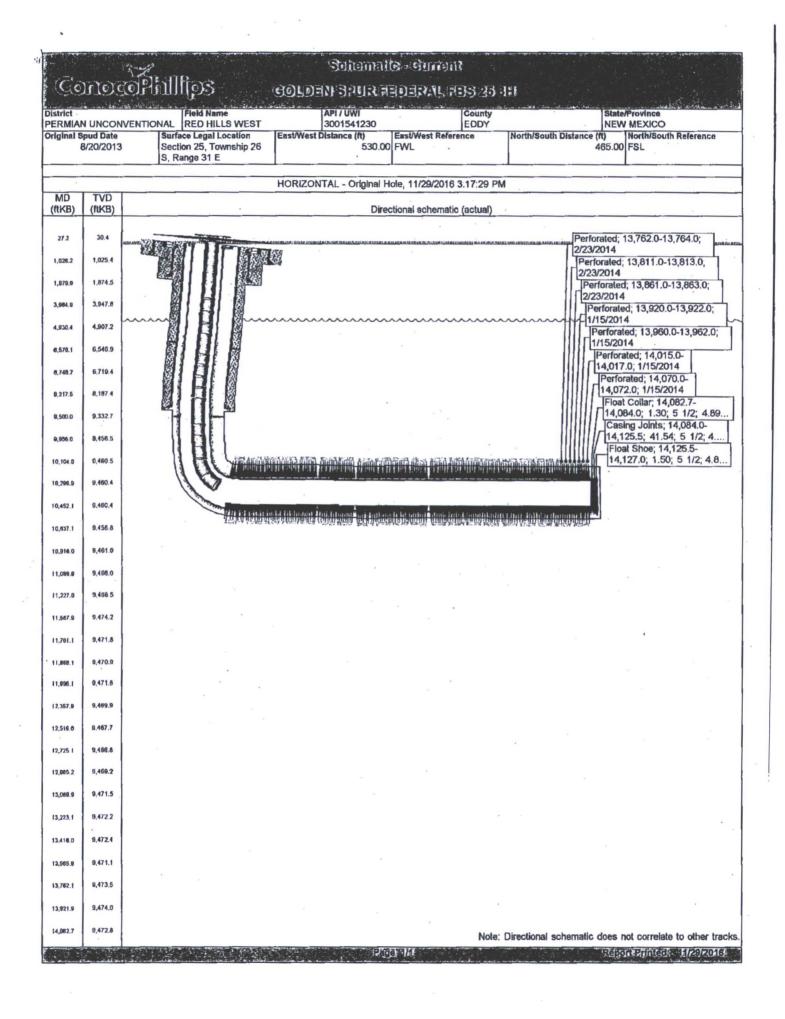

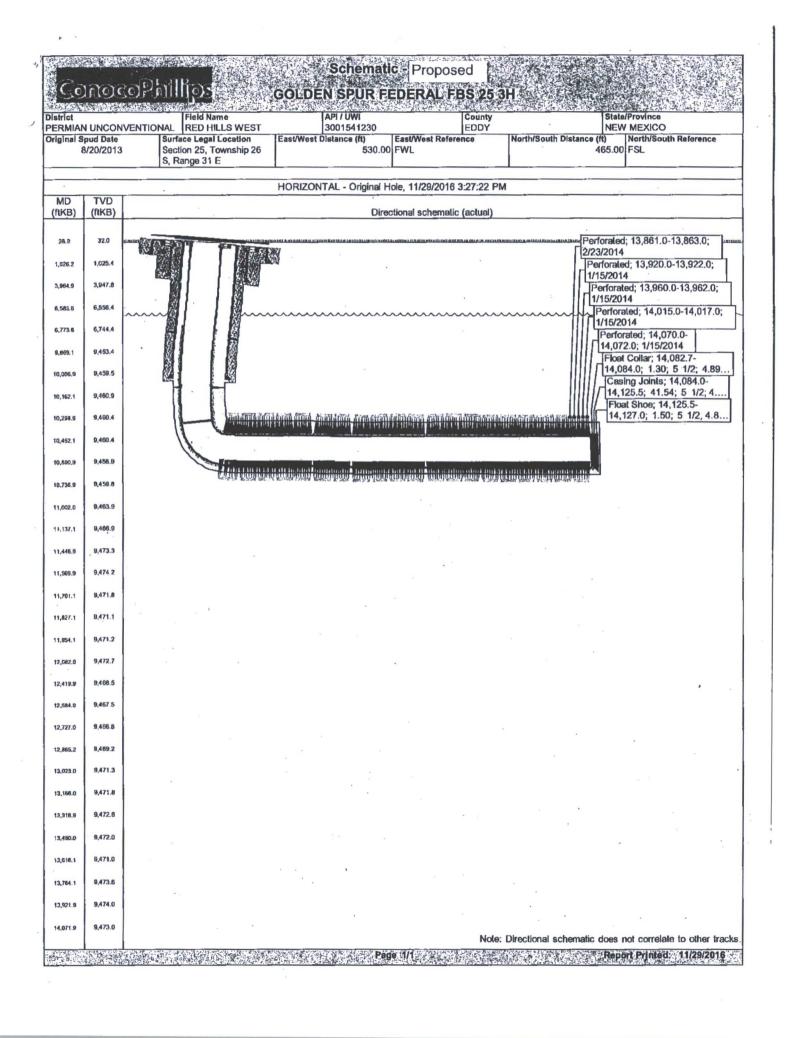

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Approved for a period of 1 year ending 12/14/2017 subject to conditions of approval. Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.

a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.

b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.

c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.

d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.

e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.

3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:

- Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval <u>with wellbore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Golden Spur 25 FBS 3H

- 1. Well is approved to be TA/SI for a period of 1 year or until 12/14/2017
- 2. Must submit NOI to recomplete or NOI to P&A. Must be submitted by 12/14/2017
- 3. COA's met at this time.