Form 3160-5 (August 2007)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT


HO	OCD Hobbs
	and a property


FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

Expires: July 31, 20

5. Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter an					NMLC054687				
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on reverse side.					7. If Unit or CA/Agreement, Name and/or No.				
1. Type of Well ☐ Gas Well ☐ Other					8. Well Name LYNX FE	and No. DERAL 08	/		
2. Name of Operator Contact: RONNIE SLACK DEVON ENERGY PRODUCTION CONG-Mail: ronnie.slack@dvn.com					9. API Well 1 30-025-0	No. 00561-00-S1			
3a. Address 6488 SEVEN RIVERS HIGHV ARTESIA, NM 88211		3b. Phone No. (include area code) Ph: 405-552-4615			Field and Pool, or Exploratory     MALJAMAR				
4. Location of Well (Footage, Sec., T			11. County of	r Parish, and Stat	e				
Sec 15 T17S R32E NWSE 19			LEA COUNTY, NM						
12. CHECK APPR	ROPRIATE BOX(ES) TO	O INDICATE	NATURE OF	NOTICE, RI	EPORT, OR	OTHER DAT	Γ <b>A</b>		
TYPE OF SUBMISSION		OF ACTION							
☑ Notice of Intent	☐ Acidize	☐ Deep	□ Deepen		□ Production (Start/Re		N N		
	☐ Alter Casing	☐ Frac	ture Treat	☐ Reclam	ation	INT TO F	PA Anx		
☐ Subsequent Report	☐ Casing Repair	□ New	Construction	□ Recomp	olete	P&A NR	<u> </u>		
☐ Final Abandonment Notice	☐ Change Plans	Plug	and Abandon	☐ Tempor	arily Abando	P&A R			
	☐ Convert to Injection	Plug	Back	☐ Water I	Disposal				
13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)  1. MIRU P&A Unit. 2. POOH w/rod pump assembly and 2-3/8" production tubing from 3,912'. 3. Circulate wellbore w/10# mud between plugs. 4. Set CIBP @ 3,750'. Tag plug. 5. Spot 70 sx (690') CI C @ 3,750' - 3,060'. (T.Queen @ 3,170') 6. Spot 25 sx (240') CI C @ 2,490' - 1,950'. Tag TOC. (B.Salt @ 2,090') 7. Perf 5-1/2" casing @ 1,200'. Pump 65 sx (260') CI C in/out @ 1,200' - 940'. Tag TOC. (T.Salt @ 1,042') 8. Perf 5-1/2" casing @ 140'. Pump 35 sx CI C in/out to surface.									
9. Cut wellhead off. Set dry hole marker.  SEE ATTACHED FOR									
LPC COAS At	tached			SEEAI	TACHEL	TUK			
14. I hereby certify that the foregoing is true and correct.  Electronic Submission #355455 verified by the BLM Well Information System  For DEVON ENERGY PRODUCTION COM LP, sent to the Hobbs  Committed to AFMSS for processing by PRISCILLA PEREZ on 10/20/2016 (17PP0090SE)  Name (Printed/Typed) RONNIE SLACK  Title PRODUCTION TECHNOLOGIST									
Signature (Electronic S	Date 10/20/	2016							
THIS SPACE FOR FEDERAL OR STATE OFFICE USE									
Approved By Malls			Title En	9			2/24/17 Date		
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conductive th	Office O	0							
T'1 10 II C C C 1001 - 1 T'1 - 12	II C C Cti 1212	·		. J:11£.11 4-	-1 to our d		- Cal I I-ia- 4		

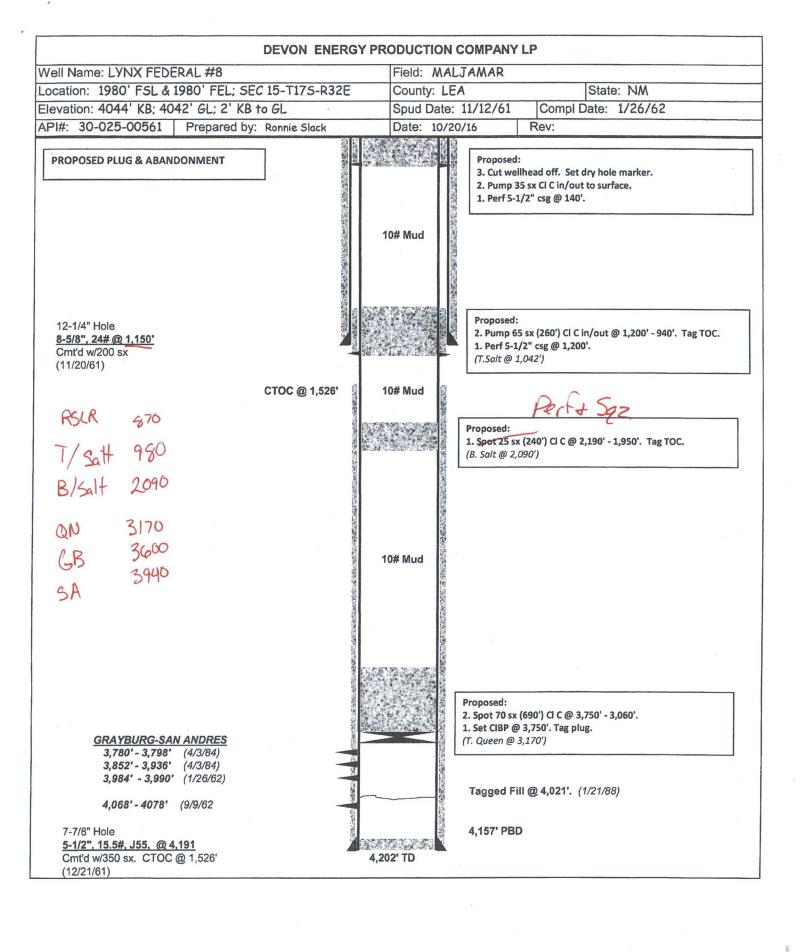

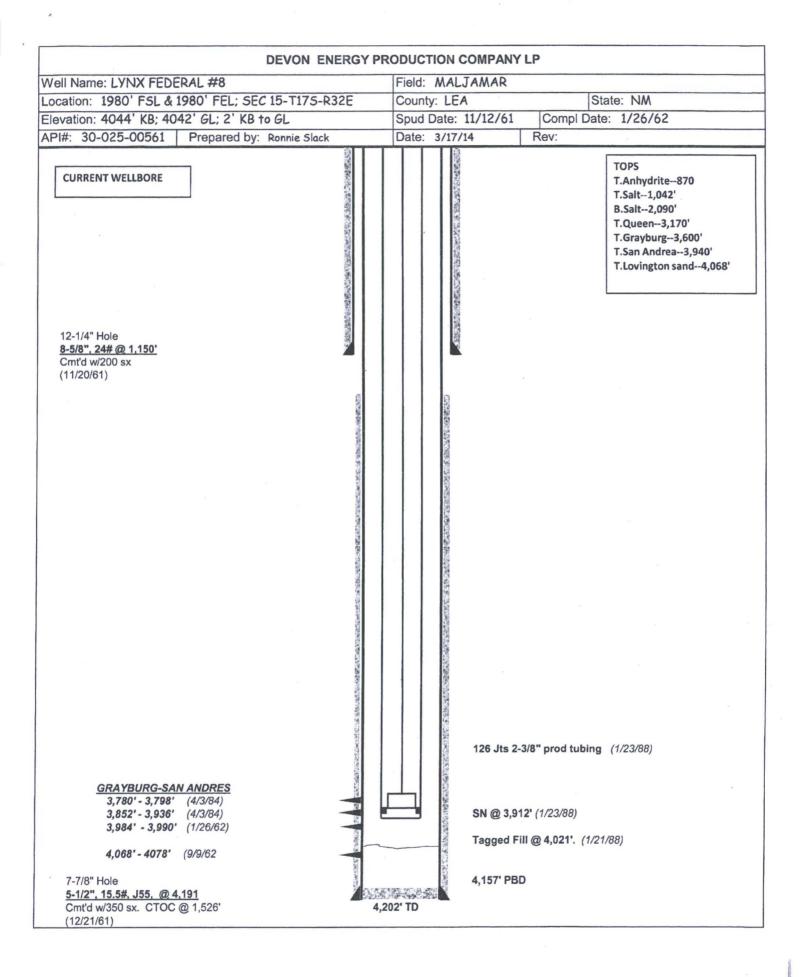

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the  $90^{th}$  day provide this office, prior to the  $90^{th}$  day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted