Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS DO not use this form for proposals to drill or to re-enter an APR 27 20 bandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM83197 6. If Indian, Allottee or Tribe Name		
RECEIVED	TRIPLICATE - Other instruc	ctions on page 2	A STREET		7. If Unit or	CA/Agreement	, Name and/or No.
1. Type of Well ☑ Oil Well □ Gas Well □ Other					8. Well Name and No. FARRELL FEDERAL 15		
2. Name of Operator RIDGEWAY ARIZONA OIL CORP E-Mail: Istanfield@hunteroil.com					9. API Well 30-041-	No. 10433-00-S1	· · ·
3a. Address 777 NORTH ELDRIDGE PAR HOUSTON, TX 77079	b. Phone No. (include h: 832-485-8522	area code)		10. Field and Pool or Exploratory Area CHAVEROO-SAN ANDRES			
4. Location of Well <i>(Footage, Sec., T</i> Sec 28 T7S R33E NWNE 660				11. County or Parish, State ROOSEVELT COUNTY, NM			
12. CHECK THE AI	PPROPRIATE BOX(ES) TO	INDICATE NAT	TURE O	F NOTICE,	REPORT, O	OR OTHER	DATA
TYPE OF SUBMISSION	TYPE OF ACTION						
<ul><li>Notice of Intent</li><li>Subsequent Report</li></ul>	<ul> <li>Acidize</li> <li>Alter Casing</li> <li>Casing Repair</li> </ul>	Hydraulic Fracturing R			complete P&A R		
☐ Final Abandonment Notice	<ul> <li>Change Plans</li> <li>Convert to Injection</li> </ul>	Plug and Abar Plug Back	andon	Tempora Water D:		FOAK	
3. Describe Proposed or Completed Op If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f Ridgeway Arizona Oil Corp (R according to the attached prop	Illy or recomplete horizontally, give k will be performed or provide the operations. If the operation results andonment Notices must be filed o nal inspection. idgeway) requests approval	e subsurface locations Bond No. on file with s in a multiple complet only after all requirement to plug and abance	and measur BLM/BIA ion or reco nts, includ	red and true ver Required sub- mpletion in a no ing reclamation	tical depths of sequent report ew interval, a l , have been co	all pertinent m s must be filed Form 3160-4 m	arkers and zones. within 30 days ust be filed once
Ridgeway or a representative procedures.		BLM 24 hours prid	or to begi	inning pluggi	ng		
SEE ATTAC CONDITIONS (		APPROVED FOR <u>3</u> MONTH PERIOD ENDING JUL 2 1 2017					
			WITCH			ann annan Tigernach, 31 ag Chland	saggedenic foreigness
	Electronic Submission #373 For RIDGEWAY AF mmitted to AFMSS for process	RIZONA OIL CORP, sing by DAVID GLA	sent to t	he Roswell //20/2017 (170	RG0156SE)		1
Name (Printed/Typed) LAURI M STANFIELD			Title OFFICE MANAGER				
Signature (Electronic S		Date	04/20/20				
	THIS SPACE FOR	FEDERAL OR	STATE (	OFFICE US	E		
Approved By ORIG. SGD.) DAYED & ORAS			PETR	OLEUM EN	GINEER		APR 2 1 201
onditions of approval, if any, are attached rtify that the applicant holds legal or equiphich would entitle the applicant to condu-	itable title to those rights in the sub ct operations thereon.	oject lease Office					
itle 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a crin	ne for any person know	vingly and	willfully to mak	te to any depai	rtment or agenc	y of the United

\*\* BLM REVISED \*\*

MW/OCD 04/27/2017



Plugging Procedure Farrell Federal #15 API - 30-041-10433 Sec. 28, T7S, R33E, UL-B 660' FNL 1980' FEL


- 1. Prepare location and test anchors
- 2. MIRU plugging rig
- 3. Notify OCD/BLM 24 hours prior to commencement of P&A procedures
- 4. NDWH/NU BOP
- 5. RIH w/ 4 ½" CIBP on 2 3/8" workstring @ 4168' (+/-)- within 50' if top perf 4213'
  - a. Spot 35' of cement on CIBP
  - b. WOC bump plug @ 4133' (+/-)
- 6. Load well with a minimum of 9 lb. mud and conduct MIT to 500 psi., test for leak off a. Bleed pressure off after MIT
- 7. MIRU WL and RIH w/ perf gun to 2533'
  - a. Perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
- 8. TIH w/WS Squeeze 125' cement @ 2533' to 2408' (+/-)
  - a. Wait on cement
  - b. Tag plug @ 2408' or above
- 9. MIRU WL and RIH w/perf gun to 539'
  - a. Perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL

## c. RDWL 150 10. TIH w/WS – Squeeze 100 cement @ 489' to 389'

- a. 85/8" casing shoe @ 414'
- b. Wait on cement
- c. Tag plug @ 389 or above
- 11. MIRU WL and RIH w/perf gun to 60'
  - a. Perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
- 12. TIH w/WS Circulate cement plug from 60' to surface
  - a. Wait on cement
  - b. Cut off well head 4' below ground level
- 13. RDMO plugging rig
  - a. Install P&A marker
  - b. Cut off dead men
  - c. Remediate location

## 200 N. Loraine, STE 1440 Midland, TX 79701

Tel: 432-687-0303 Fax: 432-687-0321

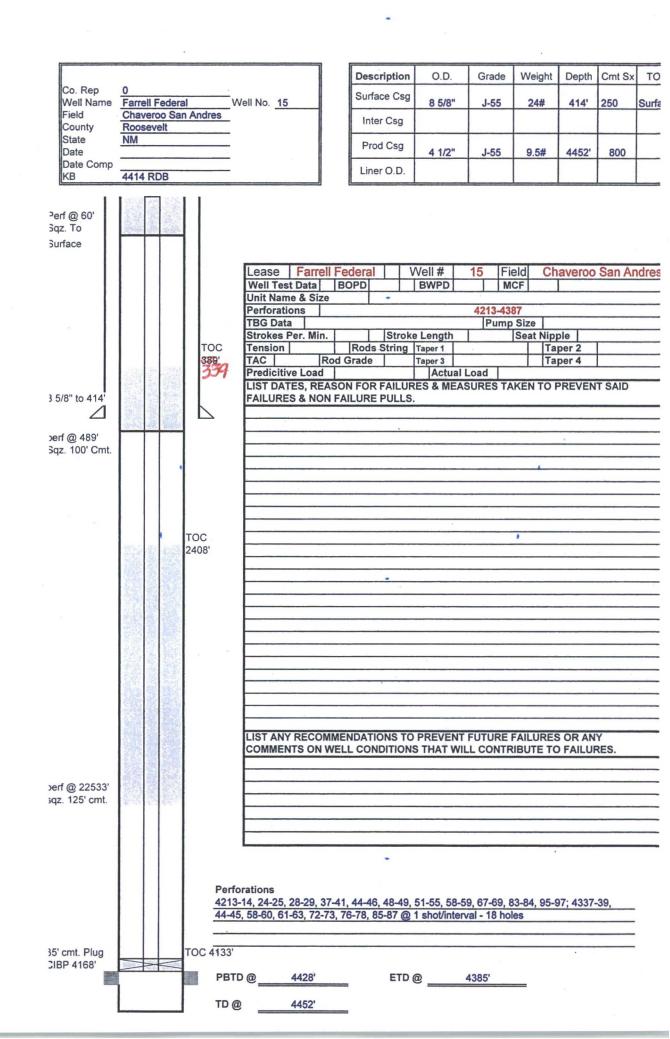

## BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety** (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office (RFO), prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.

2. <u>Notification</u>: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. <u>Monument:</u> Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Timing Limitation Lease Stipulation / Condition of Approval For Lesser Prairie-Chicken:</u> Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1 through June 15 annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D seismic operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 feet from the source of the noise.

8. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.