

	Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT OCD Hobbs SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMLC069276 6. Condian, Allottee or Tribe Name			
	SUBMIT IN TRIPLICATE - Other instructions on page 2					2019 Unit or CA/Agreement, Name and/or No.			
c v = T	1. Type of Well					8 Well Name and No.			
	2. Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM					9. API Well No. 30-025-31357-00-S1			
	3a. Address3b. Phone No. (include area code)202 S CHEYENNE AVE. SUITE 1000Ph: 432-687-3033TULSA, OK 74103Ph: 432-687-3033					10. Field and Pool or Exploratory Area BUFFALO VALLEY			
	4. Location of Well (Footage, Sec., T., R., M., or Survey Description)						or Parish, State		
	Sec 29 T18S R33E SESW 660FSL 1980FWL					LEA COUNTY, NM			
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA								
	TYPE OF SUBMISSION	TYPE OF ACTION							
	Notice of Intent	<ul> <li>Acidize</li> <li>Alter Casing</li> </ul>		<ul> <li>Deepen</li> <li>Hydraulic Fracturing</li> <li>New Construction</li> </ul>		<ul> <li>Production (Start/R</li> <li>Reclamation</li> <li>Recomplete</li> </ul>		INT TO PA <u>Pm_x</u> P&A NR	
	□ Subsequent Report	Casing Repair	_						
	☐ Final Abandonment Notice	<ul> <li>Change Plans</li> <li>Convert to Injection</li> </ul>			□ Tempora		P&A R		
	<ul> <li>If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.</li> <li>2) SET 4-1/2" CIBP @ 4,350'; PUMP 25 SXS.CMT. @ 4,350'-4,100'; CIRC. WELL.</li> <li>2) PUMP 70 SXS.CMT. @ 3,356'-2,716'(T/YATES,B/SALT(; WOC X TAG CMT. PLUG. 1500 -1391)</li> <li>3) PUMP 25 SXS.CMT. @ 1,401'-1,291'(T/ANHY.); WOC X TAG CMT. PLUG. 1500 -1391</li> <li>4) PERF. X ATTEMPT TO SQZ. 40 SXS.CMT. @ 473'-373'(8-5/8"CSG.SHOE); WOC X TAG.</li> <li>5) PERF. X CIRC. TO SURF., FILLING ALL ANNULI, 35 SXS.CMT. @ 100'-3'.</li> <li>6) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; VERIFY CMT. TO SURF. ON ALL ANNULI; WELD ON STEEL PLATE TO CSGS. X INSTALL GROUND LEVEL DRY HOLE MARKER. DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM W/ A STEEL TANK AND HAUL CONTENTS TO THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17.</li> </ul>								
	SEE ATTAC					HED FOR			
	LPC COAS Attached			SEE ATTACHED FOR CONDITIONS OF APPROVAL					
	14. I hereby certify that the foregoing is true and correct.       Electronic Submission #372903 verified by the BLM Well Information System         For CIMAREX ENERGY COMPANY OF CO, sent to the Hobbs         Committed to AFMSS for processing by DEBORAH MCKINNEY on 04/18/2017 (17DLM0869SE)         Name (Printed/Typed)       DAVID A EYLER								
	Signature (Electronic S	Submission)		ate 0//12/2	017				
	Signature     (Electronic Submission)     Date     04/13/2017       THIS SPACE FOR FEDERAL OR STATE OFFICE US					SE .			
	M $(10)$			E. E.				Date 5/19/17	
	Approved By Conditions of approval, if any, are attached. Approval of this notice does not warrant of certify that the applicant holds legal or equitable title to those rights in the subject lease			Title Eng				Date 2/19/17	
	which would entitle the applicant to conduct operations thereon. Office							y of the United	
	States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.								
	FOR RECORD ONLY MW/0CD 05/30/2017								

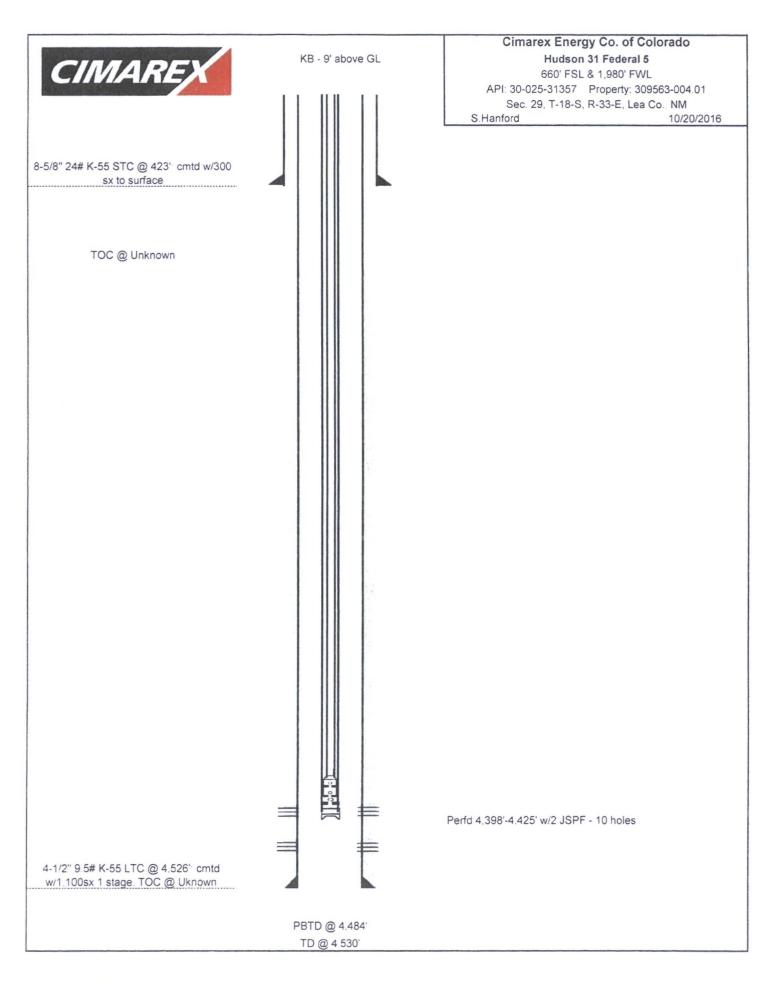

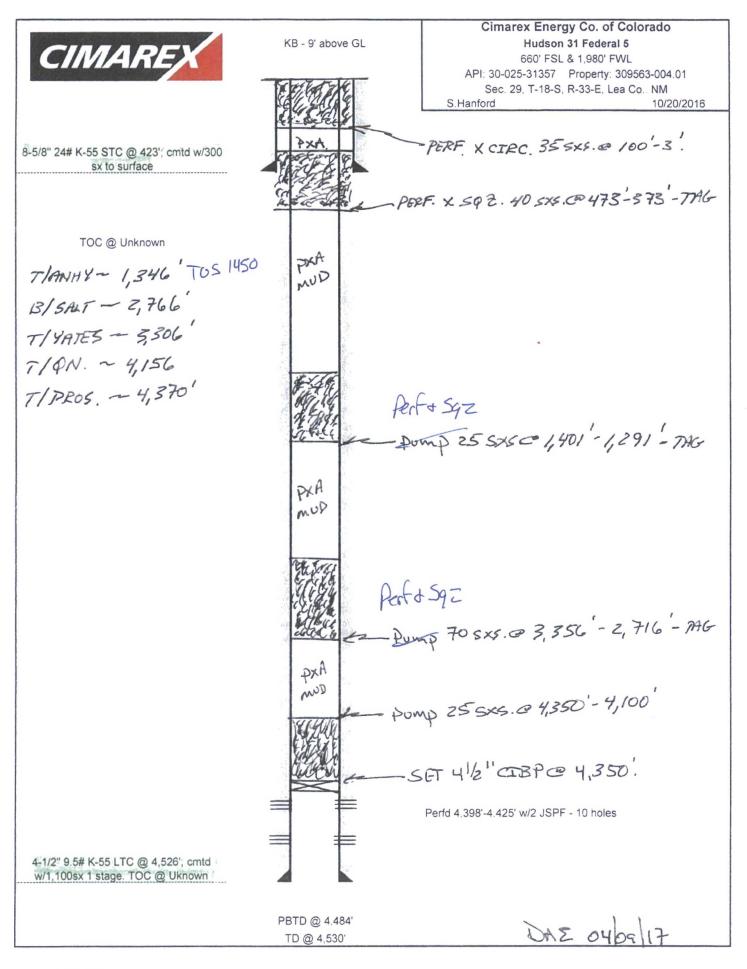

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.** 

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the <b>BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least <sup>1</sup>/<sub>4</sub> inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.** 

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>**Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u></u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted</u>**