
Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

BUREAU OF LAND MANAGEMENT
SUNDRY NOTICES AND REPORTS ON WELL#OBBS OC Ds. Lease Serial No. NMLC066438

SUNDKI I	141012000438						
Do not use thi abandoned wel	6. If Indian, Allottee or Tribe Name						
SUBMIT IN 1	TRIPLICATE - Other instruct	tions on page 2	EIVED	7. If Unit or CA/Agreen 891001066X	nent, Name and/or No.		
1. Type of Well ☐ Gas Well ☐ Other				8. Well Name and No. BELL LAKE UNIT NORTH 401H			
Name of Operator KAISER FRANCIS OIL COMF	Contact: MEL PANY E-Mail: mjp1692@gma	LANIE J WILSON if.com		9. API Well No. 30-025-44693-00	-X1		
3a. Address	Phone No. (include area code) 1: 575-914-1461		10. Field and Pool or Ex BELL LAKE-WOI	oploratory Area FCAMP NORTH			
TULSA, OK 74121-1468 4. Location of Well (Footage, Sec., T.	R M or Survey Description)			11. County or Parish, St	rate		
Sec 1 T23S R33E SWNW 210 32.335163 N Lat, 103.533562			LEA COUNTY, NM				
12. CHECK THE AF	PPROPRIATE BOX(ES) TO	INDICATE NATURE OF	NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION		TYPE OF	ACTION	NC			
Notice of Intent	☐ Acidize	□ Deepen	☐ Product	ion (Start/Resume)	☐ Water Shut-Off		
_	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclam		■ Well Integrity		
☐ Subsequent Report	☐ Casing Repair	■ New Construction	Recomp		Onshore Order Varian		
☐ Final Abandonment Notice	☐ Change Plans ☐ Convert to Injection	☐ Plug and Abandon☐ Plug Back	☐ Tempor☐ Water I	arily Abandon	ce		
Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi Kaiser-Francis Oil Company of Annular. Attached is Kaiser-F Weekly well control drills will be to a minimum of 3500 psi during	operations. If the operation results and onment Notices must be filed or inal inspection. espectfully requests a variance rancis Oil Company's Well Company	in a multiple completion or recor ally after all requirements, including the to Onshore Order 2 for to control Plan along with a BC to 5M annular will be press	npletion in a man reclamation the use of a DP diagram ure tested	new interval, a Form 3160 n, have been completed an 5M	-4 must be filed once d the operator has		
Variance approved for	or a 5 Manulas.			Field Offi Hobbs	(SM) 20		
14. I hereby certify that the foregoing is	true and correct. Electronic Submission #4246	692 verified by the BLM Well CIS OIL COMPANY, sent to	the Hobbs	•	J		
Name (Printed/Typed) MELANIE	J WILSON	Title REGULA	TORY AN	ALYST			
Signature (Electronic S	Submission)	Date 06/19/20	18				
	THIS SPACE FOR I	FEDERAL OR STATE (FFICE U	SE			
_Approved By_ZOTA STEVENS		TitlePETROLEU	JM ENGIN	EER	Date 06/26/2018		
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu							
Title 18 U.S.C. Section 1001 and Title 43			willfully to m	ake to any department or a	gency of the United		

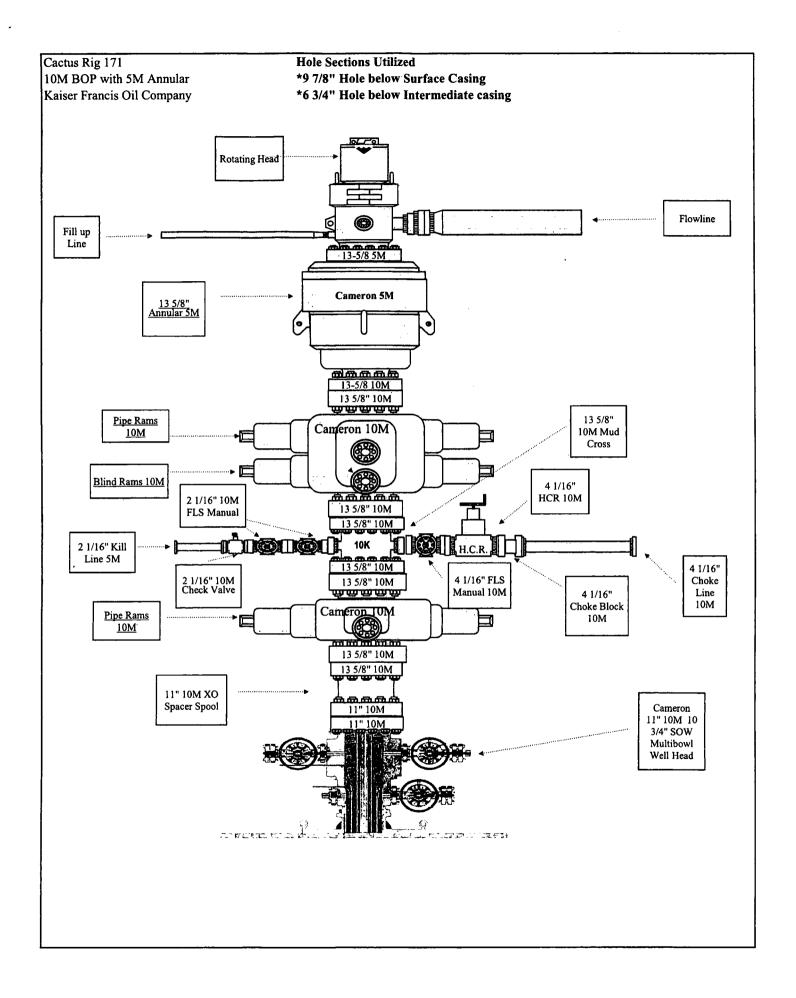

Kaiser-Francis Oil Company Well Control Plan

A. Component and Preventer Compatibility Table

Component	OD	Preventer	RWP
Drill Pipe	5"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Heavyweight Drill Pipe	5"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Drill Collars & MWD Tools	6 1/4 - 6 3/4"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Mud Motor	6 1/4 - 6 3/4"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
Production Casing	5 1/2"	Upper VBR: 3.5 – 5.5 Lower VBR: 3.5 – 5.5	10M
All	0 – 13 5/8"	Annular	5M
Open Hole		Brind Rams	10M

B. Well Control Procedures

- I. General Procedures While Drilling:
 - a. Sound alarm alert crew
 - b. Space out drill string
 - c. Shut down pumps and stop rotary
 - d. Open HCR
 - e. Shut well in, utilizing upper VBRs
 - f. Close choke
 - g. Confirm shut in
 - h. Notify rig manager and Kaiser-Francis Oil Company company representative
 - i. Call Kaiser-Francis Oil Company engineer
 - j. Read and record:
 - i. Shut in drill pressure and shut in casing pressure
 - ii. Pit gain
 - iii. Time
 - k. Regroup, identify forward plan

II. General Procedures While Tripping:

- a. Sound alarm alert crew
- b. Stab full opening safety valve and close
- c. Space out drill string
- d. Open HCR
- e. Shut well in, utilizing upper VBRs
- f. Close choke
- g. Confirm shut in
- h. Notify rig manager and Kaiser-Francis Oil Company company representative
- i. Call Kaiser-Francis Oil Company engineer
- j. Read and record:
 - i. Shut in drill pressure and shut in casing pressure
 - ii. Pit gain
 - iii. Time
- k. Regroup, identify forward plan

Kaiser-Francis Oil Company Well Control Plan

III. General Procedures While Running Casing:

- a. Sound alarm alert crew
- b. Stab full opening safety valve and close
- c. Space out drill string
- d. Open HCR
- e. Shut well in, utilizing upper VBRs
- f. Close choke
- g. Confirm shut in
- h. Notify rig manager and Kaiser-Francis Oil Company company representative
- i. Call Kaiser-Francis Oil Company engineer
- Read and record:
 - i. Shut in drill pressure and shut in casing pressure
 - ii. Pit gain
 - iii. Time
- k. Regroup, identify forward plan

IV. General Procedures With No Pipe in Hole (Open Hole):

- .a. Sound alarm alert crew
- b. Open HCR
- c. Shut well in with blind rams
- d. Close choke
- e. Confirm shut in
- f. Notify rig manager and Kaiser-Francis Oil Company company representative
- g. Call Kaiser-Francis Oil Company engineer
- h. Read and record:
 - i. Shut in drill pressure and shut in casing pressure
 - ii. Pit gain
 - iii. Time
- i. Regroup, identify forward plan

V. General Procedures While Pulling BHL Through BOP Stack:

- 1. Prior to pulling last joint of drill pipe through stack
 - A. Perform flow check and if flowing:
 - a. Sound alarm alert crew
 - b. Stab full opening safety valve and close
 - c. Space out drill string with tool joint just beneath upper pipe ram
 - d. Open HCR
 - e. Shut well in utilizing upper VBRs
 - f. Close choke
 - g. Confirm shut in
 - h. Notify rig manager and Kaiser-Francis Oil Company company representative
 - i. Call Kaiser-Francis Oil Company engineer
 - j. Read and record:
 - i. Shut in drill pressure and shut in casing pressure
 - ii. Pit gain
 - iii. Time
 - k. Regroup, identify forward plan

Kaiser-Francis Oil Company Well Control Plan

- 2. With BHL in the BOP stack and compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm alert crew
 - b. Stab full opening safety valve and close
 - c. Space out drill string with tool joint just beneath upper pipe ram
 - d. Open HCR
 - e. Shut well in utilizing upper VBRs
 - f. Close choke
 - g. Confirm shut in
 - h. Notify rig manager and Kaiser-Francis Oil Company company representative
 - i. Call Kaiser-Francis Oil Company engineer
 - i. Read and record:
 - i. Shut in drill pressure and shut in casing pressure
 - ii. Pit gain
 - iii. Time
 - k. Regroup, identify forward plan
- 3. With BHA in the BOP stack and no compatible ram preventer and pipe combo immediately available
 - a. Sound alarm alert crew
 - b. If possible to pick up high enough, pull string clear of the stack and follow Open Hole scenario (III)
 - c. If impossible to pick up high enough to pull the string clear of the stack:
 - i. Stab crossover, make up one joint/stand of drill pipe and full opening safety valve and close
 - ii. Space out drill string with tool joint just beneath the upper pipe ram
 - iii. Open HCR
 - iv. Shut in utilizing upper VBRs
 - v. Close choke
 - vi. Confirm shut in
 - vii. Notify rig manager and Kaiser-Francis Oil Company company representative
 - viii. Read and record:
 - 1. Shut in drill pipe pressure and shut in casing pressure
 - 2. Pit gain
 - 3. Time
 - d. Regroup and identify forward plan

^{**} If annular is used to shut in well and pressure build to or is expected to get to 50% of RWP, confirm space-out and swap to upper VBRs for shut in.