Forr; 3160-5 (June 2015) BI SUNDRY Do not use this	FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMLC032339B 6. If Indian, Allottee or Tribe Name						
abandoned well. Use form 3160-3 (APD) for such proposals. HOBBS OCI SUBMIT IN TRIPLICATE - Other instructions on page 2							
1. Type of Well JAN 16 2019					8. Well Name and No.		
Oil Well 🖸 Gas Well 🔲 Other					MLMU 191		
2. Name of Operator OXY USA INCORPORATED Contact: DAVID STEWART RECEIVED 9. API Well No. E-Mail: david_stewart@oxy.com 9. API Well No. 30-025-11091-00-S1							
3a. Address 3b. Phone No. (include are P O BOX 4294 Ph: 432-685-5717 HOUSTON, TX 77210-4294 Ph: 432-685-5717					10. Field and Pool or Exploratory Area LANGLIE		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State		
Sec 10 T24S R37E NWNE 660FNL 1980FEL					LEA COUNTY, NM		
12. CHECK THE AI	PPROPRIATE BOX(ES) TO	INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER DA	ТА
TYPE OF SUBMISSION TYPE OF ACTION							
Notice of Intent		Dee	pen	Product	Production (Start/Resume)		ter Shut-Off
Subsequent Report	Alter Casing		raulic Fracturing	🗖 Reclam			ll Integrity
	Casing Repair	-	Construction	Recom		Other	
Final Abandonment Notice	Change Plans		Plug and Abandon Plug Back		orarily Abandon r Disposal		
determined that the site is ready for f TD-3643' PBTD-3635' Pe 9-5/8" 36# csg @ 264' w/ 1655 5-1/2" 15.5# csg @ 3334' w/ 8 4" liner @ 3270-3471' w/ slotte 1. M&P 25sx cmt @ 3384-322 2. M&P 25sx cmt @ 2450-230 3. Perf @ 1250' sqz 60sx cmt 4. Perf @ 314' sqz 120sx cmt 10# MLF between plugs - Abc	SEE ATTACHED FOR CONDITIONS OF APPROVAL						
14. I hereby certify that the foregoing is	Electronic Submission #4422	261 verifie	d by the BLM We ATED, sent to th	I Information	n System		
For OXY USA INCORPORATED, sent to the Hobbs Committed to AFMSS for processing by PRISCILLA PEREZ on 11/01/2018 (19PP0274SE) Name (Printed/Typed) DAVID STEWART Title SR. REGULATORY ADVISOR							
Name (Printed/Typed) DAVID S1	Title SR. RE	GULATUR	ADVISOR				
Signature (Electronic S	Date 11/01/2	018					
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
Approved By_ James Le Comes			Title	ALT			1 2.18-18 Date
Conditions of approval, if any, are attache certify that the applicant holds legal or equivities would enditle the applicant to condu	Office	140		·····			
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a crim statements or representations as to an	e for any pe ny matter w	rson knowingly and thin its jurisdiction.	willfully to m	ake to any department or	agency of	the United
(Instructions on page 2) ** BLM REVISED **							
FOR RECORD ONLY Kerry Jorthe NMOCD 1-17-19							


1

OXY USA WTP LP - Current Myers Langlie Mattix Unit #191 API No. 30-025-11091


1

.

٣

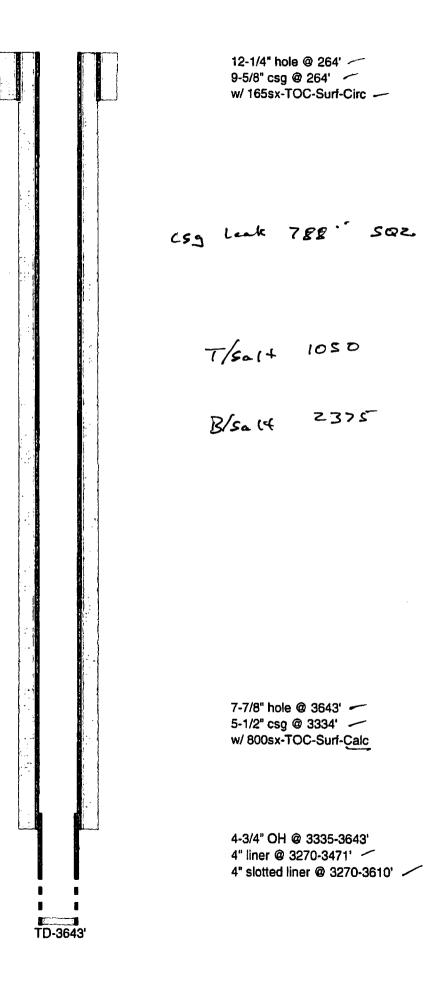

OXY USA WTP LP - Proposed Myers Langlie Mattix Unit #191 API No. 30-025-11091

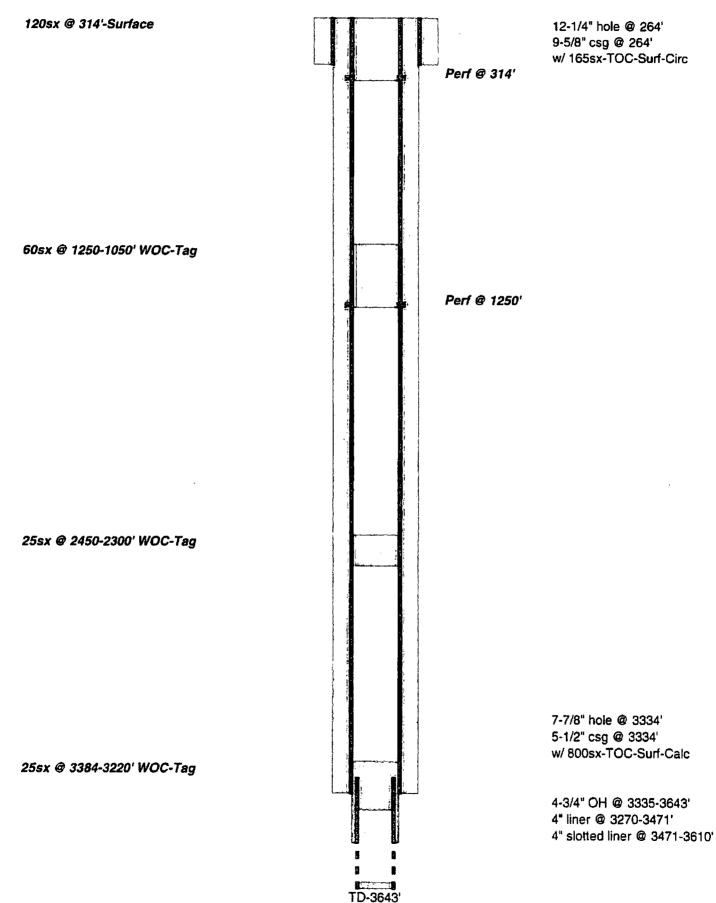

4 P

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.