UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED OMB NO. 1004-0137

Expires: January 31, 2018

5. Lease Serial No.

_			
	NATIO	NEG AND	CHIMIETTE

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals 10885

abandoned wei	i. Ose form 5100-3 (AFI	e, ioi sucii p	n oposais PO	SDO C				
SUBMIT IN 1	RIPLICATE - Other inst	ructions on	page 2 JA	N 1 6 20	7. If Unit or CA/Agreen	nent, Name and/or No.		
1. Type of Well Oil Well Gas Well Oth	er		RE	CEIV	8. Well Name and No.	06		
Name of Operator COG OPERATING LLC	Contact: E-Mail: abbym@bo	ABIGAIL AN mandassociat	DERSON		9. API Well No. 30-025-33902-00			
3a. Address ONE CONCHO CENTER 600 MIDLAND, TX 79701-4287) W ILLINOIS AVENUE	3b. Phone No Ph: 432-58	. (include area code) 0-7161		10. Field and Pool or Ex TONTO	xploratory Area		
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)			11. County or Parish, St	tate		
Sec 14 T19S R33E NWSW 16	50FSL 330FWL				LEA COUNTY, N	IM		
12. CHECK THE AP	PROPRIATE BOX(ES)	TO INDICA	TE NATURE OF	NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION			TYPE OF	ACTION				
Notice of Intent	☐ Acidize	☐ Dee	pen	☐ Product	tion (Start/Resume)	■ Water Shut-Off		
<u> </u>	□ Alter Casing	☐ Hyd	raulic Fracturing	☐ Reclamation		■ Well Integrity		
☐ Subsequent Report ☐ Casing Repair			☐ New Construction		olete	□ Other		
☐ Final Abandonment Notice	□ Change Plans	10 🗷 Plug	g and Abandon	☐ Tempor	arily Abandon			
	☐ Convert to Injection	☐ Plug	g Back	☐ Water I	ter Disposal			
following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. 1. Set 4 1/2" CIBP @ 3655'. Pressure test csg. Circulate hole w/ MLF. Spot 25 sx cmt @ 3655-3305'. 2. Spot 25 sx cmt @ 3146-2796'. WOC & Tag (B/Salt) 3. Spot 25 sx cmt @ 1700-1350. WOC & Tag (T/Salt & 8 5/8" Shoe) 4. Spot 10 sx cmt @ 60' to surface.								
				SE	E ATTACHED	FOR		
						- · •		
CONDITIONS OF APPROVA								
Below ground 1	eval dry	hole	narker	Cep	ical			
14. I hereby certify that the foregoing is	Electronic Submission #	OPERATING (LC, sent to the H	obbs	_			
	NDERSON	ang by DEBO	Title AGENT	11 121 11/2010	5 (13DENIO 1303E)			
Signature (Electronic S			Date 12/14/20					
	THIS SPACE FO	R FEDERA	L OR STATE (OFFICE U	SE 			
Approved By	e a. a) 22_	Title SPE	7		12-19-18 Date		
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu-	itable title to those rights in the		Office LFE	? 				
Fitle 18 U.S.O. Section 1001 and Title 43 U.S. States any false, fictitious or fraudulent s				willfully to m	ake to any department or a	gency of the United		

(Instructions on page 2)
*** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

Author:	JCH (8/2018)		
Well Name	Federal USA L #6		
Field	Tonto Seven Rivers	API#:	30-025-33902
County	Lea	Prop #:	
State	New Mexico	Zone:	Seven Rivers
Spud Date	7/23/1997		1650' FSL & 330' FWL
GL	3.659'		Sec 14 T19S R33E

Description	O.D.	Grade	Weight	Depth	Cmt Sx	тос
Surface Csg	8.625"	K-55	24	1455'	700	surface
Inter Csg						
Prod Csg	4.5"	N-80	11.6	3900'	950	300,
Liner						

12-1/4" hole 8-5/8" 24# K-55 @ 1,455' with 700 sks, circ 50 sx TOC @ surf

B/5alt 3096

Yates 3320

7 Ruers 3653

7-7/8" hole

4-1/2" 11.6# N-80 @ 3,900' with 950 sks, did not circ CMT

100 @ 300

3,704' - 3,716' & 3,626' - 3,636' (Seven Rivers) 22 holes 2150 gals 15% HCL 412 bbls 30# borate & 54,620# sand


2-3/8" TBG @ 3,756'

PBTD @ 3,848' TD @ 3,900'

32.6574783 -103.6413269

Author:	JCH (8/2018)			
Well Name	Federal USA L #6			
Field	Tonto Seven Rivers	API#:	30-025-33902	
County State	Lea New Mexico	Prop #: Zone:	Seven Rivers	
Spud Date	7/23/1997	20/10.	1650' FSL & 330' FWL	
GL	3,659'		Sec 14 T19S R33E	

Description	O.D.	Grade	Weight	Depth	Cmt Sx	тос
Surface Csg	8.625"	K-55	24	1455'	700	surface
Inter Csg						
Prod Csg	4.5"	N-80	11.6	3900'	950	300'
Liner						

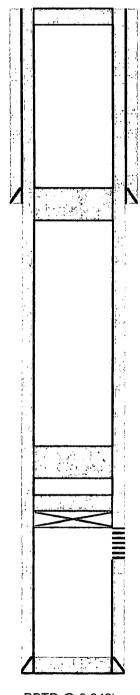

4. Spot 10 sx cmt @ 60' to Surface.

12-1/4" hole

8-5/8" 24# K-55 @ 1,455' with 700 sks, circ 50 sx TOC @ surf

3. Spot 25 sx cmt @ 1700-1350'. WOC & Tag (T/Salt & 8 5/8" Shoe)

- 2. Spot 25 sx cmt @ 3146-2796'. WOC & Tag (B/Salt)
- 1. Set 4 1/2" CIBP @ 3655'. Pressure test csg. Circulate hole w/ MLF. Spot 25 sx cmt @ 3655-3305'
 - 3,704' 3,716' & 3,626' 3,636' (Seven Rivers) 22 holes 2150 gals 15% HCL 412 bbls 30# borate & 54,620# sand
 - 2-3/8" TBG @ 3,756'

7-7/8" hole

4-1/2" 11.6# N-80 @ 3,900' with 950 sks, did not circ CMT TOC @ 300'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted