
Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No.		
					NMLC069052 6. If Indian, Allottee or Tribe Name		
SUBMIT IN 1	RIPLICATE - Other inst	tructions on		BBS (ment, Name and/or No.	
1. Type of Well		··········	J/	AN 162(Well Name and No. WDQSU 33		
Oil Well Gas Well Oth 2. Name of Operator		CONNIE SW		CEIV	API Well No.		
CHAPARRAL ENERGY LLC	E-Mail: CSWAN@		NDOK.COM		30-025-12285-0		
3a. Address3b. Phone No. (include area code)701 CEDAR LAKE BOULEVARD OKLAHOMA CITY, OK 73114918-621-6533)	10. Field and Pool or Exploratory Area DOLLARHIDE		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State		
Sec 31 T24S R38E SENW 1750FNL 2310FWL					LEA COUNTY, NM		
12. CHECK THE AF	PROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE	, REPORT, OR OTH	IER DATA	
TYPE OF SUBMISSION	F SUBMISSION TYPE OF ACTION						
X Notice of Intent		🗖 Dee	•	-	tion (Start/Resume)	U Water Shut-Off	
Subsequent Report	Alter Casing		Iraulic Fracturing	C Reclam		Well Integrity	
☐ Final Abandonment Notice	 Casing Repair Change Plans 	Y*	v Construction g and Abandon	Recom Tempo	plete prarily Abandon	□ Other	
	Convert to Injection				Disposal		
 RU WLU, RIH AND SET C CIRCULATE 9.5 PPG MLF SPOT 30SX FROM 2800' - PERF @ 1300' AND SQUE PERF @ 325' AND SQUES SURFACE. CUT OFF WELLHEAD. IN 	AND TEST CASING. 2400'. <u>WOC & TAG.</u> (YA EZE FROM 1300' - 1100 EZE FROM SURFACE - 3	ATES/B.SAL)' W/40SX OF 325' W/100S)	T) F CLASS "C" CE K OF CLASS "C"	MENT. WO CEMENT.	ONDITIONS (c & tag. (t. salt) verify cement)		
CLOSED LOOP CONTAINME	NT SYSTEM WILL BE U	ISED FOR FL	UIDS.				
14. I hereby certify that the foregoing is	Electronic Submission #	443829 verifie	d by the BLM We	II Informatio	on System	<u></u>	
	For CHAPA mitted to AFMSS for proc	essing by PRI					
Name(Printed/Typed) MATTHEV	VPATTERSON	· · · · · · · · ·	Title OPERA	TIONS MA	NAGER		
Signature (Electronic S	ubmission)		Date 11/13/2	018			
	THIS SPACE FO	DR FEDER	L OR STATE	OFFICE L	JSE		
	11	•	14	11-7	<u> </u>	12-17-1	
Approved By Conditions of approval, if any, are attached certify that the applicant holds legal or equ	A. Approval of this notice does	not warrant or	Title S/	<u> </u>	<u> </u>	Date	
which would extitle the applicant to condu Title 18 U.S.C. Section 1001 and Title 43	ct operations thereon. U.S.C. Section 1212, make it a	crime for any p	Office 24	2 I willfully to n	nake to any department or	agency of the United	
States any false, fictitious or fraudulent s	tatements or representations as	to any matter w	ithin its jurisdiction.				
(Instructions on page 2) ** BLM REV	SED ** BLM REVISEI	D ** BLM RI	EVISED ** BLM	N REVISE	D ** BLM REVISE	D **	
FOR RECO	DRD ONLY	2	1+	د د		· ·	
a maring	aur auri	ren	y toume	~ NI	mocD 1-	-17-19	
1. S.		C	Γ			- 1	

WELLBORE DIAGRAM WEST DOLLARHIDE QUEEN SAND UNIT #33

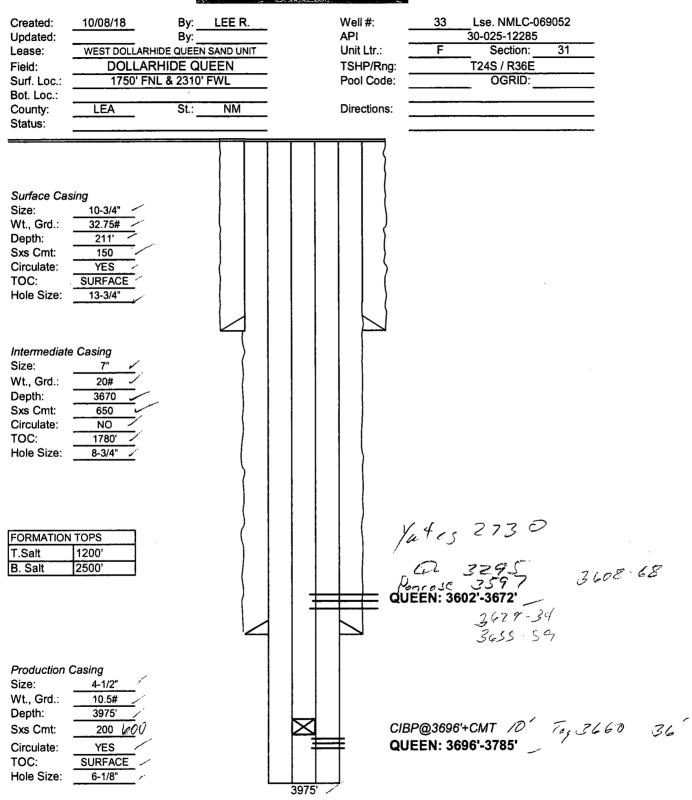

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.