#### **UNITED STATES** DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

**OCD Hobbs** 

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

#### 5. Lease Serial No. NMLC068037

**SUNDRY NOTICES AND REPORTS ON WELLS** Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals

6. If Indian, Allottee or Tribe Name

abandoned from cost to microst of (ALD) for cash proposation						
SUBMIT IN TRIPLICATE - Other instructions on photoBBS OCD					7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well ☐ Gas Well ☐ Other			JAN 16	2019	8. Well Name and No. MALLON 29 FEDERAL 02	
2. Name of Operator Contact: DAVID A EYLER CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.CO.				VED	9. API Well No. 30-025-33835-00-S1	
3a. Address 600 N MARIENFELD STE 600 MIDLAND, TX 79703	3b. Phone No. (include area code) Ph: 432-687-3033			10. Field and Pool or Exploratory Area QUAIL RIDGE		
4. Location of Well (Footage, Sec., T.			11. County or Parish, State			
Sec 29 T19S R34E NWSE 23			LEA COUNTY, NM			
12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA						
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent     ■     Notice of Intent     Notice of Inten	☐ Acidize	□ De	epen	☐ Product	ion (Start/Resume)	☐ Water Shut-Off
<del></del>	☐ Alter Casing	, 🗆 Ну	draulic Fracturing	☐ Reclama	ation	■ Well Integrity
☐ Subsequent Report	□ Casing Repair	1 . –	w Construction	☐ Recomp		☐ Other
☐ Final Abandonment Notice	☐ Change Plans	Plu 🗷 🗷	g and Abandon		arily Abandon	
222222	☐ Convert to Injection	☐ Plu	ig Back	☐ Water I	Disposal	
following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.  1) SET 5-1/2" CIBP @ 9.409'; CIRC.WELL W/ M.L.F.; PUMP 25 SXS.CMT.@ 9.409' 9.210'.  2) PUMP 35 SXS.CMT. @ 8.275'-8.015'(T/B.S.,5-1/2"DV TOOL); WOC X TAG CMT. PLUG.  3) PUMP 75 SXS.CMT. @ 6,156'-5,591'(T/S.A.,T/DLWR.).  4) PUMP 25 SXS.CMT. @ 3,546'-3,416'(T/YATES,B/SALT); WOC X TAG CMT. PLUG.  5) PUMP 55 SXS.CMT. @ 1,864'-1,453'(T/SALT,T/ANHY.,9-5/8"CSG.SHOE); WOC X TAG.  6) MIX X CIRC. TO SURF. 15 SXS.CMT. @ 100'-3'.  7) DIG OUT X CUT OFF WELLHEAD 3' B.G.L.; WELD ON STEEL PLATE TO CSGS. X INSTALL GROUND LEVEL DRY.  HOLE MARKER.  DURING THIS PROCEDURE WE PLAN TO USE THE CLOSED-LOOP SYSTEM W/ A STEEL AND HAUL CONTENTS TO THE REQUIRED DISPOSAL, PER OCD RULE 19.15.17.  14. I hereby certify that the foregoing is true and correct.  Electronic Submission #443114 verified by the BLM Well Information System						
Com Name(Printed/Typed) DAVID A [	NY OF CO, sent to the Hobbs SCILLA PEREZ on 11/08/2018 (19PP0347SE) Title AGENT					
			D			
Signature (Electronic S	Date 11/08/2018 AL OR STATE OFFICE USE					
Approved By James	a. Limo	⋜	Title 57	ET_		/2-17-18 Date
Conditions of approval, if any, are attached certify that the applicant holds legal or equation would entitle the applicant to condu	Office CFO					
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.						

(Instructions on page 2) \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

FOR RECORD ONLY Kerry Forther NMOCD 1-17-19

# CIMAREX

#### Cimarex Energy Co. of Colorado MALLON '29' FED #2

API 30-025-33835 2310' FSL & 2310' FEL, Sec 29, T19S R34E Lea County, NM GL: 3674' KB: 3691'

9 5/8" 36# J55 csg @ 1503'
Cmt w/1000 sx, circ to surface

12 1/4 14 3/4" hole to 1503'

> Rustler 1623 Sælede 1814 Tens: 1 3283 Yeter 3481 72 3791 Qu 4510 Per2 4841 GB 4928

DV tool @ 8065'


Del 5641 SA 6116 BS 8175

5 1/2" 17# N80 csg @ 10,250' / Cmt w/4350 sx circ to surface /

> PBTD: 10,000' TD: 11,250'

Bone Springs Perfs 9,414'-19', 9436'-41', 9494'-9504', 9539'-59' 10,129'-152' (12/97)

8 3/4" hole to TD 11,250'

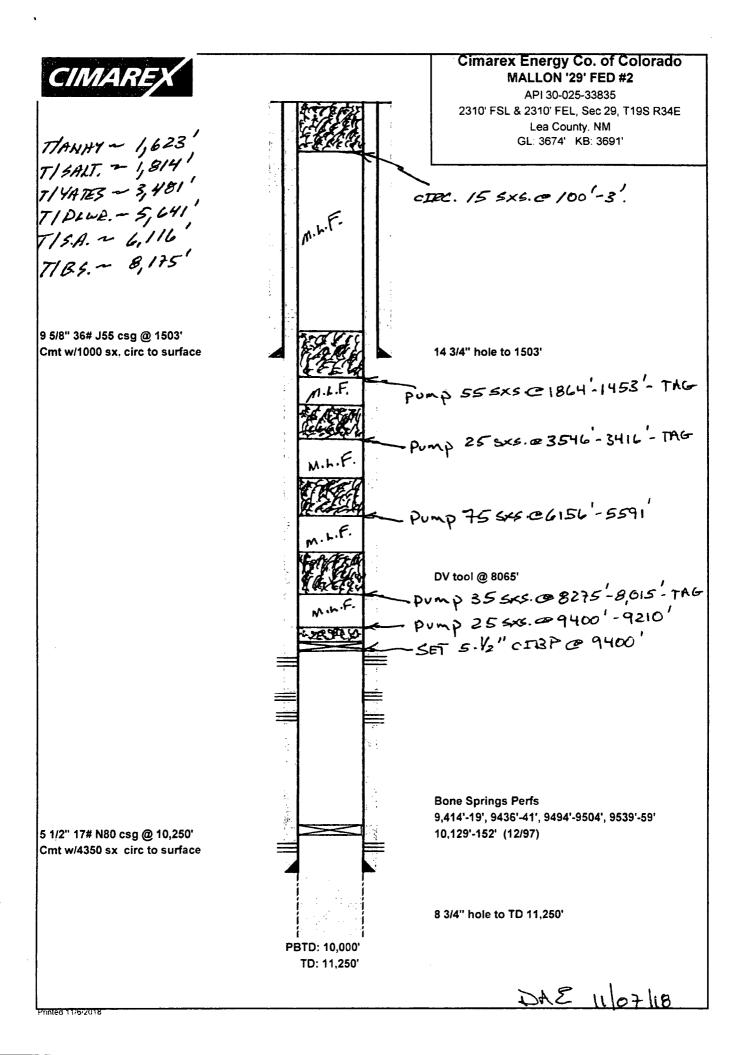

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

### Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted