Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artocia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

RI	JREAU OF LAND MANA	GEMENT		<u> </u>	Expues. Juli	um y 51, 2010
SUNDRY NOTICES AND REPORTS ON WELLS					5. Lease Serial No.	
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or	Tribe Name
abandoned wei	I. Use form 3160-3 (AP	D) for such p	oposais. HO	DE	ŕ	
SUBMIT IN TRIPLICATE - Other instructions on page 2 MAR 11.2019 f Unit or CA/Agreement, Name and/or						
1. Type of Well					Name and No.	01
Oil Well Gas Well Oth				SECE		
2. Name of Operator EOG RESOURCES INCORPO	KAY MADDOX ox@eogresources.com			9. API Well No. 30-025-27623-00-S1		
3a. Address PO BOX 2267 MIDLAND, TX 79702		3b. Phone No. (include area code) Ph: 432-686-3658			10. Field and Pool or Exploratory Area RED HILLS-BONE SPRING, NORTH	
4. Location of Well (Footage, Sec., T.)			11. County or Parish, State		
Sec 15 T25S R33E SWNE 19				LEA COUNTY, NM		
12. CHECK THE AP	PROPRIATE BOX(ES)	TO INDICAT	TE NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA
TYPE OF SUBMISSION						
The National Classical	☐ Acidize ☐ Deepen		☐ Production (Start/Resume)		☐ Water Shut-Off	
Notice of Intent	☐ Alter Casing 🤻	☐ Hydraulic Fracturing		☐ Reclamation		■ Well Integrity
☐ Subsequent Report	□ Casing Repair	New Construction		☐ Recomplete		☐ Other
☐ Final Abandonment Notice	☐ Change Plans	Plug and Abandon		□ Temporarily Abandon		
	Convert to Injection	n 🗖 Plug Back		☐ Water Disposal		
testing has been completed. Final Ab determined that the site is ready for final EOG PROPOSES TO PLUG ALSO ATTACHED.	nal inspection.	·	•	•	•	·
				055	TT 1 0	
SEE ATTACHED FOR						
CONF					DITIONS OF APPROVAL	
CONDITIONS OF APPROVAL						
Below ground	I level de	y ha	le ma	rKer	required	2
14. I hereby certify that the foregoing is	true and correct. Electronic Submission #	454604 verifie	by the BLM Wel	Il Information	System	
Commi		JRCES INCOR	PORATED, sent 1	to the Hobbs	-	
Name (Printed/Typed) KAY MADDOX				ATORY SPE		
			······································			
Signature (Electronic S	Submission)		Date 02/13/2	019		
	THIS SPACE FO	OR FEDERA	L OR STATE	OFFICE U	SE	
Approved By James O. Como		P	Title SA	ET		Z-Z3-19 Date
Conditions of approval of any, are attached. Approval of this notice does not waterify that the applicant holds legal or equitable title to those rights in the subject which would entitle the applicant to conduct operations thereon.			Office <i>Cf</i>	·0		
Title & U.S.C Section 1001 and Title 43 States any false, fictitious or fraudulent				willfully to ma	ike to any department or a	igency of the United

(Instructions on page 2)
*** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** X7 NMOCD 3-22-19



Ochoa Federal #1 Re-entry - P&A

SECT 15, T25S, R33E

API # 30-025-276230100

NO SR OF CIBPR 11620, RIH Tag. ABTD. or submit SR.

- 1. Set 9.625" CIBP at 10,962' and dump 45 sks Class H on top of CIBP to cover.
- 2. Spot a 45 sk class H cement from 9,178' 9,078'. 9228 9628.
- 3. Spot 40 sx class C cement from 7,460′ 7,360′, WOC & Tag. **75/0 7330**
- 4. Spot 40 sx class C cement from 6,340' 6,240'. 6390 6230
- Perf & Sgz. 5. Spot 45 sx class C cement from 5,065'-4,941'; WOC & Tag. 5075- 4925
- Perft Saz 6. Spot 40 sx class C cement from 3,000' 2,000' 2870 600 725
- Per F & Spot 40 sx class C cement from 1,100'-1,010'; WOC & Tag. 1160-1060
- 8. Spot 40 sx class C cement from 660' 560'; WOC & Tag.
- Acc + 2 Spot 85 sx class C cement from 250' 0'; Verify Cement is to surface.
 - 10. Cut off WH 3' below surface; Verify cement to surface.
 - 11. Weld on P&A marker. Cut off anchors 3' below surface and clean location.


Ochoa Federal #1 R/E Red Hills (Bone Springs) Field Lea County, NM

1,979' FNL 1,979' FEL Section 15 Township 25 South Range 33 East

API #: 30-025-27623

Current Wellbore

KB: 3,400' GL: 3,369'

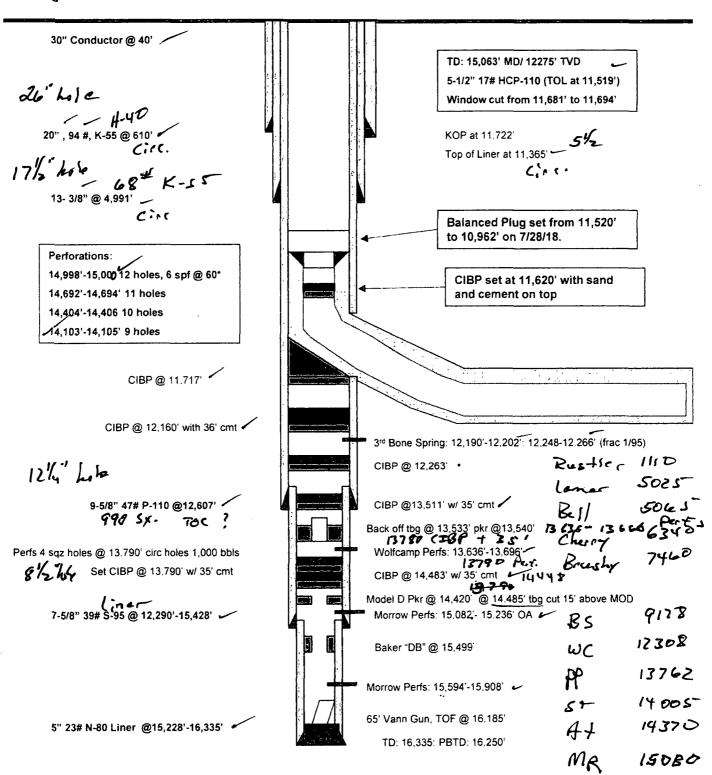


Ochoa Federal #1 R/E Red Hills (Bone Springs) Field Lea County, NM

1,979' FNL 1,979' FEL Section 15 Township 25 South Range 33 East

API #: 30-025-27623

Proposed Wellbore

KB: 3,400' GL: 3,369'

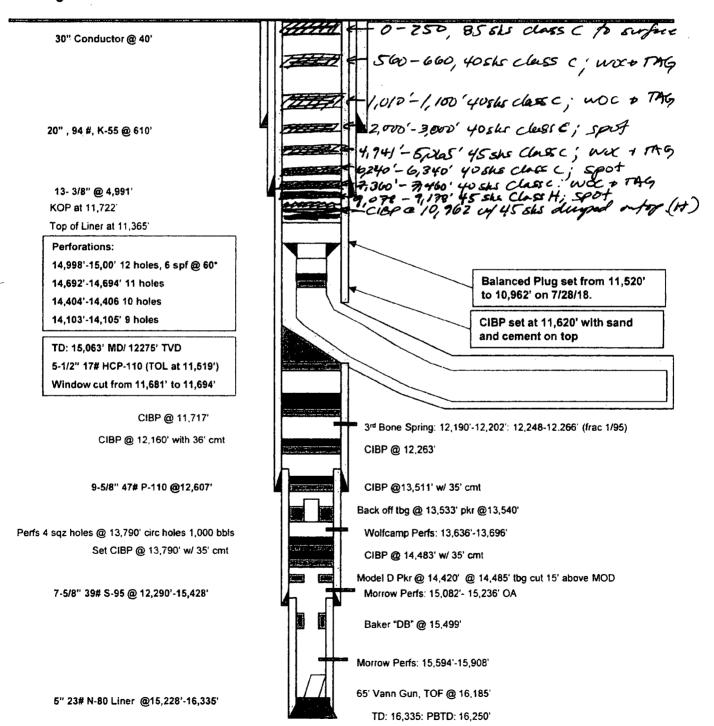

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted