SUNDRY	UREAU OF LAND MANA NOTICES AND REPO		~	5. Lease Serial No. NMLC029410B	
Do not use thi abandoned wei	is form for proposals to II. Use form 3160-3 (API	D) for such proposals.	MAP 1 1 201	6. If Indian, Allottee o	r Tribe Name
SUBMIT IN T	TRIPLICATE - Other inst			7. If Unit or CA/Agre 920003410	ement, Name and/or
1. Type of Well	ег		RECEI	8. Well Name and No. MCA UNIT 310	
2. Name of Operator CONOCOPHILLIPS COMPAN	Contact:	GREG BRYANT YANT@BASICENERGYSER	VICES.COM	9. API Well No. 30-025-24108-0	00-S1
3a. Address MIDLAND, TX 79710	3b. Phone No. (include area of Ph: 432-563-3355 Fx: 432-563-3364	code)	10. Field and Pool or Exploratory Area MALJAMAR		
4. Location of Well (Footage, Sec., T		) )		11. County or Parish,	State
Se 30 T17S R32E NENW 12	95FNL 1365FWL			LEA COUNTY,	NM
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICATE NATUR	E OF NOTICE	I , REPORT, OR OTI	IER DATA
TYPE OF SUBMISSION		TYP:	E OF ACTION		
Notice of Intent	🗖 Acidize	Deepen	🗖 Produc	tion (Start/Resume)	U Water Shut-
	Alter Casing	🗖 Hydraulic Fractur	÷		🗖 Well Integri
Subsequent Report	Casing Repair	New Construction		•	Other
Final Abandonment Notice	<ul> <li>Change Plans</li> <li>Convert to Injection</li> </ul>	Plug and Abandon	n 🔲 lempo	rarily Abandon	
<ol> <li>Describe Proposed or Completed Opt If the proposal is to deepen directiona Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for final 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 3400'</li> </ol>	rk will be performed or provide l operations. If the operation re pandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pre-	the Bond No. on file with BLM sults in a multiple completion of led only after all requirements, in	/BIA. Required su recompletion in a acluding reclamation	ubsequent reports must be new interval, a Form 316 on, have been completed	filed within 30 day
If the proposal is to deepen directions Attach the Bond under which the won following completion of the involved testing has been completed. Final At determined that the site is ready for fi 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3000' - 28	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pre- 400' we corress 380'.	The Bond No. on file with BLM sults in a multiple completion of led only after all requirements, in SSURE test CSG	/BIA. Required so recompletion in a netuding reclamation SEE ATT	ibsequent reports must be new interval, a Form 316	filed within 30 day: 0-4 must be filed on and the operator has
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3000' - 28	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pres 400'	the Bond No. on file with BLM sults in a multiple completion of led only after all requirements, in ssure test csg ean location	VBIA. Required so recompletion in a ncluding reclamati SEE ATT, CONDITI	ACHED FOR ONS OF APPF	filed within 30 day: 0-4 must be filed or and the operator has
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for ff 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 850' - 7) Spot-10sx cmt @ 60' - 3'. V 8) RDMO. Cut off WH & ancho 28 14. 1 hereby certify that the foregoing is	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pres 400'	The Bond No. on file with BLM sults in a multiple completion of led only after all requirements, in ssure test csg ean location	VBIA. Required st recompletion in a ncluding reclamatic SEE ATT, CONDITI	ACHED FOR ACHED FOR ONS OF APPF	filed within 30 day 0-4 must be filed or and the operator has
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for ff 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 850' - 7) Spot-10sx cmt @ 60' - 3'. V 8) RDMO. Cut off WH & ancho 28 14. 1 hereby certify that the foregoing is	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pre- 400' $\omega e c$ Tag 380'. - 1700'. WOC-Tag - 650'. WOC-Tag - 70'. WOC-Ta	the Bond No. on file with BLM sults in a multiple completion or led only after all requirements, in ssure test csg ean location 453962 verified by the BLM OPHILLIPS COMPANY, sen sing by DEBORAH MCKINN	VBIA. Required st recompletion in a ncluding reclamatic SEE ATT, CONDITI	ACHED FOR ACHED FOR ONS OF APPF	filed within 30 day: 0-4 must be filed or and the operator has
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 850' - 52 7) Spot-10sx cmt @ 60' - 3'. V 6) Perf/Sqz 60sx cmt @ 60' - 3'. V 6) Perf/Sqz 60' - 3'' -	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pre- 400'	the Bond No. on file with BLM sults in a multiple completion or led only after all requirements, in ssure test csg ean location 453962 verified by the BLM OPHILLIPS COMPANY, sen sing by DEBORAH MCKINN Title AG	VBIA. Required st recompletion in a ncluding reclamatic SEE ATT, CONDITI CONDITI Well Informatic t to the Hobbs EY on 02/12/20	ACHED FOR ACHED FOR ONS OF APPF	filed within 30 day 0-4 must be filed or and the operator has
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for ff 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 850' - 52 7) Spot-10sx cmt @ 60' - 3'. V 6) Perf/Sqz 60sx cmt @ 60' - 3'. V 7) Spot-10sx cmt @ 60' - 3'. V	rk will be performed or provide l operations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pre- 400' <b>core Trag</b> 380'. - 1700'. WOC-Tag 650'. WOC-Tag erify ors, install DH marker. Clo true and correct. Electronic Submission # For CONOCO itted to AFMSS for process RYANT Submission)	the Bond No. on file with BLM sults in a multiple completion or led only after all requirements, in ssure test csg ean location 453962 verified by the BLM OPHILLIPS COMPANY, sen sing by DEBORAH MCKINN Title AG	VBIA. Required str recompletion in a ncluding reclamatic SEE ATT, CONDITI CONDITI Well Informatic to the Hobbs IEY on 02/12/20 ENT 08/2019	ACHED FOR ACHED FOR ONS OF APPF Construction ACHED FOR ONS OF APPF Construction Construction ONS OF APPF (19DLM0248SE)	filed within 30 day 0-4 must be filed or and the operator has
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 850' - 7) Spot-10sx cmt @ 60' - 3'. V 6) Perf/Sqz 60sx cmt @ 60' - 3'. V 6) RDMO. Cut off WH & ancho 28) RDMO. Cut off WH & ancho 20 14. 1 hereby certify that the foregoing is Comm Name (Printed/Typed) GREG BR Signature (Electronic S Approved By	rk will be performed or provide loperations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pre- 400'	the Bond No. on file with BLM sults in a multiple completion or led only after all requirements, in ssure test csg ean location 453962 verified by the BLM OPHILLIPS COMPANY, sen sing by DEBORAH MCKINN Title AG Date 02/0 OR FEDERAL OR STA	VBIA. Required str recompletion in a ncluding reclamatic SEE ATT, CONDITI CONDITI Well Informatic to the Hobbs IEY on 02/12/20 ENT 08/2019	ACHED FOR ACHED FOR ONS OF APPF Construction ACHED FOR ONS OF APPF Construction Construction ONS OF APPF (19DLM0248SE)	filed within 30 day 0-4 must be filed or and the operator has ROVAL
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 3600' - 26 5) Perf/Sqz 60sx cmt @ 850' - 6) Perf/Sqz 60sx cmt @ 60' - 3'. V 7) Spot-10sx cmt @ 60' - 3'.	rk will be performed or provide loperations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pres 400'	the Bond No. on file with BLM sults in a multiple completion or led only after all requirements, in ssure test csg ean location 453962 verified by the BLM OPHILLIPS COMPANY, sen sing by DEBORAH MCKINN Title AG Date 02/0 DR FEDERAL OR STA	VBIA. Required str recompletion in a ncluding reclamatic SEE ATT, CONDITI CONDITI Well Informatic to the Hobbs EY on 02/12/20/ ENT 08/2019 TE OFFICE L	ACHED FOR ACHED FOR ONS OF APPF Construction ACHED FOR ONS OF APPF Construction Construction ONS OF APPF (19DLM0248SE)	filed within 30 day 0-4 must be filed or and the operator has ROVAL
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi 1) MIRU, ND WH, NU BOP. P 2) RIH Tag 5-1/2 CIBP @ 3600 3) Spot 25sx cmt @ 3600' - 34 4) Spot 25sx cmt @ 3600' - 26 5) Perf/Sqz 40sx cmt @ 1800' 6) Perf/Sqz 60sx cmt @ 850' - 7) Spot-10sx cmt @ 60' - 3'. V 6) Perf/Sqz 60sx cmt @ 60' - 3'. V 7) Spot-10sx cmt @ 60' - 3'. V 7)	rk will be performed or provide loperations. If the operation re bandonment Notices must be fil inal inspection. POOH w/ Prod Tbg 10'. Circ hole w/ MLF. Pres 400'	eithe Bond No. on file with BLM sults in a multiple completion or led only after all requirements, in ssure test csg ean location 453962 verified by the BLM OPHILLIPS COMPANY, sen sing by DEBORAH MCKINN Title AG Date 02/0 DR FEDERAL OR STA	//BIA. Required str         recompletion in a necluding reclamating r	ACHED FOR ACHED FOR ONS OF APPF Suited In System 19 (19DLM0248SE)	filed within 30 day: 0-4 must be filed or and the operator has ROVAL

## WELLBORE SKETCH ConocoPhillips Company -- Permian Basin Business Unit

RKB @ 3917'				Date 2/1/2019		
DF @ 3917						
GL @ <u>3907</u>	Subarea Lease & Well N	Buckeye W	MCA Unit #310	······································		
121 1 1 Surface 121/1	Legal Description		Sec 30, T-175, R-32E	1365' FWL - 1295' FNL		
	County	LEA		tate New Moxico		
8-5/8", 20#/It to 700	Field Date Spudded	MALJAMAF				
Cmt'd w/ xxx SX		5	5/24/1972			
TOC · Circ'd to surface	API Number	3002524108	J			
4/9/1983 - Sq2'd w/ 305SX - Testsa OK						
2 STOC - Assumed		Operator Number Loase ID				
		Loaso ID Field Number				
Production 77/8						
5-1/2", 14#/ft to 4025						
Cmt'd w/ xxx SX						
10C - 2500 by TS						
CIBP (0.3000						
			And	575		
Grayburg			i and in the second sec			
Ports 3647' - 3697'			Anhy Sat	690		
			Sat	670		
			Yates			
San Angres			Yntei	1915		
Ξ Ξ 3762' · 3769' ✓			1010			
======================================						
				-		
			$\frown$	2978		
			Qu	23,-		
= San Andres = 3921 - 3940			•			
			10	3333		
			6B	393 3		
				<b>P</b>		
			<b>^</b> .	3718		
			SA			
PBTD @4115'				3864		
i tersenet intra fanske 📼			Lev.	00-1		
			Cov .			


.

.

.

WELLBORE SKETCH ConocoPhillips Company -- Permian Basin Business Unit

× 1

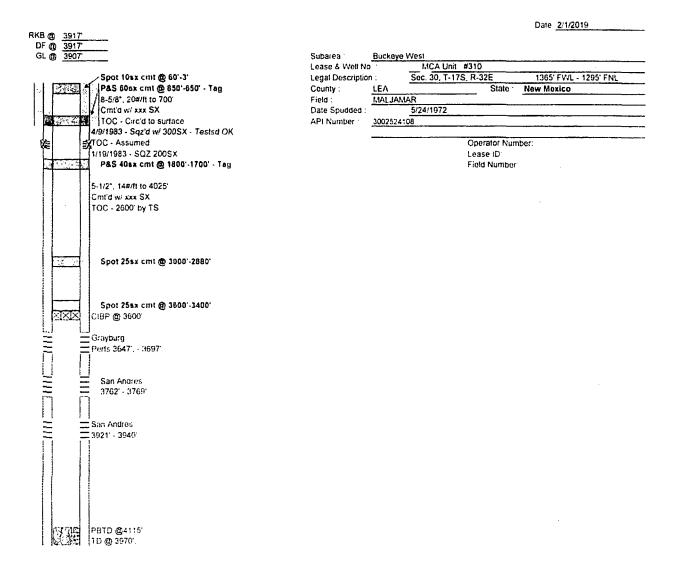

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses.** Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the **BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted