
	UNITED STATES EPARTMENT OF THE IN UREAU OF LAND MANAG	ITÉRIOR	OCD Hob	bs	OMB NO	APPROVED D. 1004-0137 nuary 31, 2018	
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an OBBS 06. If Indian, Allottee or T abandoned well. Use form 3160-3 (APD) for such proposals. OBBS 06.						Tribe Name	
	TRIPLICATE - Other inst		page 2 JUA	1 0 2019		ment, Name and/or No.	
1. Type of Well       B. Well Name and No.         Soli Well       Gas Well         Other       Context         Data of Context       Data (Data Stress)         RECEIVED       0. API Well No.							
2. Name of Operator CIMAREX ENERGY COMPANY OF CO-Mail: DEYLER@MILAGRO-RES.COM					9. API Well No. 30-025-31947-00-S1		
3a. Address3b. Phone No. (include600 N MARIENFELD STE 600Ph: 432-687-3033MIDLAND, TX 79703Ph: 432-687-3033					10. Field and Pool or Exploratory Area DIAMONDTAIL-DELAWARE		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State		
Sec 11 T23S R32E SENW 2310FNL 1650FWL					LEA COUNTY, NM		
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE OI	F NOTICE,	REPORT, OR OTH	IER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	<ul> <li>Acidize</li> <li>Alter Casing</li> </ul>	Deep	oen raulic Fracturing	Producti Reclamation	on (Start/Resume) ation	<ul> <li>Water Shut-Off</li> <li>Well Integrity</li> </ul>	
Subsequent Report	Casing Repair	• –	Construction	Recomp		Other	
Final Abandonment Notice	Change Plans	Plug	and Abandon Back	U Tempora	arily Abandon Visposal		
determined that the site is ready for 1) SET 5-1/2" CIBP @ 6,950' 2) CIRC. WELL W/ M.L.F.; PI TAG CMT. PLUG. 3) PERF.X ATTEMPT TO SC 4) PERF. X CIRC. TO SURF. 5) DIG OUT X CUT OFF WEL CSGS. X INSTALL GROUND DURING THIS PROCEDURE THE REQUIRED DISPOSAL	; PUMP 60 SXS.CMT. @ 6 UMP 55 SXS.CMT. @ 4,96 Z.50 SXS.CMT. @ 1,255'- , FILLING ALL ANNULI, 2 LLHEAD 3' B.G.L.; VERIF D LEVEL DRY HOLE MAR WE PLAN TO USE THE	80'-4,604'(T/[ 1,120'(13-3/8 5 SXS.CMT. 5 CMT. TO S KER. CLOSED-LO	0LWR.,8-5/8"CS( "CSG.SHOE,T/A @ 63'-3'. URF. ON ALL A	G.SHOE, B/ \NHY.); TAG NNULI; WEI	S. -D ON STEEL PLA		
SEE ATTACHED FOR							
Below ground level dry hole marker requ					CONDITIONS OF APPROVAL		
14. I hereby certify that the foregoing i Con Name (Printed/Typed) DAVID A	## Electronic Submission For CIMAREX EN mmitted to AFMSS for proce	ERGY COMP	NÝ OF CO, sent	to the Hobbs n 05/07/2019	3		
Signature (Electronic	Date 05/07/20	019					
	THIS SPACE FO			OFFICE U	SE		
Approved By	nes a am	<u>*_</u> ~	Title SHE	7		6-2-19 Date	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office							
Title 18 U.S. C. Bection 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a	crime for any pe to any matter w	rson knowingly and ithin its jurisdiction.	willfully to ma	ke to any department or	agency of the United	
(Instructions on page 2) <b>** BLM REV</b>	VISED ** BLM REVISED			N REVISED	OR RECO		

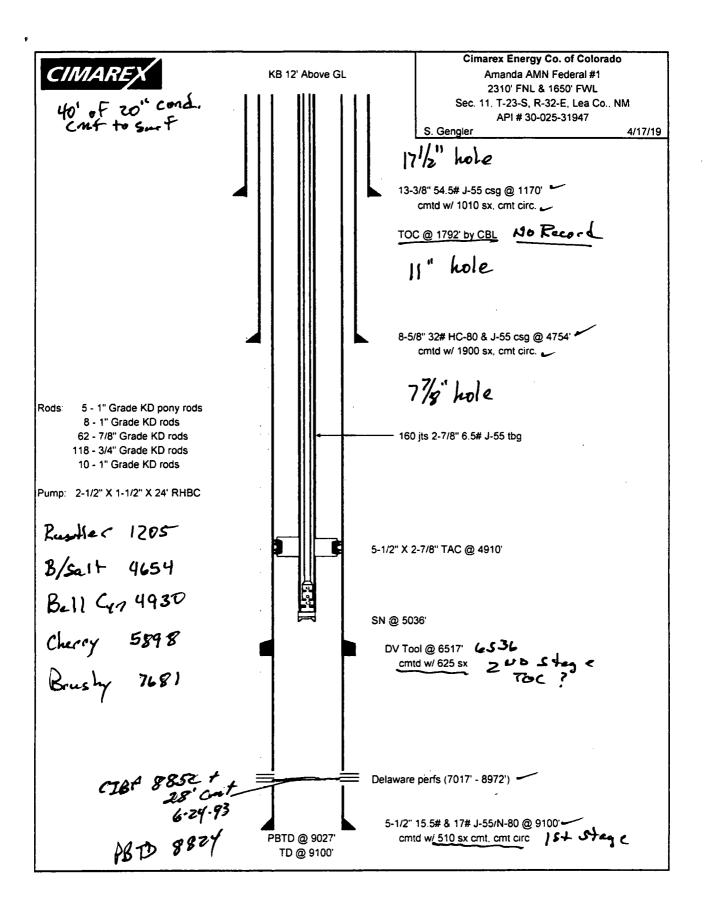

Printed 4/24/2019

**Cimarex Energy Co. of Colorado** CIMAREX KB 12' Above GL Amanda AMN Federal #1 2310' FNL & 1650' FWL Sec. 11, T-23-S, R-32-E, Lea Co., NM API # 30-025-31947 S. Gengler 4/17/19 N. L.F. T/ANHY. - 1,205' B/SALT - 4,654' T/CANYON - 4,930' COLUR; PERF. X CIEC. 25 = x & @65 -3! 13-3/8" 54.5# J-55 csg @ 1170' cmtd w/ 1010 sx, cmt circ. PERF. X SQZ. 50 5X5. C 1,255 -1,120 - TAG-TOC @ 1792' by CBL N.h.F. 8-5/8" 32# HC-80 & J-55 csg @ 4754' cmtd w/ 1900 sx, cmt circ. Pump 555×504,980'-4,604-796 M.L.F. Pump 605×5.006,950-6,467'-TAG. DV Tool @ 6517' cmtd w/ 625 sx SET 5-1/2" CIBP @ 6,950' Delaware perfs (7017' - 8972') 5-1/2" 15.5# & 17# J-55/N-80 @ 9100' PBTD @ 9027' cmtd w/ 510 sx cmt, cmt circ TD @ 9100' DAE 05/07/19

Printed 5/7/2019

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted