
Submit I Copy To Appropriate District	State of	New Me		Form C-103	
Office District I – (575) 393-6161	State of New Mexico Energy, Minerals and Natural Resources				Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240				WELL API N	<i>'</i>
<u>District II</u> - (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSER			30-025-25144 5. Indicate Ty	
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.			STATE	FEE 🗌
District IV - (505) 476-3460 1220 S. St. Francis Dr., Santa Fc, NM	Santa Fe, NM 87505			6. State Oil &	Gas Lease No.
87505		B-934			
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A				7. Lease Nam	e or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPL PROPOSALS.)		RM C-101) FO	R SUCH		
1. Type of Well: Oil Well	Gas Well 🔲 Other	1			per 27
2. Name of Operator				9. OGRID NI	ımber
XTO ENERGY, INC. 3. Address of Operator		<u> </u>		005380 10. Pool name	e or Wildcat
6401 HOLIDAY HILL RD, BLDG 5, MIDLAND TX 79707					Wash and Drinkard
4. Well Location		<u>-</u>	RECEI	/ED	
Unit LetterK:	1830 feet from the	_South li			West_line
Section 2	Township			7E NMPM	County LEA
	11. Elevation (Show w	hether DR,	RKB, RT, GR, d	etc.)	
				, <u>, , , , , , , , , , , , , , , , </u>	, _ , _ , _ ,
12. Check	Appropriate Box to In	nd cate N	ature of Notic	ce, Report or Oth	ner Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:					
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING					
TEMPORARILY ABANDON 🔲 CHANGE PLANS 🔲 🦳 COMMENCE DRILLING OPNS. 🗌 P AND A					
	-		CASING/CEM	ENT JOB]
DOWNHOLE COMMINGLE					
OTHER:	- 		OTHER:		
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of					
proposed completion or recompletion					
 XTO respectfully requests permission to PA the subject well as follows; SET A CIBP @3,520' WITH WIRELINE. 					
2. PUMP 56 BBLS OF PLUG MUD.					
3. SPOT 25 SX OF CMT PLUG FROM 3,270' TO 3,520';					
4. TAG TOC @3,270'. PRESSURE TEST CSG (500 psi);					
5. PERF @2,997' (50' BELOW 7 RIVERS);					
6. SPOT 30SX CMT PLUG FROM 2,748' TO 3,048'. TAG TOC @2,748';					
7. PERF @1,387' (50' BELOW RUSTLER); 8. SPOT 30 SX OF CMT PLUG FROM 1,138' TO 1,437'. TAG TOC @1,138';					
 XTO respectfully requests permission to PA the subject well as follows; SET A CIBP @3,520' WITH WIRELINE. PUMP 56 BBLS OF PLUG MUD. SPOT 25 SX OF CMT PLUG FROM 3,270' TO 3,520'; TAG TOC @3,270'. PRESSURE TEST CSG (500 psi); PERF @2,997' (50' BELOW 7 RIVERS); SPOT 30SX CMT PLUG FROM 2,748' TO 3,048'. TAG TOC @2,748'; PERF @1,387' (50' BELOW RUSTLER); SPOT 30 SX OF CMT PLUG FROM 1,138' TO 1,437'. TAG TOC @1,138'; SPOT 30 SX CMT TO SURF. TAG TOC @SURF. 					
				<u> </u>	
Spud Date:	Rig	Release Da	ite:		
I hereby certify that the information above is true and complete to the best of my knowledge and belief.					
	T				·
SIGNATURE	hun TIT	LE Reg	ulatory Analyst		06/24/2019 DATE
	/		Katrina Thoma	oson@xtoenergy.com	A22,780,2073
Type or print name Katrina Thor	E-n	nail address	:		PHONE: 432-783-2373
APPROVED BY: Kerry Junte					
APPROVED BY: Kerry	TIT	LE Comp	liance D	ffice H	date <u>7-10-19</u>
Conditions of Approval (if app):		1	6	1	

New Mexico S State #27 – Class II Well API: 30-025-25144

- 1. SET A CIBP @3,520' WITH WIRELINE.
- 2. PUMP 56 BBLS OF PLUG MUD.
- 3. SPOT 25 SX OF CMT PLUG FROM 3,270' TO 3,520';
- 4. TAG TOC @3,270'. PRESSURE TEST CSG (500 psi);
- 5. PERF @2,997' (50' BELOW 7 RIVERS);
- 6. SPOT 30SX CMT PLUG FROM 2,748' TO 3,048'. TAG TOC @2,748';
- 7. PERF @1,387' (50' BELOW RUSTLER);
- 8. SPOT 30 SX OF CMT PLUG FROM 1,138' TO 1,437'. TAG TOC @1,138';
- 9. SPOT 30 SX CMT TO SURF. TAG TOC @SURF.

THIS PROCEDURE IS PENDING C-103 APPROVAL FROM NMOCD/BLM. DEPTHS & VOLUMES MAY BE SUBJECT TO CHANGE.

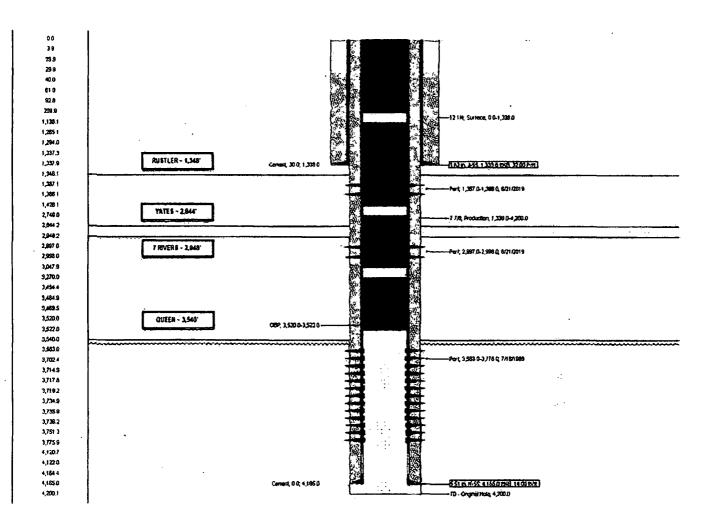

GENERAL CONDITIONS OF APPROVAL:

- 1) Insure all bradenheads have been exposed, identified, and valves are operational prior to rigging up on well.
- 2) Contact the appropriate NMOCD District Office no later than 24 hours prior to moving in and rigging up.
- 3) A copy of the approved C103 intent to P&A should be distributed to the onsite company and plugging representatives. <u>Approved procedures are good for a period of one year from approved date, unless otherwise specified on the C103 intent</u>. Approvals past this date will require the submission and approval of a new C103 intent.
- 4) A company representative is required to be present to witness all operations including setting CIBP's, circulation of mud laden fluids, perforating, squeezing or spotting cement plugs, tags, or any other operations approved on the C103 intent to P&A. Company representative should contact the NMOCD and report all operations.
- 5) Any changes that may be required during plugging operations should be approved by the NMOCD before proceeding.
- 6) A closed loop system is to be used for all plugging operations. Contents of the steel pits to be hauled to a NMOCD permitted disposal facility.
- 7) Mud laden fluids must be placed between all cement plugs mixed at 25 sacks of salt gel per 100 barrels of brine.
- All cement plugs will be 100' or 25 sacks cement, whichever is greater. Class 'C' cement will be used above 7500' and Class 'H' below 7500'. Plugs should be no more than 3000' apart
- 9) Site remediation due within one year of well plugging completion.