
	UNITED STATES	NTERIOR	OCD H	lobhs:	OMB N	APPROVED O. 1004-0137 inuary 31, 2018
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELL					5. Lease Serial No. NMNM77060	
Do not use thi abandoned we	s form for proposals to II. Use form 3160-3 (AP TRIPLICATE - Other ins	drill or to re-enter D) for such propo	ran sals.	3 OCD	6. If Indian, Allottee o	r Tribe Name
SUBMIT IN	TRIPLICATE - Other ins	tructions on page	AOD	21 2019	7. If Unit or CA/Agree	ement, Name and/or No.
1. Type of Well 13 Oil Well 1 Gas Well 1 Oth	ier		AUG	-ENF	Well Name and No. RED TANK 34 FE	DERAL 15
2. Name of Operator OXY USA INCORPORATED	DAVID STEWART TEWART@OXY.COM					
3a. Address P O BOX 4294 HOUSTON, TX 77210-4294	3b. Phone No. (inclu Ph: 432-685-571			10. Field and Pool or Exploratory Area W RED TANK		
4. Location of Well (Footage, Sec., 7)	11. Count		11. County or Parish,	State	
Sec 34 T22S R32E SWNW 17		LEA COUNTY, NM				
12. CHECK THE AI	PROPRIATE BOX(ES)	TO INDICATE N	ATURE OF	NOTICE,	, REPORT, OR OTH	IER DATA
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent	C Acidize	Deepen		Product	tion (Start/Resume)	□ Water Shut-Off
	Alter Casing	🗖 Hydraulic	Fracturing	🗖 Reclam	ation	Well Integrity
Subsequent Report			lew Construction		plete	Other
Final Abandonment Notice	Change Plans Convert to Injection	Plug and AbandonPlug Back		 Temporarily Abandon Water Disposal 		
10-3/4" 40.5# csg @ 818' w/70 7-5/8" 29.7# csg @ 4520' DVT 4-1/2" 11.6# csg @ 8742' DVT 1. RIH & set CIBP @ 7150', M 2. M&P 25sx cmt @ 6490-629 3. M&P 205x cmt @ 4720-444 4. Perf @ 3425', sqz 40sx cm 5. Perf @ 2135'_sqz 30sx cm	8" hole, TOC-Surf-	SEE ATTACHED FOR				
6. Perf @ 866, sqz 1855x cm	t to surface 1090 ((T.Satt, Sha	-	1-		(
14. I hereby certify that the foregoing is	true and correct.	I dry h		marke		<u> </u>
	Electronic Submission # For OXY US	SA INCORPORATED	, sent to the	Hobbs		
Comm Name (Printed/Typed) DAVID ST		Title SR. REGULATORY ADVISOR				
Signature (Electronic S	Date					
		DR FEDERAL OF			SE	
	00	········	all		<u></u>	7-14-1 Date
Approved By nditions of approval, if any, are attached tify that the applicant holds legal or equ	A Approval of this notice does the title to those rights in the	not warrant or	SPE.	/	<u></u>	Date
hich would entitle the applicant to condu- the 18 ψ .S.C. Section 1001 and Title 43	uct operations thereon. U.S.C. Section 1212, make it a	Offi crime for any person k	ce CFD nowingly and v	willfully to m	ake to any department or	agency of the United
States any false, fictitious or fraudulent s	datements or representations as	to any matter within its	jurisdiction.			
nstructions on page 2) ** BLM REV	ISED ** BLM REVISEI	D ** BLM REVISI	ED ** BLM	REVISE) ** BLM REVISEI	


Additional data for EC transaction #472536 that would not fit on the form

32. Additional remarks, continued

.

10# MLF between plugs - Above ground steel tanks will be utilized

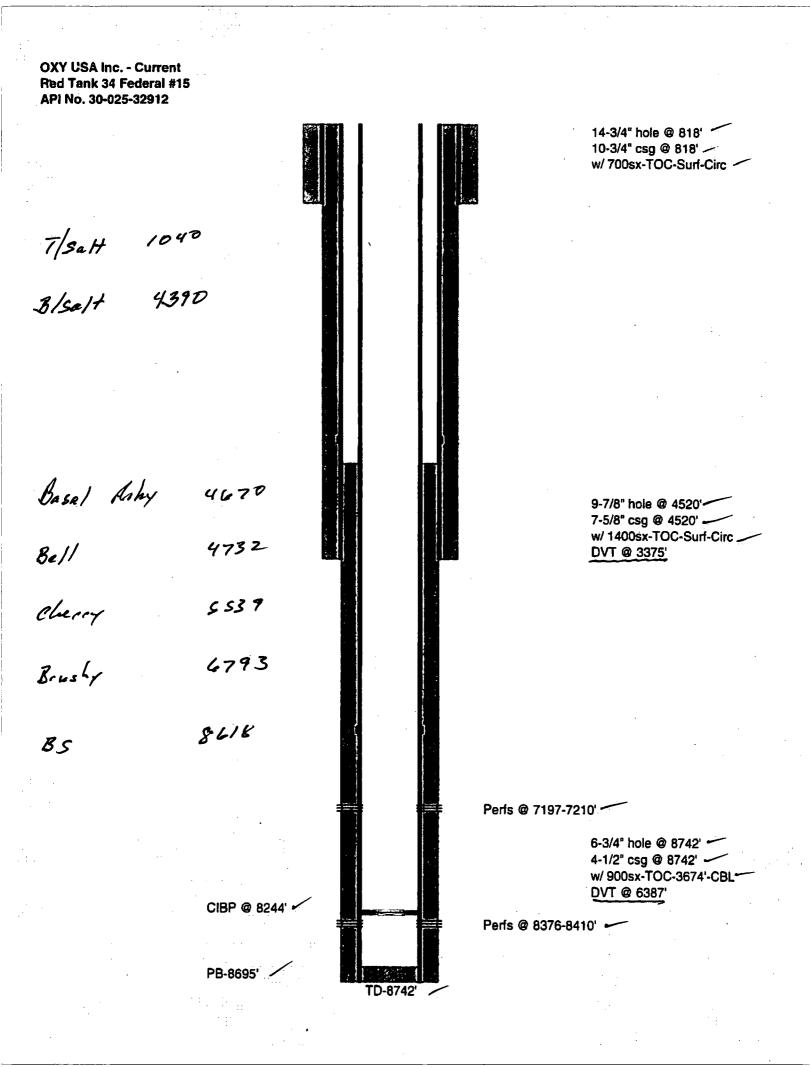

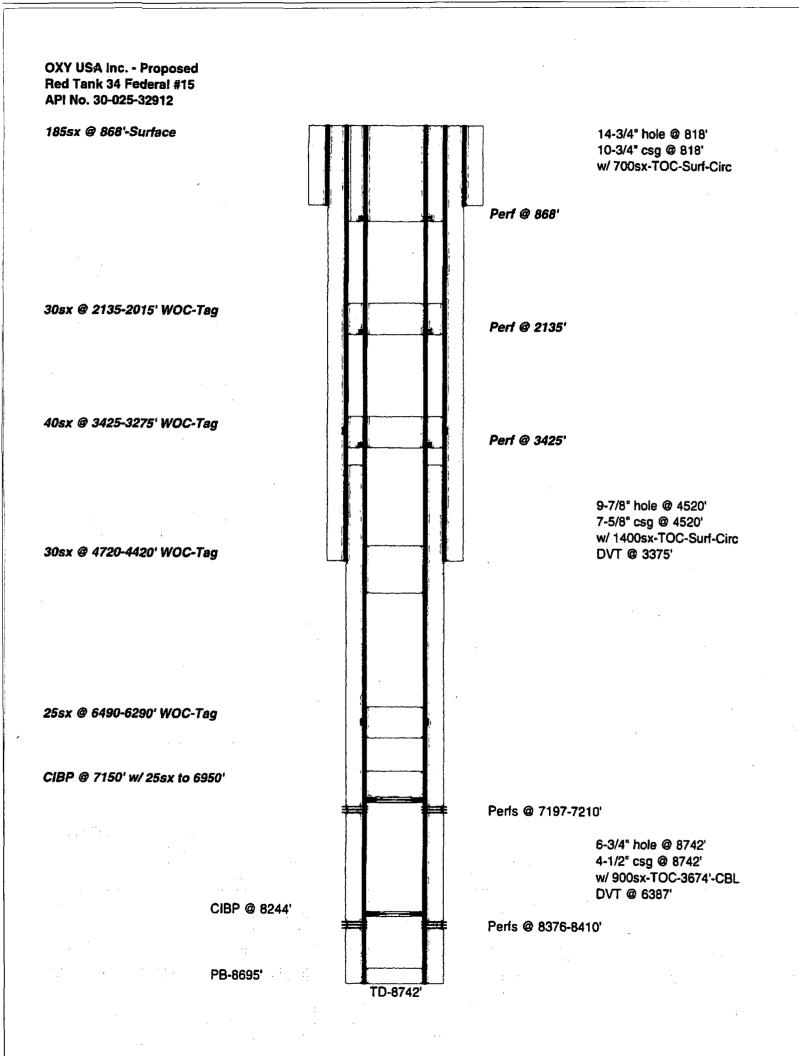

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water Minimum nine (9) pounds per gallon.

5 <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3 00 am and 9 00 am. Normal vehicle use on existing roads will not be restricted