

	UNITED STATES EPARTMENT OF THE D UREAU OF LAND MANA	NTERIOR	OCD H		OMB NO	APPROVED D. 1004-0137 nuary 31, 2018
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an					NMNM65441 6. If Indian, Allottee of	r Tribe Name
abandoned well. Use form 3160-3 (APD) for suct HOBBS OCD						
SUBMIT IN TRIPLICATE - Other instructions on prof 31, 2019					7. If Unit or CA/Agree	ement, Name and/or No.
Type of Well     Oil Well Gas Well Other     RECEIVED					8. Well Name and No. MADERA 25 FEDERAL 1	
2. Name of Operator Contact: ADRIAN COVARRUBIAS BLACK MOUNTAIN OPERATING LLCE-Mail: jvancuren@marathonoil.com					9. API Well No. 30-025-29808-00-S1	
3a. Address 500 MAIN STREET SUITE 12 FORT WORTH, TX 76102	3b. Phone No. (include area code) Ph: 713-296-3368			10. Field and Pool or Exploratory Area JABALINA SWD		
4. Location of Well (Footage, Sec., 2	)				11. County or Parish, State	
Sec 25 T26S R34E NWSE 19				LEA COUNTY, NM		
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICAT	E NATURE OF	F NOTICE, I	RÉPORT, OR OTH	IER DATA
TYPE OF SUBMISSION	TYPE OF SUBMISSION TYPE OF ACTION					
Notice of Intent	Acidize	🗖 Deepe	n	Production (Start/Resume)		UWater Shut-Off
Subsequent Report	Alter Casing		ulic Fracturing	🗖 Reclamat		U Well Integrity
	Casing Repair	—	Construction	<ul> <li>Recomplete</li> <li>Temporarily Abandon</li> </ul>		Other
Final Abandonment Notice	Change Plans			U Tempora	•	
<ul> <li>a) Spot 35sx Class C CMT @</li> <li>b) P. S. 100sx Class C CMT @</li> <li>c) Spot 50sx Class C CMT @</li> <li>c) Spot 40sx Class C CMT @</li> <li>c) Spot 40sx Class C CMT @</li> <li>c) P. S. 115sx Class C CMT @</li> <li>c) P. S. 40sx Class C CMT @</li> <li>c) Install Below Ground Dry H</li> <li>All fluids to licensed facility</li> <li>Use MLF between all plugs</li> </ul>	Tag Same	SEE ATTACUED FOD				
	s true and correct. Electronic Submission # For BLACK MOL mmitted to AFMSS for proc G GERVAIS	INTAIN OPERAT	ING LLC, sent CILLA PEREZ or	Information to the Hobbs 1 09/13/2019 ( LEUM ENGII	19PP3162SE)	
Name(17intew Typed) JOSHOA						
Signature     (Electronic Submission)     Date     09/13/2019       THIS SPACE FOR FEDERAL OR STATE OFFICE USE						
					· <b>`</b>	10 35 10
Approved By	l. llmos_	ļ	Title SAL	T		10-25-19 Date
Conditions of approva, if any, are attach certify that the applicant holds legal or ec which would entitle the applicant to cond	uitable title to those rights in th	s not warrant or e subject lease	Office CFC	,	اب	
Title 18 U.S.C Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations as	crime for any pers to any matter with	on knowingly and in its jurisdiction.	willfully to mal	te to any department or	agency of the United
(Instructions on page 2) ** BLM REV X J	VISED ** BLM REVISE			-	ORREGO	

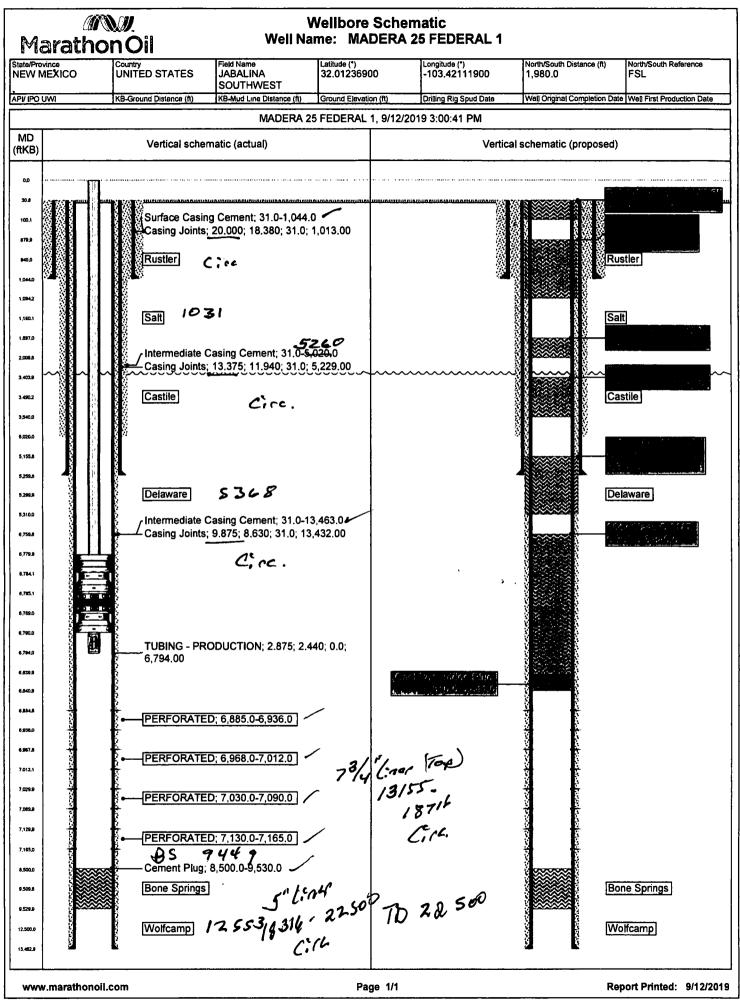

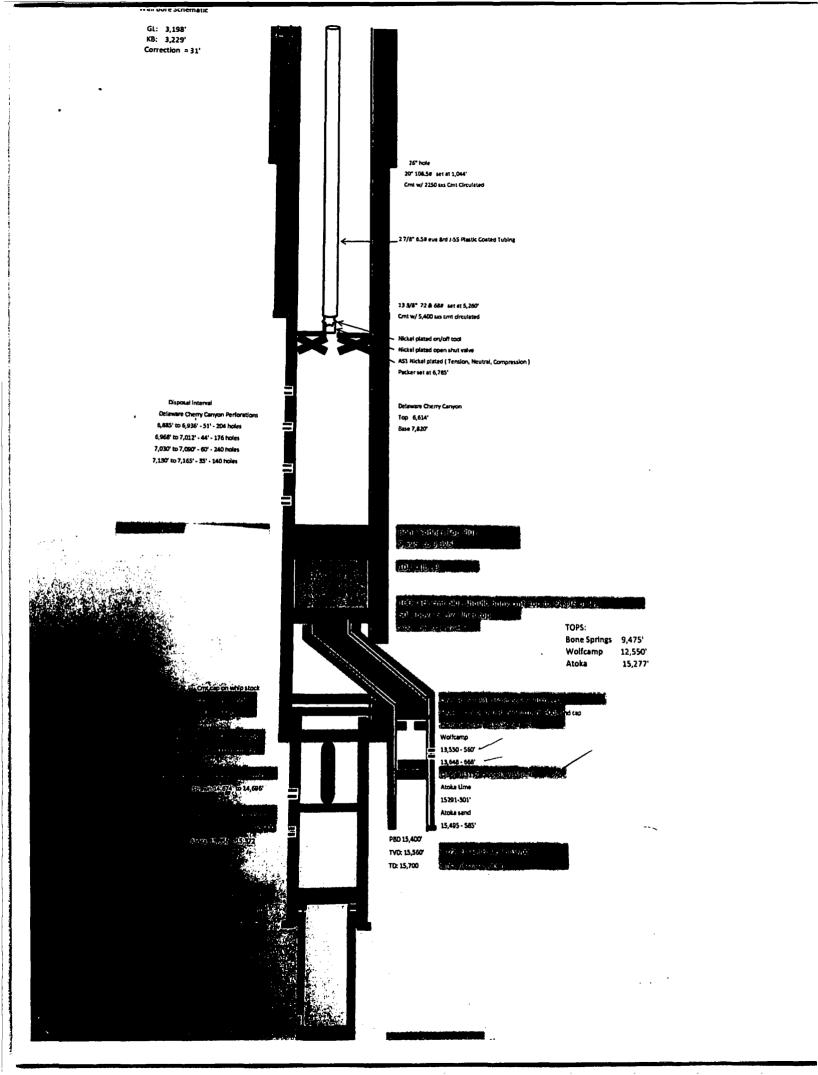

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least <sup>1</sup>/<sub>4</sub> inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted