

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised August 1, 2011

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.

30-025-44720

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

North Hobbs (G/SA) Unit
Section 33

8. Well Number: 697

9. OGRID Number: 157984

10. Pool name or Wildcat
Hobbs (G/SA)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other: -----

2. Name of Operator
Occidental Permian Ltd.

3. Address of Operator
P.O. Box 4294, Houston, 77210-4294

4. Well Location

Unit Letter N : 1248 feet from the S line and 1702 feet from the W Line

Section 33 Township 18-S Range 38-E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3633' (GL)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☒ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU PU, NDWH - NUBOP
2. POOH w. ESP equipment
3. RU WL RIH w/ CIBP and set @ +/- 4570', dump bail pea gravel to 4544' and cap it with 3' of cmt. RD WL
4. RIH with CIBP and set @ 4450'
5. RU Cementing co and cement sqz top 2 clusters (4519-4527 and 4534-4538), RD cementing co.
6. RIH with 6-1/4" bit, DO CIBP, cement, pea gravel and CIBP. Continue CO to PBTD (4975') POOH with bit
7. RIH with ESP production equipment,
8. NDBOP - NUWH
9. Place well in service

During this procedure we plan to use the closed-loop system with a steel tank and haul contents to the required disposal per ODC Rule 19.15.17

Spud Date:

Rig Release Date:

Condition of Approval: notify
OCD Hobbs office 24 hours
prior of running MIT Test & Chart

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE Production Engineer

DATE 1/8/2020

Type or print name


Carlos Restrepo

E-mail address carlos_restrepo@oxy.com

PHONE: 713-366-5147

For State Use Only

APPROVED BY:

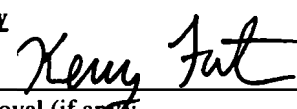

TITLE

CO

A

DATE

2-14-20

Conditions of Approval (if any):

Additional Data that would not fit on the form.