

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

WELL API NO.
30-025-09007

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Peerless et al Com

8. Well Number
1

9. OGRID Number
15938

10. Pool name or Wildcat
Eunice: 7 Rivers-Queen South Pool

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR TO BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
NM&O Operating Company

3. Address of Operator
320 S Boston Ave., Ste. 2000, Tulsa, OK 74103

4. Well Location

Unit Letter C : 660 feet from the North line and 1980 feet from the West line
Section 22 Township 22S Range 36E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3537'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☒
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

2/10/20 thru 2/15/20: RIH w/tbg and set CIBP @ 3470'. Pull up 1 jt. then load csg. and test to 500 psig for 30 min. with no leak off. POOH, RIH w/tbg to 3465' and spot 40 sx Class C cement. POOH w/8 jts tbg. WOC. RIH and tag cement @ 3200'. Pull tbg. to 3100' and spot 40 sx Class C cement. POOH w/tbg, RIH w/wireline and tag cement @ 2825'. Pull up to 1620' and shoot csg. w/4 holes. Pump into hole @1620' w/8 bbls @1700 psig. Call OCD for procedure. RIH w/tbg and spot 25 sx of Class C cement across perfs. POOH w/tbg. RIH w/wireline and tag cement at 1500'. NU to backside of 7' csg. and broke circulation to surface on 9 5/8" then pump 14.8# cement, 19 bbls slurry, 79 sx @230 psig. NDBOP, top off both strings of surface. Cut off wellhead. Install dead hole marker and back fill, dig up deadman and dress up location.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE President DATE 4/10/20

Type or print name Larry D. Sweet E-mail address: heatherf@xanexp.com PHONE: 918-584-3802
For State Use Only

APPROVED BY: [Signature] TITLE CO A DATE 8-21-20
Conditions of Approval (if any)

NM&O OPERATING COMPANY

320 S. Boston, Ste 2000
Tulsa, OK 74103
Telephone 918-584-3802
Fax 918-585-1753

April 10, 2020

State of New Mexico
Oil Conservation Division
1625 N. French Dr.
Hobbs, NM 88240

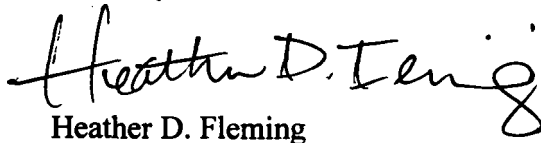
RE: Form C-103

Whomever this may concern:

Please file the attached Form C-103.

Should you have any questions, please advise.

Sincerely,

A handwritten signature in cursive script that reads "Heather D. Fleming". The signature is written in dark ink and is positioned above the printed name.

Heather D. Fleming

Pipe line Rd.

D. BASIAU

