

**RECEIVED**  
April 2004  
**SEP 08 2009**  
**HOBBSOCD**

**OCD-HOBBS**

UNITED STATES  
 DEPARTMENT OF THE INTERIOR  
 BUREAU OF LAND MANAGEMENT

FORM APPROVED  
 OMB No. 1004-0137  
 Expires: March 31, 2007

**SUNDRY NOTICES AND REPORTS ON WELLS**

*Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.*

**SUBMIT IN TRIPLICATE- Other instructions on reverse side.**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input checked="" type="checkbox"/>		5. Lease Serial No. LC 032650B
2. Name of Operator Chevron USA Inc <input checked="" type="checkbox"/>		6. If Indian, Allottee or Tribe Name
3a. Address 15 Smith Rd., Midland, TX 79705	3b. Phone No. (include area code) 432-561-8600	7. If Unit or CA/Agreement, Name and/or No
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) UL O, Sec. 24-T25S-R37E <input checked="" type="checkbox"/> 330' FSL & 1650' FEL <input checked="" type="checkbox"/>		8. Well Name and No. A.B. Coates "C" Federal #26 <input checked="" type="checkbox"/>
		9. API Well No. 30-025-21427 <input checked="" type="checkbox"/>
		10. Field and Pool, or Exploratory Area Langlie Mattix 7 Rvrs Queen Grybrg <input checked="" type="checkbox"/>
		11. County or Parish, State Lea, NM <input checked="" type="checkbox"/>

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

1. Notify BLM 24 hrs prior to MI and RU.
2. RIH set CIBP at 3250, spot 25sx, plug from 3250-3050 (perfs).
3. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
4. Perf 4 holes at 2300, sqz 40sx, plug from 2300-2095 (B-Salt) WOC Tag.
5. Perf 4 holes at 1550, sqz 40sx, plug from 1550-1350 (T-Salt) WOC Tag.
6. Perf 4 holes at 620, sqz 40sx, plug from 1005-800 (Shoe) WOC Tag.
7. Perf 4 holes at 100, sqz 25sx, plug from 100-surface (surface) WOC Tag.
8. Install dry hole marker.

**SEE ATTACHED FOR  
 CONDITIONS OF APPROVAL**


**RECLAMATION PROCEDURE  
 ATTACHED**

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)	Title
Signature <i>M. P. Brown</i>	Agent for Chevron USA, inc.
	Date
	08/24/2009

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by <i>Dustin Winkler</i>	Title
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Date
	Office

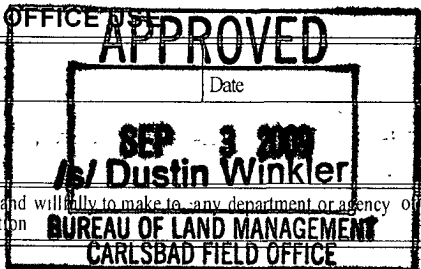

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

## WELL DATA SHEET

**FIELD:** Langlie Mattix

**WELL NAME:** A. B. Coates "C" Federal #26

**FORMATION:** 7 Rivers/Queen/Grayburg

**LOC:** 330' FSL & 1650' FEL  
**TOWNSHIP:** 25S  
**RANGE:** 37E  
**LOT:** 0

**SEC:** 24      **GL:** 3070'  
**COUNTY:** Lea      **DF:** 3080'  
**STATE:** NM      **KB:** 3081'


**CURRENT STATUS:** PR  
**API NO:** 30-025-21427  
**REFNO:** FF4781

**Surface Casing**

7-5/8", 26.4# J-55  
 Set @ 903' w/400 sx cmt  
 11" hole  
 Circ cmt to surface

**Spud Date:** 5/14/65  
**Date of Completion:** 6/9/65  
**Initial Completion:** Blinebry

This wellbore diagram is based on the most recent information regarding wellbore configuration and equipment that could be found in the Midland well files and computer databases as of the update date below. Verify what is in the hole with the well file in the Dolichridge Field Office. Discuss w/ WEO Engineer, WQ Rep, OS, ALS, & FS prior to rigging up on well regarding any hazards or unknown issues pertaining to this well.

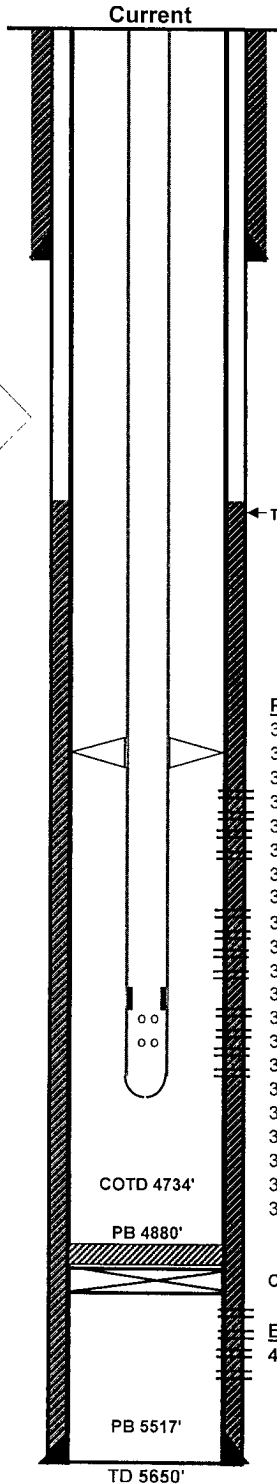

Perfs	Status
3294-98'	Grayburg - Open
3299-3305'	Grayburg - Open
3312-17'	Grayburg - Open
3325-31'	Grayburg - Open
3336-43'	Grayburg - Open
3351-55'	Grayburg - Open
3361-67'	Grayburg - Open
3377-82'	Grayburg - Open
3395-3402'	Grayburg - Open
3405-08'	Grayburg - Open
3417-23'	Grayburg - Open
3428-37'	Grayburg - Open
3442-49'	Grayburg - Open
3455-57'	Grayburg - Open
3460-66'	Grayburg - Open
3470-80'	Grayburg - Open
3485-89'	Grayburg - Open
3493-96'	Grayburg - Open
3505-14'	Grayburg - Open
3517-20'	Grayburg - Open
3527-34'	Grayburg - Open

CIBP set @ 4915' w/35' cmt on top

Blinebry Perfs	Status
4986-5342'	Below CIBP

**Tubing Detail:**

#Jts:	Size:	Footage
	KB Correction	11 00
106	Jts 2 3/8" EUE 8R J-55 Tbg	3190 05
	TAC	3 03
12	Jts 2 3/8" EUE 8R J-55 Tbg	360 62
1	Jt 2 3/8" EUE 8R J-55 IPC Tbg	31 35
	SN	1 10
119	Bottom Of String >>	3597.15

**Production Casing**

4-1/2", 11.6# J-55  
 Set @ 5649' w/1100 sx cmt  
 6-3/4" hole  
 Circ cmt to 2000' (TS)

Updated: 5/31/07

By: A M Howell

Chevron USA Inc.  
NMLC-032650B: A.B.Coates "C" Federal #26  
API: 30-025-21427  
Eddy County, New Mexico

RE: Plugging and Abandonment Procedure, Conditions of Approval

1. OK
- 1a. Tag CIBP with 35' of cement at 4880' or shallower.
- 1b. Displace hole with MLF, 9.5# Brine w/ 25# gel p/BBL.
- 1c. Spot a 150' plug with a minimum 25sx from 4674'-4524' (Top of Glorieta).
2. OK
3. OK
4. CHANGE: Perf and squeeze 40sx for a minimum 120' plug from 2343'-2223'. If injection rate cannot be established, spot plug starting 50' below the perfs. WOC and tag at 2223' or shallower. (BOS)
5. CHANGE: Perf and squeeze 40sx for a 200' plug (as proposed) from 1400'-1200'. If injection rate cannot be established, spot plug starting 50' below the perfs. WOC and tag at 1200' or shallower. (TOS)
6. CHANGE: Perf csg at 1005' instead of the 620' that was proposed. Tag at 800' or shallower. (Csg shoe)
7. OK
8. OK
9. Submit subsequent report, with details.

See attached standard COA.

DHW 090309

**BUREAU OF LAND MANAGEMENT**  
**Carlsbad Field Office**  
**620 East Greene Street**  
**Carlsbad, New Mexico 88220**  
**575-234-5972**

**Permanent Abandonment of Federal Wells**  
**Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

**If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 60<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.**

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine water**. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. **Dry Hole Marker:** All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. **Subsequent Plugging Reporting:** Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. **Trash:** All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

JDW 072709



# United States Department of the Interior

## BUREAU OF LAND MANAGEMENT

Carlsbad Field Office  
620 E. Greene St.  
Carlsbad, New Mexico 88220-6292  
www.blm.gov/nm



In Reply Refer To 1310

### Interim Reclamation Procedures

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses.

Interim reclamation consists of minimizing the footprint of disturbance by reclaiming all portions of the well site not needed for production operations. The portions of the cleared well site not needed for operational and safety purposes are recontoured to a final or intermediate contour that blends with the surrounding topography as much as possible. Sufficient level area remains for setup of a workover rig and to park equipment. Topsoil is respread over areas not needed for all-weather operations. Production facilities should be clustered to maximize the opportunity for interim reclamation. In order to inspect and operate the well or complete workover operations, it may be necessary to drive, park, and operate on restored, interim vegetation within the previously disturbed area. This is generally acceptable provided damage is repaired and reclaimed following use.

To reduce final reclamation costs; maintain healthy, biologically active topsoil; and to minimize habitat, visual, and forage loss during the life of the well, all salvaged topsoil should be spread over the area of interim reclamation, rather than stockpiled.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). Interim reclamation is to be completed within 6 months of well completion.
3. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with interim reclamation as per approved APD or Sundry Notice. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
4. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
5. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos  
Supervisory Environmental Protection Specialist  
575-234-5909, 575-361-2648 (Cell)

Cody Layton  
Natural Resource Specialist  
575-234-5959

Terry Gregston  
Environmental Protection Specialist  
575-234-5958

Trishia Bad Bear  
Natural Resource Specialist  
575-393-3612

Bobby Ballard  
Environmental Protection Specialist  
575-234-2230

Todd Suter  
Surface Protection Specialist  
575-234-5987

Randy Rust  
Environmental Protection Specialist  
575-234-5943

Doug Hoag  
Civil Engineering Technician  
575-234-5979

Linda Denniston  
Environmental Protection Specialist  
575-234-5974

Jennifer Van Curen  
Environmental Protection Specialist  
575-234-5905

Justin Frye  
Environmental Protection Specialist  
575-234-5922