

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease

State Fee

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- WIW	7. Unit Agreement Name Seven Rivers Queen Unit
2. Name of Operator ARCO Oil and Gas Company Division of Atlantic Richfield Company	8. Farm or Lease Name Seven Rivers Queen Unit
3. Address of Operator P. O. Box 1710, Hobbs, New Mexico 88240	9. Well No. 39
4. Location of Well UNIT LETTER <u>M</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>35</u> TOWNSHIP <u>22S</u> RANGE <u>36E</u> NMPM.	10. Field and Pool, or Wildcat South Eunice 7R Queen
15. Elevation (Show whether DF, RT, GR, etc.) 3507' RKB	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

RU, POH w/inj assy. Install BOP. CO to 3988'. Perf w/1 JSPF @ 3705-13, 19, 23, 24'. RIH w/RBP & set BP @ 3740', pkr @ 3680'. Acidize Middle Queen perfs 3692-3724' w/4500 gals 15% NEA in 3 stages. Move BP to 3680', pkr to 3615'. Acidize Upper Queen perfs 3665-75' w/1000 gals 15% NEA acid. Swab back. POH w/pkr & RBP. RIH w/inj assy, set pkr above perfs & return to water injection.


18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Roland P. Lawrence TITLE Drlg. Engr. DATE 9/8/82

APPROVED BY Eddie W. Sean TITLE OIL & GAS INSPECTOR DATE SEP 13 1982

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED
SEP 10 1982
O.C.D.
HOESS OFFICE

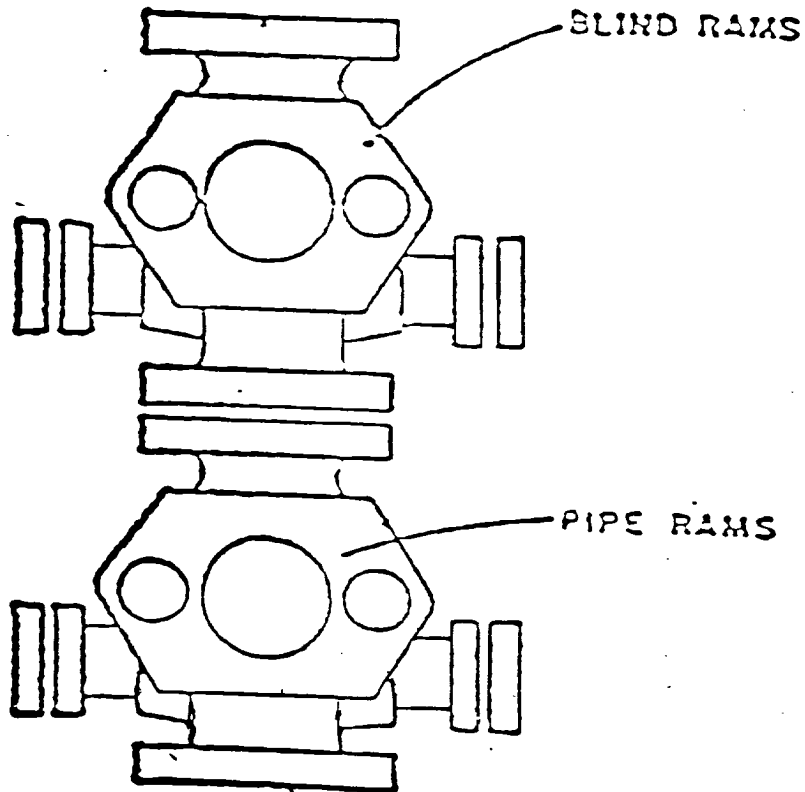

ARCO Oil & Gas Company
 Division of Atlantic Richfield Company
Blow Out Preventer Program

Lease Name Seven Rivers Queen Unit

Well No. 39

Location 660' FSL & 660' FWL
Sec 35-22S-36E, Lea County

BOP to be tested when installed on well and will be maintained in good working condition during drilling. All wellhead fittings to be of sufficient pressure to operate in a safe manner.