

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Reports

Well Name: SMITH FED GAS C Well Location: T22S / R23E / SEC 12 / County or Parish/State: EDDY /

SWNW /

NINA

IAIAI

Well Number: 2 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL

Lease Number: NMNM0251099A Unit or CA Name: SMITH FED GAS Unit or CA Number: NMNM85354

COM 2

US Well Number: 300152683400S1 Well Status: Gas Well Shut In Operator: EOG RESOURCES

INCORPORATED

Accepted for record – NMOCD gc 3/12/2021

Notice of Intent

Type of Submission: Notice of Intent

Type of Action Plug and Abandonment

Date Sundry Submitted: 01/19/2021 Time Sundry Submitted: 10:12

Date proposed operation will begin: 03/01/2021

Procedure Description: EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 7381 ft with 35 ft Class H cement on top to 7346 ft. This will cover Cisco Canyon perfs. WOC and tag. 3. Spot a 25 sx Class H cement plug from 6726 ft – 6511 ft. This will cover top Wolfcamp. 4. Spot a 25 sx Class H cement plug from 6307 ft – 6092 ft. This will cover top Dean. 5. Perforate at 3509 ft. Spot a 25 sx Class C cement plug from 3509 ft – 3297 ft. This will cover top Bone Spring. 6. Perforate at 2411 ft. Spot a 25 sx Class C cement plug from 2411 ft – 2199 ft. This will cover 8-5/8 inch casing shoe. WOC and tag. 7. Perforate at 266 ft. Spot a 32 sx Class C cement plug from 266 ft up to surface. Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. Wellbore schematics attached

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Smith_Fed_Gas_Com_2_Proposed_WBD_20210119101201.pdf

Smith_Fed_Gas_Com_2_Current_WBD_20210119101201.pdf

eived by OCD: 3/12/2021 8:14:31 AM Well Name: SMITH FED GAS C

US Well Number: 300152683400S1

Well Location: T22S / R23E / SEC 12 /

SWNW /

County or Parish/State: EDDY /

Unit or CA Number: NMNM85354

Operator: EOG RESOURCES

Zip:

Well Number: 2

Type of Well: CONVENTIONAL GAS

Well Status: Gas Well Shut In

WELL

Lease Number: NMNM0251099A Unit or CA Name: SMITH FED GAS

COM 2

Allottee or Tribe Name:

INCORPORATED

Conditions of Approval

Specialist Review

Smith_Fed_Gas_C_2_P_A_20210127101719.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: HUERTA Signed on: JAN 19, 2021 10:12 AM

Name: EOG RESOURCES INCORPORATED

Title: Regulatory Specialist

Street Address: NOT ENTERED

City: NOT ENTERED State: NOT ENTERED

Phone: (713) 651-7000

Email address:

Field Representative

Representative Name:

Street Address:

City: State:

Phone:

Email address:

BLM Point of Contact

Signature: Long Vo

BLM POC Name: Long Vo BLM POC Title: Petroleum Engineer

BLM POC Phone: 5752345972 BLM POC Email Address: Ivo@blm.gov

Disposition: Approved Disposition Date: 01/27/2021

Page 2 of 2

PLUG AND ABANDONMENT CONDITIONS OF APPROVAL

Critical Cave

OPERATOR'S NAME:

EOG Resources Incorporated

LEASE NO.:

NMNM0251099A

WELL NAME & NO.:

Smith Fed Gas C 2 300152683400S1

US Well Number: LOCATION:

Section 12, T.22 S., R.23 E., NMPM

COUNTY:


Eddy County, New Mexico

EOG Resources, Inc. plans to plug and abandon this well as follows:

- 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment.
- Set a CIBP at 7381 ft with 35 ft Class H cement on top to 7346 ft. This will cover Cisco Canyon 2. leak test CIBP, Must Use Bailer 6726 600' perfs. WOC and tag. 7440
- 3. Spot a 25 sx Class H cement plug from 6726 ft - 6511 ft. This will cover top Wolfcamp.
- Spot a 25 sx Class H cement plug from 6307 ft 6092 ft. This will cover top Dean. 4.
- Perforate at 3509 ft. Spot a 25 sx Class C cement plug from 3509 ft 3297 ft. This will cover top Perforate at 2411 ft. Spot a 25 sx Class C cement plug from 2411 ft – 2199 ft. This will cover 8-Bone Spring. WOC ETHE
- 5/8 inch casing shoe. WOC and tag. 60 5%
- Perforate at 266 ft. Spot a 32 sx Class C cement plug from 266 ft up to surface. Back fill as 7. needed. (In/out) Verify @ surface.
- 8. Cut off wellhead and install dry hole marker. Clean location as per regulated.

Wellbore schematics attached

Approval Subject to General Requirements and Special Stipulations Attached

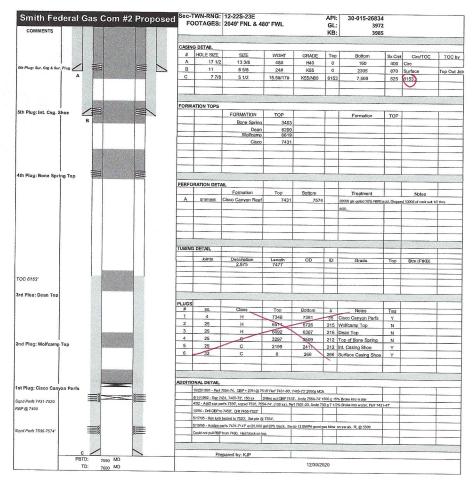

See COA

Smith Fe	ederal Gas Co	om #2 Current			12-22\$-23E 2049' FNL & 48	30' FWL		API: GL: KB:	30-015-2683 397 398	2		
				DETAIL.								
24.0				HOLE SIZE	SIZE	WGHT	GRADE	Тор	Bottom	Sx Cmt		TOC by
48, 11			B	17 1/2	13 3/8	48#	H40	0	160		Circ	
			C	7 7/8	8 5/8	24#	K55	0	2305		Circ	
				/ //8	5 1/2	15.5#/17#	K55/N80	6153	7,600	525	TOC 6153	
										-		
	9.6		FORMA	TION TOPS								
					FORMATION	TOP			Formation	TOP		T
	В				BS	3403						
					Dean	6200						
0.0			-		. WC	6619		-		-		
			\vdash	-	Cisco	7431		\vdash		-		
								-		-		
								-				
1												
			Perfora	tion Detail								
1			-		Formation	Тор	Bottom		Treatment		Notes	
1			_ A	5/18/1995	Cisco Canvon Reef	7431	7574		20000 gls gelled 20% NEFE	acid. Droppe		thru
1			-						acid.			
1			\vdash									
1			-	-				-				
1										-		-
1												
			Tubing	Detail								
			-	Joints	Description	1 th						
1				Journs	2.875	Length 7477	OD	1D	Grade	Тор	Btm (FtKB)	
1			-									
								-				
								-		-		
1												
								-				
1			\vdash					-				
	100		-					-				
	20					-		-		-		
- 1								-			-	
1								-		_		
1												
1												
1												
1	20 L			NAL DETAIL								
1			1	0/25/1991 - Perf 7	554-74, OBP+2011@75	18' Perf 7431-60', 7-	465-73" 2000g MCA					
d Perfs 7431-7520	XX	XXX	4	/11/1992 - Sqz 74	31, 7465-73', 150 sx	rited out CBP 7518	. Acdz 7554-74' 1	500 g 15%	Broke into water			
P@7490			1	one or once	7458', 192ed 7536, 755 7458', Drill 7458-7522'	4-74', (108 sx), Part	7501-20, Acdz 70	0 g 7 1/2%	Broke into water, Perl 743	1-47		
					7458'. Drill 7458-7522' basket to 7520'. Set ple (2)	7350		+				
į			5	/19/95 - Acidze rv	rfs 7431-7147 w/20,000 c	and 20% black David	h 12 BUDI mark			-		
	X X	NX MX	10	could not pull RRIP	rom 7490. Had block on to	n.	U 13 0111119000 0	IN DION OF	13W80. PL (\$ 5500	-	-	
in Pens /536-/5/4"						-		-+		-		
III Peris /536-75/4"												
ad Perfs 7536-75741	_											
ID Mens 7536-7674	C PBTD: 7590			Pre	pared by: DC							

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well completion, and final reclamation.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- The approved Subsequent Report of Reclamation will be your notice that the native soils, contour
 and seedbed have been reestablished. If the BLM objectives have not been met the operator will
 be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 20627

CONDITIONS OF APPROVAL

Operator:			OGRID:		Action Type:
EOG RESOURCES INC	P.O. Box 2267	Midland, TX79702	7377	20627	C-103F

OCD Reviewer	Condition
gcordero	None