

Well Name: MYSTERY AYM FEDERAL	Well Location: T20S / R25E / SEC 33 / NWSW /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMNM108454	Unit or CA Name:	Unit or CA Number:
US Well Number: 300153254100S1	Well Status: Gas Well Shut In	Operator: EOG RESOURCES INCORPORATED

Accepted for record – NMOCD gc 6/29/2021

Notice of Intent

Type of Submission: Notice of Intent	Type of Action Plug and Abandonment
Date Sundry Submitted: 06/04/2021	Time Sundry Submitted: 10:12
Date proposed operation will begin: 06/25/2021	
Procedure Description: Please see attached.	

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Mystery_AYM_Federal_1_6_4_21_20210604101224.pdf

Conditions of Approval

Specialist Review

Mystery_AYM_Fed_1_Revised_P_A_20210627100911.pdf

Well Name: MYSTERY AYM FEDERAL	Well Location: T20S / R25E / SEC 33 / NWSW /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMNM108454	Unit or CA Name:	Unit or CA Number:
US Well Number: 300153254100S1	Well Status: Gas Well Shut In	Operator: EOG RESOURCES INCORPORATED

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: TINA HUERTA	Signed on: JUN 04, 2021 10:12 AM
Name: EOG RESOURCES INCORPORATED	
Title: Regulatory Specialist	
Street Address: 104 SOUTH FOURTH STREET	
City: Artesia	State: NM
Phone: (575) 748-4168	
Email address: tina_huerta@eogresources.com	

Field Representative

Representative Name:		
Street Address:		
City:	State:	Zip:
Phone:		
Email address:		

BLM Point of Contact

BLM POC Name: ZOTA M STEVENS	BLM POC Title: Petroleum Engineer
BLM POC Phone: 5752345998	BLM POC Email Address: ZSTEVENS@BLM.GOV
Disposition: Approved	Disposition Date: 06/27/2021
Signature: Zota Stevens	

EOG Resources, Inc. plans to plug and abandon this well as follows:

1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment.
2. Set a CIBP at 9572 ft with 19 sx Class H cement on top to 9406 ft. WOC and tag. This will cover Morrow top perforations.
3. Spot a 25 sx Class H cement plug from 9228 ft – 9008 ft. This will cover Atoka top.
4. Spot a 25 sx Class H cement plug from 8832 ft – 8612 ft. This will cover Strawn top.
5. Spot a 25 sx Class H cement plug from 8302 ft – 8082 ft. This will cover Canyon top.
6. Spot a 37 sx Class C cement plug from 6825 ft – 6469 ft. This will cover Wolfcamp and 3rd Bone Spring tops.
7. Perforate at 3486 ft. Spot a 30 sx Class C cement plug from 3486 ft – 3193 ft. WOC and tag. This will cover 2nd Bone Spring and Bone Spring tops and intermediate casing.
8. Spot a 25 sx Class C cement plug from 950 ft – 704 ft. This will cover San Andres top.
9. Perforate at 555 ft. Spot a 25 sx Class C cement plug from 555 ft – 309 ft. This will cover surface casing shoe.
10. Perforate at 100 ft. Spot an 11 sx Class C cement plug from 100 ft up to surface. WOC and tag. Backfill as needed.
11. Cut off wellhead and install dry hole marker. Clean location as per regulated.

Wellbore schematics attached

Mystery AYM Federal 1 Current

Sec-TWN-RNG:
FOOTAGES:

Sec. 33-20S-25E
1980' FSL & 660' FWL

API: 30-015-32541
GL: 3634
KB: 3652

CASING DETAIL

#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method
A	17 1/2	13 3/8	48	H-40	0	432	600	Circ	
B	12 1/4	9 5/8	24	J-55	0	3,338	2026	Circ	
C	8 3/4	5 1/2	11.6	J-55/P-110	0	9,900	1200	Circ	

FORMATION TOPS

	Formation	Top		Formation	Top
	SA	827			
	BS	3243			
	2nd BS	3436			
	3rd BS	6519			
	WC	6702			
	Canyon	8192			
	Strawn	8722			
	Atoka	9118			
	Morrow	9456			

TUBING DETAIL

#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft):	Top (ftKB):	Btm (ftKB):
		2 7/8"							
		Packer @ 9236							

Perforation Detail

	Formation	Top	Bottom		Treatment			
A	Morrow	9,456	9,466		Frac Morrow w/70% Binary foam frac carrying 22,000# 18/40 Versaprop			
B	Morrow	9,512	9,532		Acidized w/1500g 7 1/2% IC HCL acid			
C	Morrow	9,572	9,622					

5/22/2007 Composite Bridge plug was not at 9500. Displaced hole w/N-2. All Morrow zones are open

DKC 1/28/21

A

B

C

PBTD: 9,857 MD
TD: 9,900 MD

Perf A

Perf B

Perf C

Mystery AYM Federal 1 Proposed

9th Plug

8th Plug

7th Plug

6th Plug

5th Plug


4th Plug

3rd Plug

2nd Plug

1st Plug

Existing Morrow Perfs: 9456' - 9622'

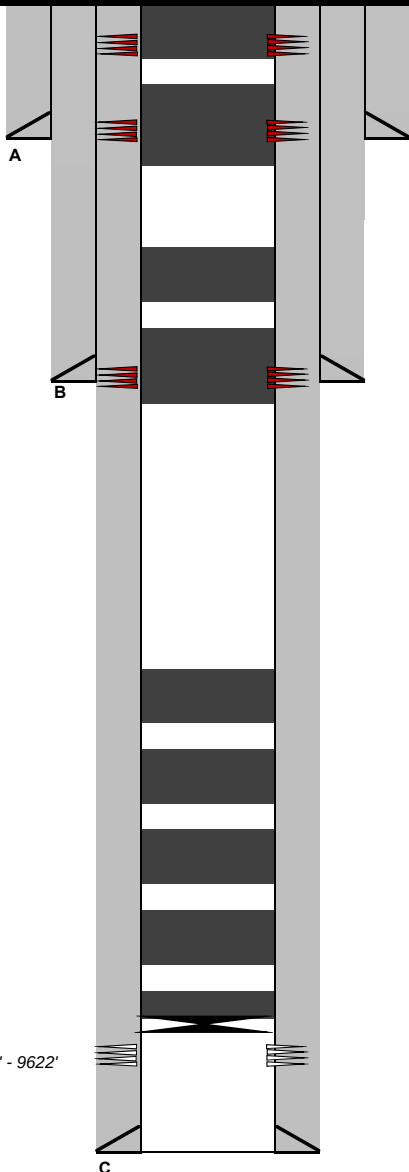

PBTD: 9,857 MD
TD: 9,900 MD

Sec-TWN-RNG: Sec. 33-20S-25E
FOOTAGES: 1980' FSL & 660' FWL

API: 30-015-32541
GL: 3634
KB: 3652

CASING DETAIL

#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method
A	17 1/2	13 3/8	48	H-40	0	432	600	Circ	
B	12 1/4	9 5/8	24	J-55	0	3,338	2026	Circ	
C	8 3/4	5 1/2	15.5	J-55/P-110	0	9,900	1200	Circ	

FORMATION TOPS

	Formation	Top		Formation	Top		Formation	Top	
	SA	827		Canyon	8192				
	BS	3243		Strawn	8722				
	2nd BS	3436		Atoka	9118				
	3rd BS	6519		Morrow	9456				
	WC	6702							

TUBING DETAIL

#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft):	Top (ftKB):	Btm (ftKB):
		2 7/8"							
		Packer @ 9236							

PLUGS

#	SX	Class	Top	Bottom	Δ	Notes	Tag
1	19	H	9406	9572	166	Morrow Top/Perfs	Y
2	25	H	9008	9228	220	Atoka Top	N
3	25	H	8612	8832	220	Strawn Top	N
4	25	H	8082	8302	220	Canyon Top	N
5	37	C	6469	6825	356	Wolfcamp Top & 3rd Bone Spring Top	N
6	30	C	3193	3486	293	2nd BS Top, BS Top & Int. Csg. Shoe	Y
7	25	C	704	950	246	San Andres Top	N
8	25	C	309	555	246	Sur. Csg. Shoe	Y
9	11	C	0	100	100	Surface Plug	Y

PERFORATION DETAIL

	Formation	Top	Bottom						
	Morrow	9456	9622						

ADDITIONAL DETAIL

Prepared by: KJP

Revised P&A

1. Set CIBP at 9444ft. Spot CI H cmt from 9444' - 9290'. (Pressure Test) **WOC & Tag(T/Morrow)**
2. Spot 25sx CI H from 9228'-9008'. **(T/Atoka)**
3. Spot 25 sx CI H from 8832'-8621'. **(T/ Strawn)**
4. Spot 25 sx CI H from 8302ft – 8615'. (T/ Canyon)
5. Spot 37 sx CI C from 6900' - 6700'. (T/Wolfcamp)
6. Spot CI C from 6600' - 5-6500'. (T/ 3rd BS)
7. Perf @ 3486'. Sqz 30 sx CI C from 3486'-3193'. **WOC & Tag (2nd BS)**
8. Perf @ 555' and Sqz 25 sx CI C from 555' - 704'. (T/San Andres)
9. Perf @ 100'. Sqz CI C from 100' – surface.
10. MLF between plugs- Above ground steel tanks will be utilized.
11. Cut wellhead off. Set Dry Hole marker.

**BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

**Permanent Abandonment of Federal Wells
Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (**Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure**). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Petroleum Engineering Tech
575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias
Environmental Protection Specialist
575-234-6230

Crisha Morgan
Environmental Protection Specialist
575-234-5987

Melissa Horn
Environmental Protection Specialist
575-234-5951

Kelsey Wade
Environmental Protection Specialist
575-234-2220

Trishia Bad Bear, Hobbs Field Station
Natural Resource Specialist
575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 33994

CONDITIONS

Operator: EOG RESOURCES INC P.O. Box 2267 Midland, TX 79702	OGRID: 7377
	Action Number: 33994
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	6/29/2021