

Well Name: HIGH HOPE FD GI	Well Location: T17S / R23E / SEC 23 / NWNE /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMNM0554756	Unit or CA Name: FEDERAL GI COM	Unit or CA Number: NMNM71956
US Well Number: 300152186200S1	Well Status: Producing Gas Well	Operator: EOG RESOURCES INCORPORATED

Accepted for record – NMOCD gc 9/16/2021

Notice of Intent

Sundry ID: 2633157

Type of Submission: Notice of Intent	Type of Action: Plug and Abandonment
Date Sundry Submitted: 09/08/2021	Time Sundry Submitted: 09:51
Date proposed operation will begin: 09/16/2021	

Procedure Description: Please see attached NOI to P&A. Thank you.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Federal_GI_Com_1_9_8_21_20210908095114.pdf

Well Name: HIGH HOPE FD GI	Well Location: T17S / R23E / SEC 23 / NWNE /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMNM0554756	Unit or CA Name: FEDERAL GI COM	Unit or CA Number: NMNM71956
US Well Number: 300152186200S1	Well Status: Producing Gas Well	Operator: EOG RESOURCES INCORPORATED

Conditions of Approval

Specialist Review

High_Hope_FD_GI_1_Sundry_ID_2633157_P_A_20210912124157.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: TINA HUERTA	Signed on: SEP 08, 2021 09:51 AM
Name: EOG RESOURCES INCORPORATED	
Title: Regulatory Specialist	
Street Address: 104 SOUTH FOURTH STREET	
City: Artesia	State: NM
Phone: (575) 748-4168	
Email address: tina_huerta@eogresources.com	

Field Representative

Representative Name:		
Street Address:		
City:	State:	Zip:
Phone:		
Email address:		

BLM Point of Contact

BLM POC Name: LONG VO	BLM POC Title: Petroleum Engineer
BLM POC Phone: 5752345972	BLM POC Email Address: LVO@BLM.GOV
Disposition: Approved	Disposition Date: 09/12/2021
Signature: Long Vo	

Federal GI Com 1
30-015-21862
Lease # NM-0554756
660'FNL & 1980'FEL
Unit Letter B-23-17S-23E
Eddy County, New Mexico

EOG Resources, Inc. plans to plug and abandon this well as follows:

1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment.
2. Perforate at 3741'. Spot a ~~45~~ ⁷⁵ sx Class C cement plug from 3741'-~~3498~~ ³⁴⁶²'. WOC and tag. This will cover TOC and Abo top. *(in/out)*
3. Perforate at 2960'. Spot a 32 sx Class C cement plug from 2960'-2830'. WOC and tag. This will cover Tubb top. *95 sx*
4. Perforate at 1602'. Spot an ~~84~~ ⁷⁵ sx Class C cement plug from 1602'-1255'. WOC and tag. This will cover Glorieta top and casing shoe. *(in/out)*
5. Perforate at 285'. Spot a ~~65~~ ⁷⁵ sx Class C cement plug from 285' up to surface. Back fill as needed. *75 sx*
6. Cut off wellhead and install dry hole marker. Clean location as per regulated. *(in/out)*

Wellbore schematics attached

(Verify @ surface)

→ Set CSBP @ 4374' spot 25 sx class C. Leak test CSBP.

Federal GI Com 1 Proposed


Sec-TWN-RNG: 23-17S-23E

API: 30-015-21862

GL: 3921

KB:

FOOTAGES: 660'FNL & 1980'FEL

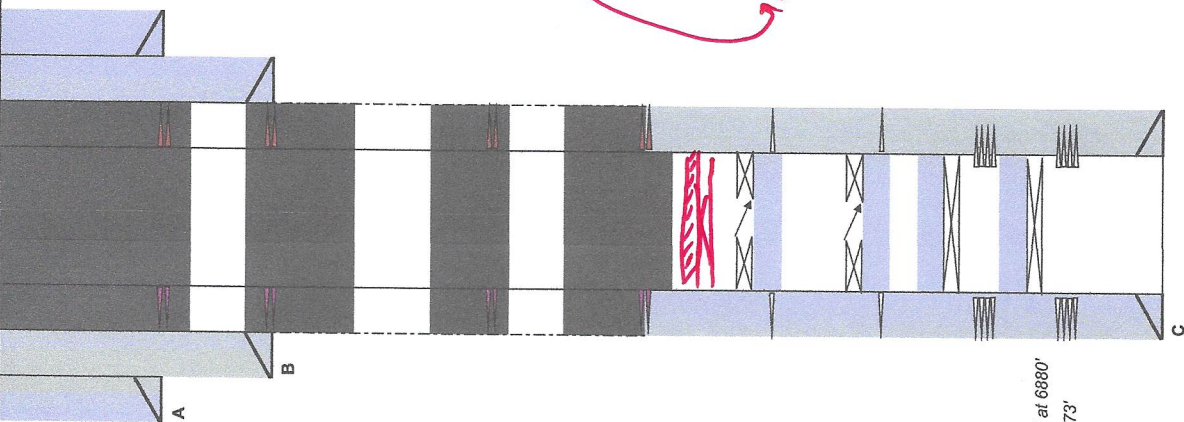

4th Plug

3rd Plug

2nd Plug

1st Plug

TOC at ~3660'

Existing Cmt. Retainer at 4711'

Existing Cmt. Circ. Perfs at 4860'

Existing Cmt. Retainer at 5250'

Existing Cmt. Circ. Perfs at 5490'

Existing CIBP w/ 15' cmt at 6720'

Existing Wolfcamp Perfs: 6763' - 6793'

Existing CIBP w/ cmt [vol. undisclosed] at 6880'

Existing Mississippian Perfs: 6965' - 7073'

PBTD: 4,711 MD

TD: 7,085 MD

CASING DETAIL

#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method
A	17 1/2	13 3/8	48	-	0	160	150	Circ	
B	12 1/4	8 5/8	24	K-55	0	1,305	850	Circ	
C	7 7/8	4 1/2	10.5	K-55	0	7,080	735	3660	CBL

FORMATION TOPS

Formation	Top	Formation	Top	Formation	Top
San Andres	234	Chester	6845		
Glorieta	1552	Mississippian	6960		
Tubb	2895				
Abo	3548				
Wolfcamp	4478				

TUBING DETAIL

#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft)	Top (ftKB)	Btn (ftKB)
		2 3/8 tubing & packer						4,405	

PLUGS

#	SX	Class	Top	Bottom	Notes	Tag
1	48' 75	C	3498	3741	TOC & Abo Top	Y
2	32	C	2830	2960	Tubb Top	Y
3	84' 95	C	1255	1602	Glorieta Top & Int. Csg. Shoe	Y
4	60' 75	C	0	285	San Andres Top, Sur. Csg. Shoe & Surface Plug	Y

9,501 04374' 259X

PERFORATION DETAIL

Formation	Top	Bottom	Formation	Top	Bottom
Mississippian	6,965	7,073	Abo	4,425	4,472
Wolfcamp	6,783	6,793			

ADDITIONAL DETAIL

Existing cement retainers at 4711' & 5250'

Existing CIBPs at 6720' & 6880' both topped with cement

Prepared by: KJP

Low Cave

Federal GI Com 1 Current

Sec-TWN-RNG: 23-17S-23E

FOOTAGES: 660'FNL & 1980'FEL

API: 30-015-21862

GL: 3921

KB:

CASING DETAIL

#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cnt	Circ/TOC	TOC Method
A	17 1/2	13 3/8	48	-	0	160	150	Circ	
B	12 1/4	8 5/8	24	K-55	0	1,305	850	Circ	
C	7 7/8	4 1/2	10.5	K-55	0	7,080	735	3660	CBL

FORMATION TOPS

Formation	Top	Formation	Top
San Andres	234		
Glorieta	1552		
Tubb	2895		
Abo	3548		
Wolfcamp	4478		
Chester	6845		
Mississippian	6960		

TUBING DETAIL

#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft)	Top (ftKB)	Blm (ftKB)
		2 3/8 tubing						4,405	
		Packer						4,383	

CIBP's at 6880 w/2 balls cement and 6720 w/15' cement

Perforated 4 holes at 5490, cement retainer at 5250 sqz w/150 sx cement

Perforated 4 holes at 4860, cement retainer at 4711 sqz w/325 sx cement

Perforation Detail

Formation	Top	Bottom	Treatment
Mississippian	6,965	7,073	Acidize w/4000g 15% DS-30 WAC-2 and nitrogen
Wolfcamp	6,783	6,793	Acidize w/1000g 7-1/2% MS acid and 5000 scf nitrogen with BS
Abo	4,426	4,471	Acidize w/4000g 15% DS-30 acid
Abo(Re-perforate)	4,424.5	4,472	Pumped 60,000g treated water, 100,000# sand, 70,000# 20/40 sand, 30,000# 100 mesh

Prepared by: TH

PBTD: 4,711 MD

TD: 7,085 MD

Perf D
Perf C

Perf B

Perf A

**BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

**Permanent Abandonment of Federal Wells
Conditions of Approval (LPC Habitat)**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the riggers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Petroleum Engineering Tech
575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias
Environmental Protection Specialist
575-234-6230

Crisha Morgan
Environmental Protection Specialist
575-234-5987

Melissa Horn
Environmental Protection Specialist
575-234-5951

Kelsey Wade
Environmental Protection Specialist
575-234-2220

Trishia Bad Bear, Hobbs Field Station
Natural Resource Specialist
575-393-3612

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 47979

CONDITIONS

Operator: EOG RESOURCES INC P.O. Box 2267 Midland, TX 79702	OGRID: 7377
	Action Number: 47979
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	9/16/2021