

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: FLATSEDGE ZR

**FEDERAL** 

Well Number: 1

Well Location: T8S / R38E / SEC 21 /

NENW /

County or Parish/State: ROOSEVELT / NM

Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name:

Lease Number: NMNM36490

**Unit or CA Name:** 

**Unit or CA Number:** 

**US Well Number: 3004120736** 

Well Status: Producing Gas Well

**Operator:** CONTANGO RESOURCES INC

#### **Notice of Intent**

**Sundry ID: 2629765** 

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 08/19/2021

**Time Sundry Submitted: 10:43** 

Date proposed operation will begin: 09/30/2021

Procedure Description: 1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg shoe). 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.

## **Surface Disturbance**

Is any additional surface disturbance proposed?: No

## **NOI Attachments**

## **Procedure Description**

Flatsedge\_ZR\_Federal\_1\_\_\_Proposed\_WBD\_20210819104308.pdf

Flatsedge\_ZR\_Federal\_1\_\_Current\_WBD\_20210819104258.pdf

**Accepted for Record Only** 

SUBJECT TO LIKE APPROVAL BY BLM

NMOCD 12/1/21

**FEDERAL** 

Lease Number: NMNM36490

**US Well Number: 3004120736** 

Well Number: 1

Type of Well: CONVENTIONAL GAS

Well Location: T8S / R38E / SEC 21 /

Well Status: Producing Gas Well

WELL

NENW /

**Unit or CA Name:** 

Allottee or Tribe Name:

ROOSEVELT / NM

County or Parish/State:

Page 2 of

**Unit or CA Number:** 

**Operator: CONTANGO** 

RESOURCES INC

# **Conditions of Approval**

## **Specialist Review**

Conditions\_of\_Approval\_20210826141621.pdf

General\_Conditions\_of\_Approval\_20210826141622.pdf

## **Operator Certification**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

**Operator Electronic Signature: ALISON DENNER** Signed on: AUG 19, 2021 10:43 AM

Name: CONTANGO RESOURCES INC

Title: Regulatory Analyst

Street Address: 717 TEXAS AVE., SUITE 2900

City: HOUSTON State: TX

Phone: (713) 236-7456

Email address: ADENNER@CONTANGO.COM

# **Field Representative**

**Representative Name:** 

**Street Address:** 

City:

Phone:

**Email address:** 

## **BLM Point of Contact**

**BLM POC Name: JENNIFER SANCHEZ** 

State:

**BLM POC Phone:** 5756270237

**Disposition:** Approved

Signature: Jennifer Sanchez

**BLM POC Title:** Petroleum Engineer


Zip:


BLM POC Email Address: j1sanchez@blm.gov

Disposition Date: 08/26/2021

Page 2 of 2

Received by OCD: 8440/202107823:45 AM State of New Mexico	Form C-103	
District I – (575) 393-6161 Energy, Minerals and Natural Res	ources Revised July 18, 2013	
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	WELL API NO.	
811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVIS	SION 30-041-20736	
District III - (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	5. Indicate Type of Lease STATE FEE FED	
District IV – (505) 476-3460 Santa Fe, NM 87505	STATE FEE FED  6. State Oil & Gas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM 87505	o. State on & das Lease No.	
SUNDRY NOTICES AND REPORTS ON WELLS	7 Lease Name on Unit Assessment N	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name FLATSEDGE ZR FEDERAL	
1. Type of Well: Oil Well Gas Well Other	8. Well Number 001	
2. Name of Operator	9. OGRID Number 330447	
CONTANGO RESOURCES, INC.	21 3 STAD TAINION 330447	
3. Address of Operator 717 TEXAS AVE., SUITE 2900, HOUSTON TX, 77002	10. Pool name or Wildcat	
4. Well Location	BLUITT; SAN ANDREAS (ASSOCIATE	
Control of the contro		
Territoring Cos Range	SSE NMPM County ROOSEVELT	
11. Elevation (Show whether DR, RKB, R 3977' GL	T, GR, etc.)	
6)11 32		
12. Check Appropriate Box to Indicate Nature of	f Notice Papart or Other Data	
	r volice, Report of Other Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		
TEMPORARIUM ARANDON	DIAL WORK ☐ ALTERING CASING ☐	
DILL OD ALTER CACING	ENCE DRILLING OPNS. P AND A	
PULL OR ALTER CASING   MULTIPLE COMPL   CASING DOWNHOLE COMMINGLE	G/CEMENT JOB	
CLOSED-LOOP SYSTEM		
OTHER:	?·	
13. Describe proposed or completed operations. (Clearly state all pertinent	details, and give pertinent dates, including estimated data	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M	details, and give pertinent dates, including estimated data	
	details, and give pertinent dates, including estimated data	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M	details, and give pertinent dates, including estimated data	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of	
<ul> <li>13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>2. Spot 25 sxs cmt from 4,595' - 4,395'.</li> </ul>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg)</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.)</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.)</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> <li>Proposed PA date: Sept 30 2021.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.)</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> <li>Proposed PA date: Sept 30 2021.</li> </ol>	details, and give pertinent dates, including estimated date ultiple Completions: Attach wellbore diagram of  Accepted for Record Only g shoe).	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg.) 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.  Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM	
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.</li> <li>Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.</li> <li>Spot 25 sxs cmt from 4,595' - 4,395'.</li> <li>Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC &amp; tag (8-5/8" csg.)</li> <li>Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.</li> <li>Cut off wellhead, verify cmt to surface, weld on dry hole marker.</li> <li>Proposed PA date: Sept 30 2021.</li> </ol>	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg.) 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.  Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg.) 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.  Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM  knowledge and belief.	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg.) 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker. Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM  knowledge and belief.	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg. 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker. Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:  Title_SR. Regulate  Type or print name _ALISON DENNER	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM  knowledge and belief.	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg. 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.  Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:  I hereby certify that the information above is true and complete to the best of my SIGNATURE  TITLE SR. REGULAT	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM  knowledge and belief.  ORY ANALYST DATE 8 9 2021	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg. 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker. Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:  Title SR. Regulate  Type or print name ALISON DENNER E-mail address: adenner( For State Use Only	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM  knowledge and belief.  ORY ANALYST DATE 8 2 2021  @contango.com PHONE: 713-236-7456	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For M proposed completion or recompletion.  1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg. 2. Spot 25 sxs cmt from 4,595' - 4,395'. 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' - 2,150', WOC & tag (8-5/8" csg. 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface. 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker. Proposed PA date: Sept 30 2021.  Spud Date:  Rig Release Date:  Title SR. Regulate  Type or print name ALISON DENNER  E-mail address: adenner(  For State Use Only	Accepted for Record Only g shoe).  SUBJECT TO LIKE APPROVAL BY BLM  knowledge and belief.	

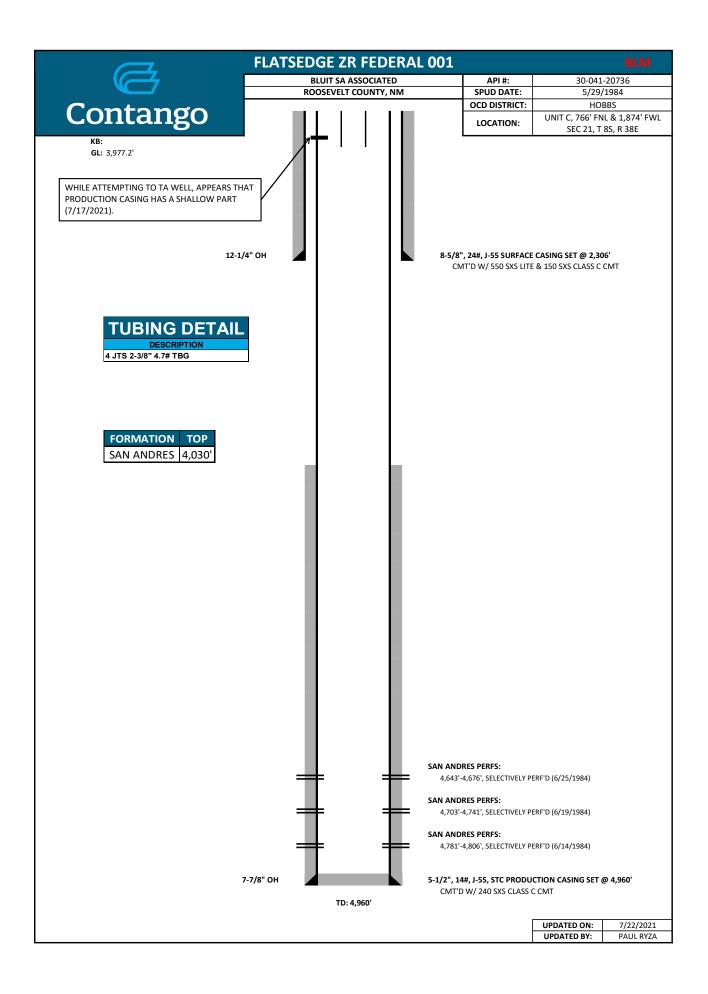

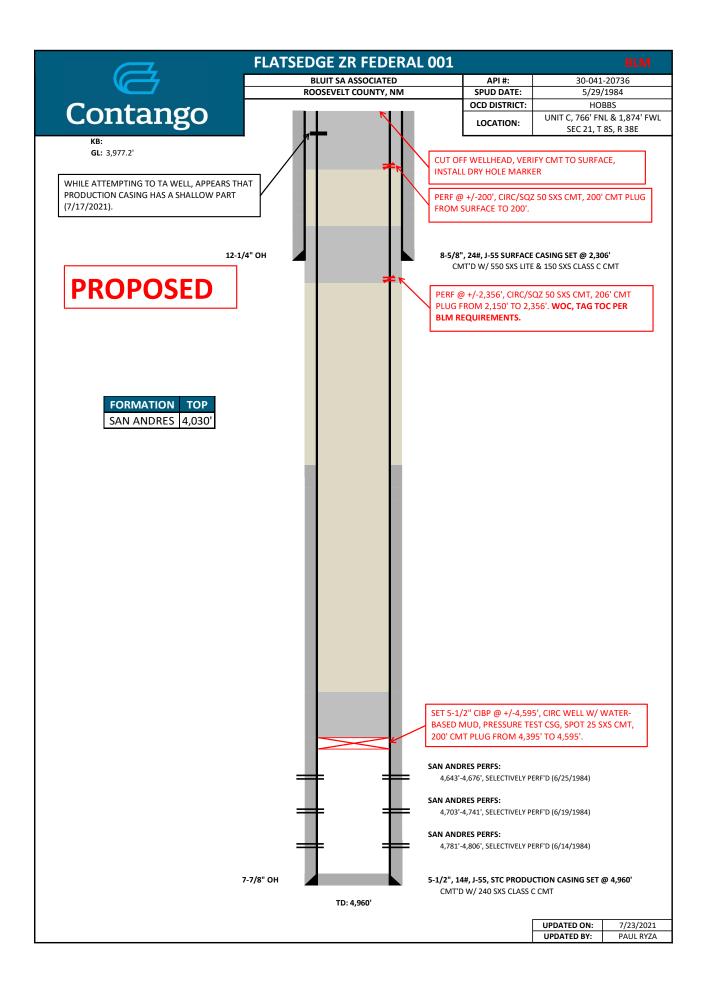

Flatsedge ZR Federal 001, 30-041-20736 Plugging Plan Contango Resources Inc. OGRID 330447

Notify OCD 24 hours prior to MIRU to P&A.

## Description of Procedure:


- 1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.
- 2. Spot 25 sxs cmt from 4,595' 4,395'.
- 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' 2,150', WOC & tag (8-5/8" csg shoe).
- 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.
- 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.


Flatsedge ZR Federal 001, 30-041-20736 Plugging Plan Contango Resources Inc. OGRID 330447

Notify OCD 24 hours prior to MIRU to P&A.

## Description of Procedure:

- 1. Set 5-1/2" CIBP @ 4,595', circ well w/ water-based mud, pressure test csg.
- 2. Spot 25 sxs cmt from 4,595' 4,395'.
- 3. Perf @ 2,356', circ/sqz 50 sxs cmt from 2,356' 2,150', WOC & tag (8-5/8" csg shoe).
- 4. Perf @ 200', circ/sqz 50 sxs cmt from 200' to surface.
- 5. Cut off wellhead, verify cmt to surface, weld on dry hole marker.

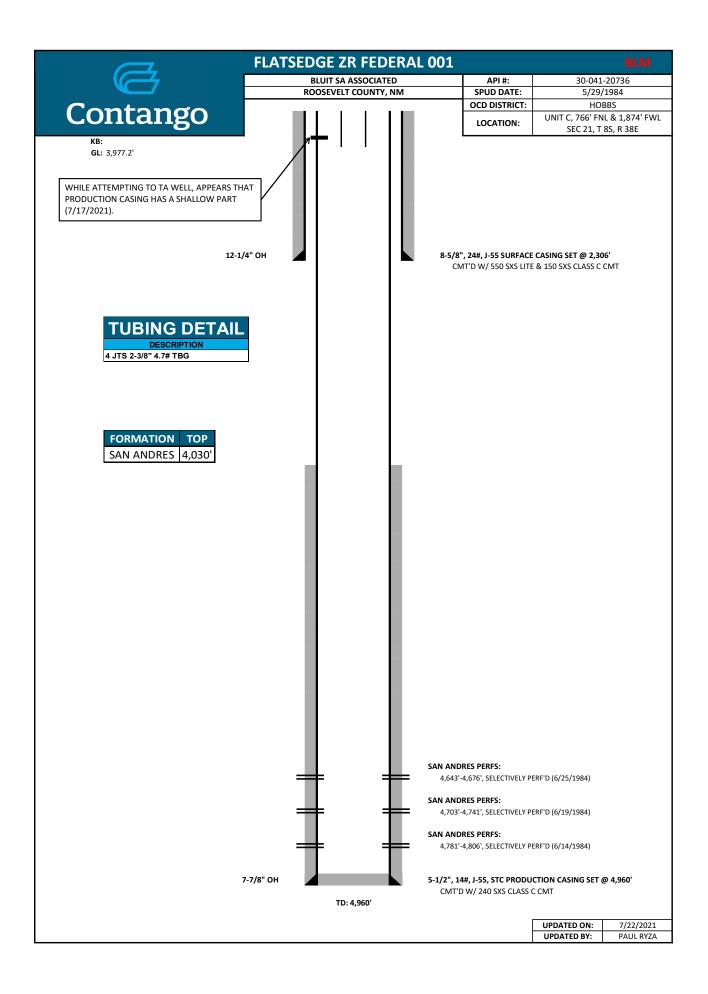

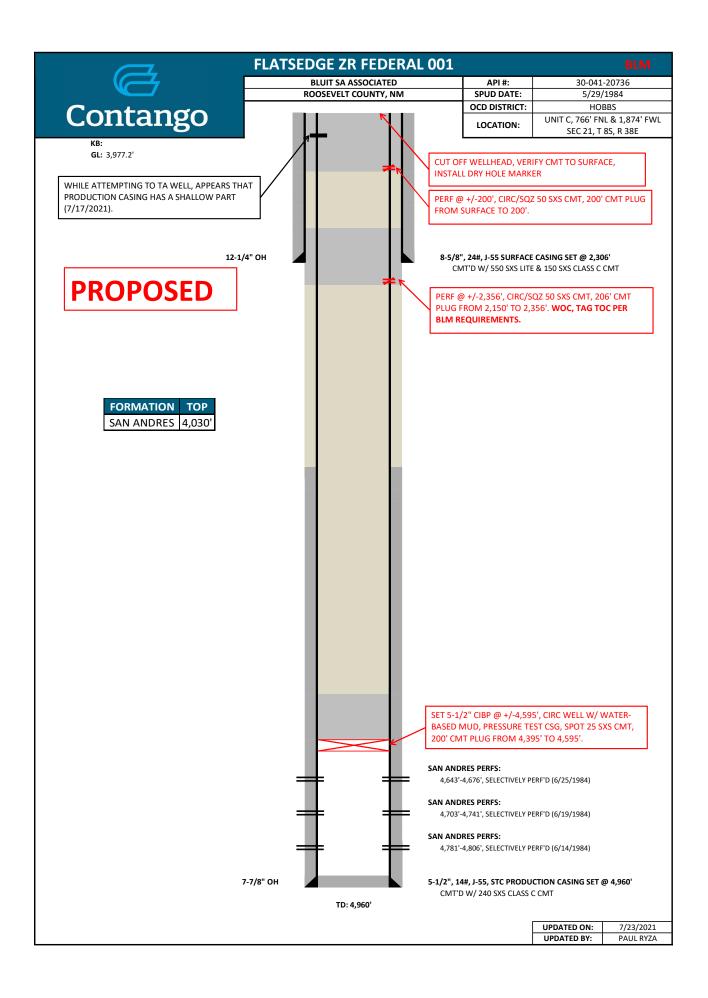

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 40877

#### **CONDITIONS**

Operator:	OGRID:
Contango Resources, Inc.	330447
717 Texas Ave.	Action Number:
Houston, TX 77002	40877
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
kfortner	Like approval from BLM	12/1/2021