
eceived by Och: 12/13/2021 6:57:1	State of New Me		Form C-103
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	Energy, Minerals and Natu		Revised July 18, 2013 WELL API NO. 30-025-42142
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	OIL CONSERVATION 1220 South St. Fran	ncis Dr.	5. Indicate Type of Lease STATE FEE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 87	7505	6. State Oil & Gas Lease No. VO-8658-0000
SUNDRY NOT (DO NOT USE THIS FORM FOR PROPO	ICES AND REPORTS ON WELLS SALS TO DRILL OR TO DEEPEN OR PLU	JG BACK TO A	7. Lease Name or Unit Agreement Name
PROPOSALS.) 1. Type of Well: Oil Well	CATION FOR PERMIT" (FORM C-101) FO Gas Well Other	OR SUCH	WOOL HEAD "20" STATE COM 8. Well Number 3
Name of Operator Advance Energy Partners		ABSONIANA	9. OGRID Number 00785
3. Address of Operator 11490 Westheimer RD, Suite 950 I	Houston, TX 77077	2 STANDER OF THE STANDARD OF T	10. Pool name or Wildcat WC-025, G-10, S2133280: WOLFCAMP
4. Well Location Unit Letter M: 330	feet from the S line and 330 i	feet from the W	
		IPM LEA	County
	11. Elevation (Show whether DR, 3739		
12. Check A	Appropriate Box to Indicate N	ature of Notice,	Report or Other Data
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPL	SUB- REMEDIAL WOR COMMENCE DRI CASING/CEMEN	LLING OPNS. P AND A
1. MIRU – NU BOP RIW W/ 12,150' – 11,870' WOC &	TAG Spot 60 sx Class H 10,550 2 H CMT @ 8,872' - 8,762' WOC &	2nd BS Spot 60	O BBLS MLF SPOT 70 SX CLASS H CMT @ O sx Class H 9960 1st BS
 PUW - PERF @ 5,268' SQ PUW - PERF @ 3,000' SQ PUW - PERF @ 1,678' SQ 	Z 60 SX CLASS C CMT @ 5,268' Z 60 SX CLASS C CMT @ 3,000' Z 85 SX CLASS C CMT @ 1,678' Z 70 SX CLASS C CMT @ 650'	– 2900' – 1,478' WOC & T	
	Z 600 SX CLASS C CMT @ 1900 CUT OFF WELL HEAD INSTALL		
4" diameter 4' tall Above	Ground Marker		ATTACHED CONDITIONS PPROVAL
I hereby certify that the information	above is true and complete to the be	st of my knowledge	e and belief.
SIGNATURE	TITLE_Opera	ntions Supervisor	DATE_12/13/21
Type or print nameJohnny Rodrig For State Use Only	gue E-mail address: _jro	odriguez@brigade.e	energy PHONE: (432)248-2019
APPROVED BY: Yerry	Forther TITLE Comp	liance Officer A	DATE 12/20/21
Conditions of Approval (if any).	575-2	263-6633	

Received by OCD: 12/13/2021 6:57:16 PM



CURRENT

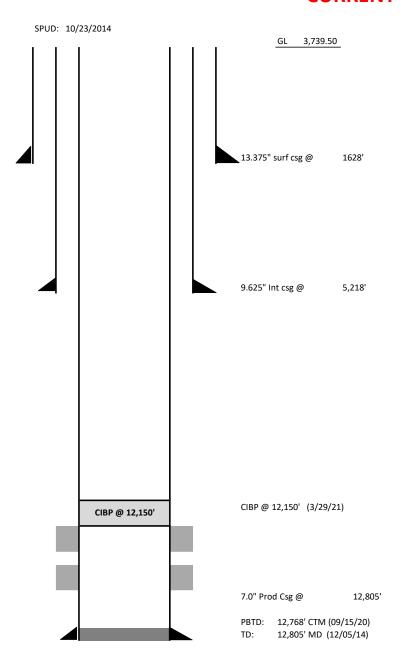

WELL NAME:	Wool Head 20 State Com 003		003			Engineer:	Boone Bajgier	•
COUNTY:	Lea					Prepared by:	Eileen M Kosa	ıkowski
STATE:	NM		Lat	32.4580102		Date:	11/18/2021	
API NO:	30-025-423	142	Long	-103.6021077				

CASING RECORD									
CASING TYPE	Size	Weight	Grade	Connection	MD	TVD	Sacks	Class	TOC
Surface Casing	13.375	54.50#	J-55		1628'		1400	С	0
Intermediate Csg	9.625	40.0#	P-110		5,218'		3645	С	0
Production Casing	7.000	29.0#	HCP-110	GBCD	12,805'		1330	Н	0

Operation	Amount and Material Used	Stages	From	то	Date	Isolated	Formation
Fracture	306,911 gal w/100,000# sand & 190,000# prop	35	12,220	12,250	4/16/2015	3/29/2021	Wolf Camp

Released to Imaging: 12/20/2021 1:06:10 PM

TOC

WELL NAME WOOI Head 80 State com #3

LOCATION M-330' F5L, 330' FUL. Sec. 20, T-215, R33E

GL_______ KB_____

17 # 30 -025 -42142



w	Augment of Man		100
Perf p 100'- 592.60sx From 100'- to surface.	1334" 545#	1,628'	Surface
From 100 - to surface.	9. % -40#	5,218'	Surface
Pert & 650'- 592-705K - cont From 650'-500'	(711-29#	12,805'	6,000 ?
CMF From 650 35	.0371 bbls/Ft	1-1CP110/	NAME OF THE PARTY
-Perf @1,628 - 392. 855x From 1,628 - 14 78- WOCA			
100 1628 - 14 78- WOCA	<i>t</i> 45,		

- Perf@3,000'-5q2. 60sxcmt@3,000'-2,900'-

- Pe, 1@ 5,268-597. 705xcm+@5,268'-5,106' WOC A. TAS.

- Spot 405x class-C-cmt @ 7,000'- 6,900'

Rustler - 1,558'

TOPS

CASING PROGRAM

Delaware - 5,196' Bone Springs-8, 772

Wolfcomp- 11, 970'

Perfs:

CIBP set @ 12,150'

-Spot 605x class-H-cmt @ 8,872"-8,762" word Tag

- Spot 70 sx class. H- cm+@12,150'-11,870'-word TAG

CIBP Set @ 12,150' 3-29-21

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS


In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Received by OCD: 12/13/2021 6:57:16 PM



CURRENT

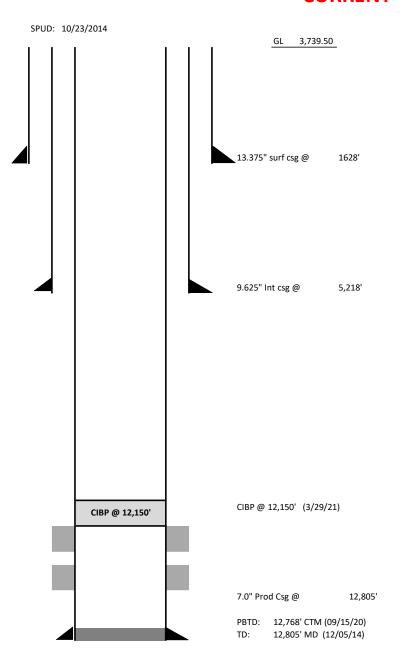

WELL NAME:	Wool Head 20 State Com 003		003			Engineer:	Boone Bajgier	
COUNTY:	Lea					Prepared by:	Eileen M Kosa	ıkowski
STATE:	NM		Lat	32.4580102		Date:	11/18/2021	
API NO:	30-025-421	L42	Long	-103.6021077				

CASING RECORD									
CASING TYPE	Size	Weight	Grade	Connection	MD	TVD	Sacks	Class	TOC
Surface Casing	13.375	54.50#	J-55		1628'		1400	С	0
Intermediate Csg	9.625	40.0#	P-110		5,218'		3645	С	0
Production Casing	7.000	29.0#	HCP-110	GBCD	12,805'		1330	Н	0

Operation	Amount and Material Used	Stages	From	TO	Date	Isolated	Formation
Fracture	306,911 gal w/100,000# sand & 190,000# prop	35	12,220	12,250	4/16/2015	3/29/2021	Wolf Camp

Released to Imaging: 12/20/2021 1:06:10 PM

WELL NAME WOOI Head BO State com #3

LOCATION M-330' F56,330' FUL. Sec. 20, T-215, R33E

GL_______ KB_____ 17 # 30 -025 -42142





SOMEON OF THE PROPERTY OF THE	CASING PRO		TOC
Perf p 100'- 592.60: From 100'- to surface.	X 1334" 545#	1,6 28'	Surface
From 100'- to surface.	9. 3/8"-40#	5,218'	Surface
Perfo 650'- 592-705K - cont From 650'- 500'	711-29#	12,805	6,000 ?
CMF F10m 050 300	,037/66/5/+	1-1CP110/	SUSTAILED DE LE CONTRACTION DE
-Perf @1,628 - 392. 85 From 1,628 - 1+1 78- WOO	7K		
		0 cm 1	
- Perf@3,000'-592. 60	SKCMT (W 3,000 "	2,400	

- Pe, 1@ 5,268-597. 705xcm+@5,268'-5,106' WOC A. TAS.

- Spot 405x class-C-cmt @ 7,000'- 6,900'

Rustler - 1,558' Delaware - 5,196'

TOPS

Bone Springs-8, 772 Wolfcomp. 11, 970'

Perfs: 12,220'-12,250' CIBP set @ 12,150'

-Spot 605x class-H-cmt @ 8,872"-8,762" word Tag

- Spot 70 sx class. H- cm+@12,150'-11,870'-word TAG

CIBP Set @ 12,150' 3-29-21

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 66770

CONDITIONS

Operator:	OGRID:
ADVANCE ENERGY PARTNERS HAT MESA, LLC	372417
11490 Westheimer Rd., Ste 950	Action Number:
Houston, TX 77077	66770
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached conditions of approval Note changes to procedure	12/20/2021