

Office  
 District I – (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II – (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III – (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV – (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM  
 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

Form C-103  
 Revised July 18, 2013

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

WELL API NO. 300-025-30157
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No. 313857
7. Lease Name or Unit Agreement Name WEST DOLLARHIDE QUEEN SAND UNIT
8. Well Number 106
9. OGRID Number 309777
10. Pool name or Wildcat DOLLARHIDE QUEEN

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator RAM ENERGY LLC	
3. Address of Operator 5100 E. SKELLY DRIVE SUITE #600, TULSA, OK 74135	
4. Well Location Unit Letter C : 1470 feet from the W line and 90 feet from the N line Section 30 Township 24S Range 38E NMPM County LEA	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3144KB	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	PNR <input type="checkbox"/>
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8-22-21  
 MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP POOH W/ TBJ 33 JNTS RIH W/TBJ & CIBP TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP  
 BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5  
 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ CWI SDO  
 8-23-21  
 HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU  
 CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL  
 VERIFY CMT POOH W/ WL RIH W/ WL PERF # @ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# CWI SDON  
 8-24-21  
 HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL  
 EQUIPMENT READY TO MOVE

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE\_Kevin Briceland TITLE Consultant DATE 1/10/21

Type or print name Kevin Briceland E-mail address: kbriceland@ramenergy.net PHONE: 918-947-6413

For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 2/3/22

Conditions of Approval (if any)

575-263-6633

**WELLBORE DIAGRAM  
WEST DOLLARHIDE QUEEN SAND UNIT #106**

**PROPOSED**

Created:	04/15/21	By:		Well #:	106
Updated:		By:		API	30-025-30157
Lease:	WEST DOOLARHIDE QUEEN SAND UNIT			Unit Ltr.:	C      Sec. 30
Field:	QUEEN			TSHR/Rng:	T:24S R:38E
Surf. Loc.:	1470 FWL & 90 FNL			Pool Code:	OGRID: 309777
Bot. Loc.:				Directions:	
County:	LEA	St.:	NM		
Status:					


**Surface Casing**

Size:	8-5/8"
Wt., Grd.:	24#
Depth:	410'
Sxs Cmt:	250
Circulate:	yes
TOC:	surface
Hole Size:	12-1/4"

FORMATION TOPS	
T.Salt	1290'
B. Salt	2610'

**Intermediate Casing**

Size:	5-1/2"
Wt., Grd.:	15.5#/17#
Depth:	4070'
Sxs Cmt:	1000
Circulate:	yes
TOC:	surface
Hole Size:	7-7/8"

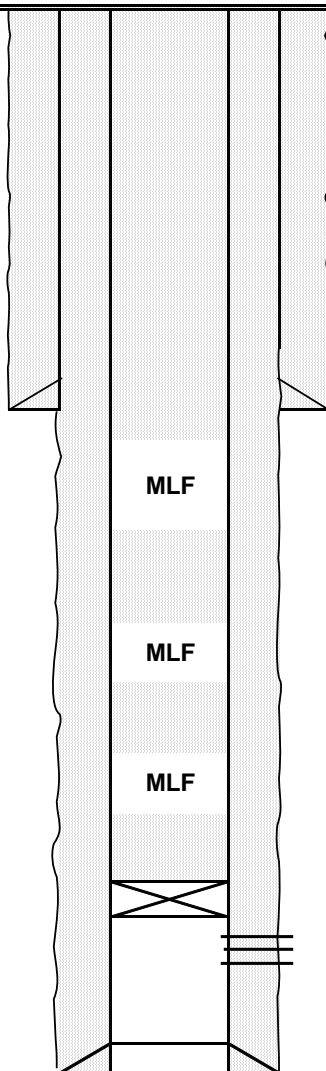

**SPOT 55SX OF CMT FROM 460'-SURFACE.  
VERIFY. (FW/SHOE/SURFACE)**

**SPOT 25SX OF CMT FROM 1340'-1190'.  
WOC&TAG. (T.SALT)**

**SPOT 40SX OF CMT FROM 2785'-2510'.  
WOC&TAG. (YATES/B.SALT)  
SET CIBP@3650' AND SPOT 25SX ON TOP  
FROM 3650'-3450'.(PERFS)**

**Queen: 3738'-3808'(OA)**

**COTTON OILFIELD SERVICES**

CALHOUN, La

**DAILY ACTIVITY REPORT**

**RAM ENERGY LLC**  
**WDQSU # 128**  
**LEA COUNTY, NM**  
**API # 30-025-30290**

8-18-21

ROAD RIG & EQUIPMENT TO LOCATION SPOT RIG, BASEBEAM & CMT PUMP MIXER COMBO PACKAGE ONTO LOCATION RU PUMP & PUMP LINES HOLD SFTY MTG & JSA HAUL IN CMT UNLOAD CMT RU UNIT OPEN WELL UP ND WELL PU ON TBJ RELEASE PKR POOH W/ PKR PKR DRAGGING ALL THE WAY OUT NU WELL CONTROL POOH W/ TBJ & PKR LD PKR RIH W/ TBJ & MECHANICAL SET CIBP TO 3654' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL CWI SDON

8-20-21

HOLD SFTY MTG & JSA RIH W/ WL PERF # @ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 700# RIH W/ TBJ TO 464' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 464' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 135**  
**LEA COUNTY, NM**  
**API # 30-025-30295**

8-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP ND TREE PU ON TBJ RELEASE PKR POOH W/ TBJ MIRU WL RIH W/ GAUGE RING TO 3533' POOH W/ WL RIH & SET CIBP @ 3,533' RIH W/ DUMP BAILER SPOT 35' CMT RIH W/ TBJ CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ MLF POOH W/ TBJ CWI SDON

8-21-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/

WL RIH W/ WL PERF #@ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)  
 NO INJECTION RATE @ 550# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H"  
 CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT  
 READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 106**  
**LEA COUNTY, NM**  
**API # 30-025-30157**

8-22-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP POOH W/ TBJ  
 33 JNTS RIH W/ TBJ & CIBP TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC  
 CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP  
 CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF  
 DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF  
 POOH W/ TBJ CWI SDON

8-23-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/  
 WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH  
 W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/  
 BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/  
 WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)  
 NO INJECTION RATE @ 500# CWI SDON

8-24-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS  
 CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL  
 EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 129**  
**LEA COUNTY, NM**  
**API # 30-025-30291**

8-24-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
 RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/ TBJ & CIBP  
 TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-25-21

HOLD SFTY MTG & JSA OPEN WELL UP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS  
 "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO  
 500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO

3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# CWI SDON

8-26-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 131**  
**LEA COUNTY, NM**  
**API # 30-025-30293**

8-26-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/ 50 JNTS TBJ CWI SDON

8-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ TBJ BREAK CIRC CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

8-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 06**  
**LEA COUNTY, NM**  
**API # 30-025-12263**

8-30-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 132 JNTS TBJ & PKR LD PKR CWI SDON

8-31-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-1-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 50 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 155**  
**LEA COUNTY, NM**  
**API # 30-025-30780**

9-1-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 119 JNTS TBJ & PKR LD PKR CWI SDON

9-2-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-3-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 132**  
**LEA COUNTY, NM**

**API # 30-025-30294**

9-3-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-7-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-8-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 130  
LEA COUNTY, NM  
API # 30-025-30292**

9-8-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT PU ON TBJ UN-SET PKR CIRC WELL W / MLF  
POOH W/ TBJ TOTAL OF 122 JNTS CWI SDON

9-9-21

HOLD SFTY MTG & JSA MIRU WL RIH W/ WL SET CIBP @ 3580' POOH W/ WL RIH W/  
BAILER & DUMP BAIL 35' CMT RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH  
W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD  
RELEASE WL RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO  
INJECTION RATE @ 500# MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC  
WDQSU # 103  
LEA COUNTY, NM  
API # 30-025-30154**

9-10-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-11-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-13-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 102**  
**LEA COUNTY, NM**  
**API # 30-025-30172**

9-13-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP RU ROD EQUIP  
PU ON RODS UN-SEAT PUMP POOH W/ 145 RODS CWI SDON

9-14-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC  
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 120 JNTS TBJ & SN RIH W/ WL SET  
CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO  
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER &  
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &  
SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT  
POOH W/ WL CWI SDON

9-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 79**  
**LEA COUNTY, NM**  
**API # 30-025-30002**



9-15-21

MOVE &amp; SPOT BASEBEAM HOLD SFTY MTG &amp; JSA MIRU UNIT OPEN WELL UP CWI SDON

9-16-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/WL SET CIBP TO 3550' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL CWI SDON

9-17-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520' POOH W/WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH W/TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 77**  
**LEA COUNTY, NM**  
**API # 30-025-30000**

9-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS RODS STUCK WORK RODS RU BACK-OFF TOOL BACK RODS OFF POOH W/ 90 RODS RD ROD EQUIP RU FOR TBJ PU ON TBJ POOH W/ 85 JNTS TBJ CWI SDON

9-21-21

HOLD SFTY MTG & JSA OPEN WELL UP BEGIN STRIPPING RODS & TUBING SWITCHING BACK & FORTH FROM ROD EQUIP TO TBJ EQUIP FINISH STRIPPING RODS & TBJ OUT OF THE HOLE NU WELL CONTROL RIH W/WL SET CIBP TO 3550' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL RIH W/TBJ BREAK CIRC TEST TBJ TO 500# CIRC WELL CLEAN CIRC W/ MLF POOH W/TBJ TEST CSG TO 500# POOH W/ 30 JNTS CWI SDON

9-22-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ REMAINING TBJ RU WL RIH W/CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520' POOH W/WL CWI SDON

9-23-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 153**  
**LEA COUNTY, NM**  
**API # 30-025-30357**

9-23-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-24-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 12**  
**LEA COUNTY, NM**  
**API # 30-025-12271**

9-27-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 117 JNTS TBJ & PKR LD PKR CWI SDON

9-28-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL WASH UP CMT EQUIP CWI SDON

9-29-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 101**  
**LEA COUNTY, NM**  
**API # 30-025-12271**

9-29-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3550' POOH W/WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL  
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL & PERF @ 520' POOH W/  
WL CWI SDON

10-1-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 21**  
**LEA COUNTY, NM**  
**API # 30-025-12270**

10-01-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

10-02-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL  
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL & PERF @ 520' POOH W/  
WL RU PUMP WASH UP CMT EQUIP CWI SDON

10-04-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 08**  
**LEA COUNTY, NM**  
**API # 30-025-12261**

10-04-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF CWI SDON

10-05-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ 122 JNTS TBJ RIH W/WL SET CIBP TO 3580' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL & PERF @ 520' POOH W/WL CWI SDON

10-06-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 90 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 81**  
**LEA COUNTY, NM**  
**API # 30-025-30011**

10-06-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 136 RODS CWI SDON

10-07-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC CNT TO WORK STUCK TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 112 JNTS TBJ RIH W/WL SET CIBP TO 3600' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# CWI SDON

10-08-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL & PERF @ 520' POOH W/WL CWI SDON

10-11-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 75**  
**LEA COUNTY, NM**  
**API # 30-025-29984**

10-11-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 141 RODS CWI SDON

10-12-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 125 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-13-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 152**  
**LEA COUNTY, NM**  
**API # 30-025-30358**

10-14-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 135 JNTS TBJ & PKR LD PKR CWI SDON

10-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-18-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 18**  
**LEA COUNTY, NM**  
**API # 30-025-12257**

10-18-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 118 JNTS TBJ & PKR LD PKR CWI SDON

10-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3520' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520' POOH W/WL CWI SDON

10-20-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 43 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 74**  
**LEA COUNTY, NM**  
**API # 30-025-29983**

10-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 50 JNTS TBJ & PKR LD PKR CWI SDON

10-21-21

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/WL SET CIBP TO 3472' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT

POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35'  
CMT POOH W/ WL CWI SDON

10-22-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU  
PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU  
PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/  
TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 113**  
**LEA COUNTY, NM**  
**API # 30-025-30231**

10-25-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
TRY TO RELEASE PKR HAVING TROUBLE W/ RELEASING PKR BEAT ON PKR RU TONGS  
CNT TO WORK PKR WORK PKR FREE NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX  
& CIRC WELL W/ 9.5 PPG MLF POOH W/ 110 JNTS TBJ & PKR LD PKR RIH W/ 15 JNTS FOR  
KILL STRING CWI SDON

10-26-21

HOLD SFTY MTG & JSA SBWO CMT DELIVERY MEET & GUIDE CMT TRUCK INTO RAM STAGGING  
AREA UN-LOAD CMT @ STAGGING YARD REPLACE VALES & SEATS IN TRI-PLEX PUMP SBWO  
WL FOR CIBP'S MIRU WL RIH W/ WL SET CIBP @ 3487' POOH W/ WL RIH W/ WL DUMP  
BAIL 35' CMT POOH W/ WL RU PUMP TEST CSG TO 500# CWI SDON

10-27-21

HOLD SFTY MTG & JSA MIRU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RE-HEAD WL RE-DRESS SETTING TOOL RIH W/ WL SET  
CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL  
PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

10-28-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 24**  
**LEA COUNTY, NM**  
**API # 30-025-12276**

10-28-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
TRY TO RELEASE PKR HAVING TROUBLE W/ RELEASING PKR BEAT ON PKR RU TONGS  
CNT TO WORK PKR WORK PKR FREE NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX  
& CIRC WELL W/ 9.5 PPG MLF POOH W/ 112 JNTS TBJ & PKR LD PKR MIRU WL RIH W/ WL  
SET CIBP @ 3470' POOH W/ WL RIH W/ WL DUMP 35' CMT RIH W/ 15 JNTS FOR KILL  
STRING CWI SDON

10-29-21

HOLD SFTY MTG & JSA RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP  
BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO  
520' RU PUMP MIX & SPOT 45 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP  
POOH W/ TBJ CWI SDON

**WDQSU # 111**  
**LEA COUNTY, NM**  
**API # 30-025-30192**

11-11-21

HOLD SFTY MTG & JSA SBWO CMT DELIVERY MEET & GUIDE CMT TRUCK INTO RAM STAGGING  
AREA UN-LOAD CMT @ STAGGING YARD MIRU UNIT & CMT EQUIP OPEN WELL UP BEGIN TO  
REMOVE HEAD EARS BROKEN ON HEAD CUT HEAD OFF PU ON TBJ RELEASE TAC CIRC  
WELL W/ MLF POOH W/ 30 JNTS TBJ CWI SDON

11-12-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 112 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3590' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

11-13-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 50 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 72**  
**LEA COUNTY, NM**  
**API # 30-025-29964**



11-15-21

MIRU UNIT & CMT EQUIP HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ RELEASE TAC  
CIRC WELL W/ MLF POOH W/ 110 JNTS TBJ MIRU WL RIH W/ WL SET CIBP @ 3472'  
POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL CWI SDON

11-16-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE  
@ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT SDON

**WDQSU # 110**  
**LEA COUNTY, NM**  
**API # 30-025-30287**

11-17-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT UN-SET PKR CIRC WELL W/ MLF PU ON TBJ  
POOH W/ 25 JNTS TBJ CWI SDON

11-18-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 111 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3556' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

11-19-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 137**  
**LEA COUNTY, NM**  
**API # 30-025-30275**

11-23-21

MIRU UNIT & CMT EQUIP HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ RELEASE PKR  
CIRC WELL W/ MLF POOH W/ 114 JNTS TBJ MIRU WL RIH W/ WL SET CIBP @ 3472'  
POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL CWI SDON

11-24-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE  
@ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT SDON

**WDQSU # 25**  
**LEA COUNTY, NM**  
**API # 30-025-12275**

11-29-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT UN-SET PKR CIRC WELL W/ MLF PU ON TBJ  
POOH W/ 35 JNTS TBJ CWI SDON

12-01-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 116 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3555' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

12-02-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 99**  
**LEA COUNTY, NM**  
**API # 30-025-30144**

12-02-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT RU ROD TONGS PU ON RODS UN-SEAT PUMP  
POOH W/ 149 RODS UN-SET TAC CIRC WELL W/ MLF PU ON TBJ POOH W/ 15 JNTS TBJ  
CWI SDON

12-03-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 120 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3575' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

12-04-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 45 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 47**  
**LEA COUNTY, NM**  
**API # 30-025-12290**

12-04-21

HOLD SFTY MTG & JSA CLEAR LOCATION FOR EQUIPMENT TO BE MOVED IN MOVE CMT  
PUMPING UNIT PAD MIRU ALL EQUIPMENT PU ON TBJ UN-SET PKR CIRC WELL W/ MLF  
POOH W/ 85 JNTS TBJ CWI SDON

12-06-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 119 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3577' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL RIH W/ TBJ TO 5620' RU PUMP EIR  
(ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RD RELEASE WL CWI SDON

12-07-21

HOLD SFTY MTG & JSA RU PUMP MIX & SPOT 40 SXS CLASS "C" CMT @ 520' TO SURF WASH  
UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 92**  
**LEA COUNTY, NM**  
**API # 30-025-30131**

12-07-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT RU ROD TONGS PU ON RODS UN-SEAT PUMP  
POOH W/ 142 RODS UN-SET TAC CIRC WELL W/ MLF PU ON TBJ CWI SDON

12-08-21

HOLD SFTY MTG & JSA POOH W/ TBJ TOTAL OF 122 JNTS MIRU WL RIH W/ WL SET  
CIBP @ 3487' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL  
SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL  
SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

12-09-21

HOLD SFTY MTG & JSA RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO  
INJECTION RATE @ 500# MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 96**  
**LEA COUNTY, NM**  
**API # 30-025-30166**

12-09-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT RU ROD TONGS PU ON RODS UN-SEAT PUMP  
POOH W/ 50 RODS ROD TONGS MALFUNCTIONED WORK ON TONGS CWI SDON

12-10-21

HOLD SFTY MTG & JSA POOH W/ REMAING RODS TOTAL OF 139 RODS PU ON TBJ UN-  
SET TAC CIRC WELL W MLF POOH W/ TBJ TOTAL OF 122 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3487' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT CWI SDON

12-11-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/  
TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 94**  
**LEA COUNTY, NM**  
**API # 30-025-30145**

12-12-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT PU ON TBJ RELEASE PKR CIRC WELL W/ MLF  
POOH W/ 112 JNTS TBJ CWI SDON

12-13-21

HOLD SFTY MTG & MIRU WL RIH W/ WL SET CIBP @ 3521' POOH W/ WL RIH W/ BAILER &  
DUMP BAIL 35' CMT RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35'  
CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL  
35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL RIH W/  
TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# MIX &  
SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN  
ALL EQUIPMENT READY TO MOVE

**WDQSU # 87**  
**LEA COUNTY, NM**  
**API # 30-025-30084**

12-14-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT CLEAR LOCATION TO ACCEPT EQUIPMENT RU  
ROD TONGS PU ON RODS UN-SEAT PUMP POOH W/ 100 RODS CWI SDON

12-15-21

HOLD SFTY MTG & JSA POOH W/ REMAING RODS TOTAL OF 137 RODS PU ON TBJ UN-  
SET TAC CIRC WELL W/ MLF POOH W/ TBJ TOTAL OF 120 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3487' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT RIH W/ WL SET CIBP  
@ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP  
@ 1320' CWI SDON

12-16-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL  
RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500#  
MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG  
DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 85**  
**LEA COUNTY, NM**  
**API # 30-025-30008**

12-16-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT PU ON TBJ UN-SET PKR CIRC WELL W/ MLF  
POOH W/ TBJ TOTAL OF 120 CWI SDON

12-17-21

HOLD SFTY MTG & JSA      MIRU WL   RIH W/ WL   SET CIBP @ 3612'   POOH W/ WL   RIH W/  
BAILER & DUMP BAIL 35' CMT   RIH W/ WL   SET CIBP @ 2760'   POOH W/ WL   RIH W/ WL  
DUMP BAIL 35' CMT   POOH W/ WL   RIH W/ WL   SET CIBP @ 1320'   CWI   SDON  
RU WL   RIH W/ WL   PERF @ 520'   POOH W/ WL   RD RELEASE WL   RIH W/ TBJ TO 520'  
RU PUMP   EIR (ESTABLISH INJECTION RATE)   NO INJECTION RATE @ 500#   MIX & SPOT 55 SXS  
CLASS "C" CMT @ 520' TO SURF   WASH UP CMT EQUIP   POOH W/ TBJ   RIG DOWN ALL  
EQUIPMENT   READY TO MOVE

**WDQSU # 35**  
**LEA COUNTY, NM**  
**API # 30-025-12289**

12-18-21

HOLD SFTY MTG & JSA   MIRU ALL EQUIPMENT   ND HEAD   PU ON TBJ   UN-SET PKR   CIRC  
WELL W/ MLF   POOH W/ 115 JNTS TBJ   MIRU WL   RIH W/ WL   SET CIBP @ 3612'   POOH  
W/ WL   RIH W/ BAILER & DUMP BAIL 35' CMT   RIH W/ WL   SET CIBP @ 2760'   POOH W/ WL  
RIH W/ WL   DUMP BAIL 35' CMT   POOH W/ WL   RIH W/ WL   SET CIBP @ 1320'  
RU WL   RIH W/ WL   PERF @ 520'   POOH W/ WL   RD RELEASE WL   CWI   SDON

12-20-21

HOLD JSA & SFTY MTG   RIH W/ TBJ TO 520'   RU PUMP   EIR (ESTABLISH INJECTION RATE)   NO  
INJECTION RATE @ 500#   MIX & SPOT 40 SXS CLASS "C" CMT @ 520' TO SURF   WASH UP CMT  
EQUIP   POOH W/ TBJ   RIG DOWN ALL EQUIPMENT   CUT & COVER HEAD

**END OF PLUGGING OPERATIONS ON THE WEST DOLLARHIDE QUEEN SANDS UNIT**

**COTTON OILFIELD SERVICES**

CALHOUN, La

**DAILY ACTIVITY REPORT**

**RAM ENERGY LLC**  
**WDQSU # 128**  
**LEA COUNTY, NM**  
**API # 30-025-30290**

8-18-21

ROAD RIG & EQUIPMENT TO LOCATION SPOT RIG, BASEBEAM & CMT PUMP MIXER COMBO PACKAGE ONTO LOCATION RU PUMP & PUMP LINES HOLD SFTY MTG & JSA HAUL IN CMT UNLOAD CMT RU UNIT OPEN WELL UP ND WELL PU ON TBJ RELEASE PKR POOH W/ PKR PKR DRAGGING ALL THE WAY OUT NU WELL CONTROL POOH W/ TBJ & PKR LD PKR RIH W/ TBJ & MECHANICAL SET CIBP TO 3654' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL CWI SDON

8-20-21

HOLD SFTY MTG & JSA RIH W/ WL PERF # @ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 700# RIH W/ TBJ TO 464' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 464' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 135**  
**LEA COUNTY, NM**  
**API # 30-025-30295**

8-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP ND TREE PU ON TBJ RELEASE PKR POOH W/ TBJ MIRU WL RIH W/ GAUGE RING TO 3533' POOH W/ WL RIH & SET CIBP @ 3,533' RIH W/ DUMP BAILER SPOT 35' CMT RIH W/ TBJ CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ MLF POOH W/ TBJ CWI SDON

8-21-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/

WL RIH W/ WL PERF #@ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)  
 NO INJECTION RATE @ 550# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H"  
 CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT  
 READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 106**  
**LEA COUNTY, NM**  
**API # 30-025-30157**

8-22-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP POOH W/ TBJ  
 33 JNTS RIH W/ TBJ & CIBP TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC  
 CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP  
 CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF  
 DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF  
 POOH W/ TBJ CWI SDON

8-23-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/  
 WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH  
 W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/  
 BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/  
 WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)  
 NO INJECTION RATE @ 500# CWI SDON

8-24-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS  
 CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL  
 EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 129**  
**LEA COUNTY, NM**  
**API # 30-025-30291**

8-24-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
 RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/ TBJ & CIBP  
 TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-25-21

HOLD SFTY MTG & JSA OPEN WELL UP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS  
 "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO  
 500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO



3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# CWI SDON

8-26-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 131**  
**LEA COUNTY, NM**  
**API # 30-025-30293**

8-26-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/ 50 JNTS TBJ CWI SDON

8-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ TBJ BREAK CIRC CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

8-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 06**  
**LEA COUNTY, NM**  
**API # 30-025-12263**

8-30-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 132 JNTS TBJ & PKR LD PKR CWI SDON

8-31-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-1-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 50 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 155**  
**LEA COUNTY, NM**  
**API # 30-025-30780**

9-1-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 119 JNTS TBJ & PKR LD PKR CWI SDON

9-2-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-3-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 132**  
**LEA COUNTY, NM**

**API # 30-025-30294**

9-3-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-7-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-8-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 130  
LEA COUNTY, NM  
API # 30-025-30292**

9-8-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT PU ON TBJ UN-SET PKR CIRC WELL W / MLF  
POOH W/ TBJ TOTAL OF 122 JNTS CWI SDON

9-9-21

HOLD SFTY MTG & JSA MIRU WL RIH W/ WL SET CIBP @ 3580' POOH W/ WL RIH W/  
BAILER & DUMP BAIL 35' CMT RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH  
W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD  
RELEASE WL RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO  
INJECTION RATE @ 500# MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC  
WDQSU # 103  
LEA COUNTY, NM  
API # 30-025-30154**

9-10-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-11-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/ WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL  
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-13-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 102**  
**LEA COUNTY, NM**  
**API # 30-025-30172**

9-13-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP RU ROD EQUIP  
PU ON RODS UN-SEAT PUMP POOH W/ 145 RODS CWI SDON

9-14-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC  
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 120 JNTS TBJ & SN RIH W/WL SET  
CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO  
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER &  
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &  
SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT  
POOH W/ WL CWI SDON

9-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'  
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 79**  
**LEA COUNTY, NM**  
**API # 30-025-30002**

9-15-21

MOVE &amp; SPOT BASEBEAM HOLD SFTY MTG &amp; JSA MIRU UNIT OPEN WELL UP CWI SDON

9-16-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC  
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/WL SET  
CIBP TO 3550' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO  
500# RU WL RIH W/CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER &  
CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH &  
SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT  
POOH W/WL CWI SDON

9-17-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520'  
POOH W/WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH  
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 77**  
**LEA COUNTY, NM**  
**API # 30-025-30000**

9-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS  
RODS STUCK WORK RODS RU BACK-OFF TOOL BACK RODS OFF POOH W/ 90 RODS RD  
ROD EQUIP RU FOR TBJ PU ON TBJ POOH W/ 85 JNTS TBJ CWI SDON

9-21-21

HOLD SFTY MTG & JSA OPEN WELL UP BEGIN STRIPPING RODS & TUBING SWITCHING BACK &  
FORTH FROM ROD EQUIP TO TBJ EQUIP FINISH STRIPPING RODS & TBJ OUT OF THE HOLE NU  
WELL CONTROL RIH W/WL SET CIBP TO 3550' POOH W/WL RIH W/WL DUMP BAIL 35'  
CMT POOH W/WL RIH W/TBJ BREAK CIRC TEST TBJ TO 500# CIRC WELL CLEAN CIRC  
W/ MLF POOH W/ TBJ TEST CSG TO 500# POOH W/ 30 JNTS CWI SDON

9-22-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ REMAINING TBJ RU WL RIH W/CIBP SET  
CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL  
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL RIH W/WL VERIFY CMT  
POOH W/WL & PERF @ 520' POOH W/WL CWI SDON

9-23-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 153**  
**LEA COUNTY, NM**  
**API # 30-025-30357**

9-23-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-24-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC**  
**WDQSU # 12**  
**LEA COUNTY, NM**  
**API # 30-025-12271**

9-27-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 117 JNTS TBJ & PKR LD PKR CWI SDON

9-28-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL WASH UP CMT EQUIP CWI SDON

9-29-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 101**  
**LEA COUNTY, NM**  
**API # 30-025-12271**

9-29-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3550' POOH W/WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL  
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL & PERF @ 520' POOH W/  
WL CWI SDON

10-1-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 21**  
**LEA COUNTY, NM**  
**API # 30-025-12270**

10-01-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG  
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

10-02-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/WL RIH W/  
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP  
@ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL  
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU  
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL & PERF @ 520' POOH W/  
WL RU PUMP WASH UP CMT EQUIP CWI SDON

10-04-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 08**  
**LEA COUNTY, NM**  
**API # 30-025-12261**

10-04-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF CWI SDON

10-05-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ 122 JNTS TBJ RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-06-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 90 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 81**  
**LEA COUNTY, NM**  
**API # 30-025-30011**

10-06-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 136 RODS CWI SDON

10-07-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC CNT TO WORK STUCK TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 112 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-08-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON



10-11-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 75**  
**LEA COUNTY, NM**  
**API # 30-025-29984**

10-11-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 141 RODS CWI SDON

10-12-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 125 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-13-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 152**  
**LEA COUNTY, NM**  
**API # 30-025-30358**

10-14-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 135 JNTS TBJ & PKR LD PKR CWI SDON

10-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-18-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 18**  
**LEA COUNTY, NM**  
**API # 30-025-12257**

10-18-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 118 JNTS TBJ & PKR LD PKR CWI SDON

10-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3520' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU BAILER & CMT RIH W/BAILER & CMT DUMP 35' CMT RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520' POOH W/WL CWI SDON

10-20-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 43 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 74**  
**LEA COUNTY, NM**  
**API # 30-025-29983**

10-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 50 JNTS TBJ & PKR LD PKR CWI SDON

10-21-21

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/WL SET CIBP TO 3472' POOH W/WL RIH W/WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL SBWOC RU CIBP RIH W/WL VERFIY CMT

POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35'  
CMT POOH W/ WL CWI SDON

10-22-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU  
PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU  
PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/  
TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 113**  
**LEA COUNTY, NM**  
**API # 30-025-30231**

10-25-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
TRY TO RELEASE PKR HAVING TROUBLE W/ RELEASING PKR BEAT ON PKR RU TONGS  
CNT TO WORK PKR WORK PKR FREE NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX  
& CIRC WELL W/ 9.5 PPG MLF POOH W/ 110 JNTS TBJ & PKR LD PKR RIH W/ 15 JNTS FOR  
KILL STRING CWI SDON

10-26-21

HOLD SFTY MTG & JSA SBWO CMT DELIVERY MEET & GUIDE CMT TRUCK INTO RAM STAGGING  
AREA UN-LOAD CMT @ STAGGING YARD REPLACE VALES & SEATS IN TRI-PLEX PUMP SBWO  
WL FOR CIBP'S MIRU WL RIH W/ WL SET CIBP @ 3487' POOH W/ WL RIH W/ WL DUMP  
BAIL 35' CMT POOH W/ WL RU PUMP TEST CSG TO 500# CWI SDON

10-27-21

HOLD SFTY MTG & JSA MIRU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RE-HEAD WL RE-DRESS SETTING TOOL RIH W/ WL SET  
CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL  
PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

10-28-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 24**  
**LEA COUNTY, NM**  
**API # 30-025-12276**

10-28-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ  
TRY TO RELEASE PKR HAVING TROUBLE W/ RELEASING PKR BEAT ON PKR RU TONGS  
CNT TO WORK PKR WORK PKR FREE NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX  
& CIRC WELL W/ 9.5 PPG MLF POOH W/ 112 JNTS TBJ & PKR LD PKR MIRU WL RIH W/ WL  
SET CIBP @ 3470' POOH W/ WL RIH W/ WL DUMP 35' CMT RIH W/ 15 JNTS FOR KILL  
STRING CWI SDON

10-29-21

HOLD SFTY MTG & JSA RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP  
BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO  
520' RU PUMP MIX & SPOT 45 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP  
POOH W/ TBJ CWI SDON

**WDQSU # 111**  
**LEA COUNTY, NM**  
**API # 30-025-30192**

11-11-21

HOLD SFTY MTG & JSA SBWO CMT DELIVERY MEET & GUIDE CMT TRUCK INTO RAM STAGGING  
AREA UN-LOAD CMT @ STAGGING YARD MIRU UNIT & CMT EQUIP OPEN WELL UP BEGIN TO  
REMOVE HEAD EARS BROKEN ON HEAD CUT HEAD OFF PU ON TBJ RELEASE TAC CIRC  
WELL W/ MLF POOH W/ 30 JNTS TBJ CWI SDON

11-12-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 112 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3590' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

11-13-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 50 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 72**  
**LEA COUNTY, NM**  
**API # 30-025-29964**

11-15-21

MIRU UNIT & CMT EQUIP HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ RELEASE TAC  
CIRC WELL W/ MLF POOH W/ 110 JNTS TBJ MIRU WL RIH W/ WL SET CIBP @ 3472'  
POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL CWI SDON

11-16-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE  
@ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT SDON

**WDQSU # 110**  
**LEA COUNTY, NM**  
**API # 30-025-30287**

11-17-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT UN-SET PKR CIRC WELL W/ MLF PU ON TBJ  
POOH W/ 25 JNTS TBJ CWI SDON

11-18-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 111 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3556' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

11-19-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 137**  
**LEA COUNTY, NM**  
**API # 30-025-30275**

11-23-21

MIRU UNIT & CMT EQUIP HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ RELEASE PKR  
CIRC WELL W/ MLF POOH W/ 114 JNTS TBJ MIRU WL RIH W/ WL SET CIBP @ 3472'  
POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL CWI SDON

11-24-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE  
@ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT SDON

**WDQSU # 25**  
**LEA COUNTY, NM**  
**API # 30-025-12275**

11-29-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT UN-SET PKR CIRC WELL W/ MLF PU ON TBJ  
POOH W/ 35 JNTS TBJ CWI SDON

12-01-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 116 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3555' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

12-02-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 99**  
**LEA COUNTY, NM**  
**API # 30-025-30144**

12-02-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT RU ROD TONGS PU ON RODS UN-SEAT PUMP  
POOH W/ 149 RODS UN-SET TAC CIRC WELL W/ MLF PU ON TBJ POOH W/ 15 JNTS TBJ  
CWI SDON

12-03-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 120 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3575' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

12-04-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 45 SXS CLASS "C" CMT @ 520' TO SURF  
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 47**  
**LEA COUNTY, NM**  
**API # 30-025-12290**

12-04-21

HOLD SFTY MTG & JSA CLEAR LOCATION FOR EQUIPMENT TO BE MOVED IN MOVE CMT  
PUMPING UNIT PAD MIRU ALL EQUIPMENT PU ON TBJ UN-SET PKR CIRC WELL W/ MLF  
POOH W/ 85 JNTS TBJ CWI SDON

12-06-21

HOLD SFTY MTG & JSA POOH W/ REMAING TBJ TOTAL OF 119 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3577' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH  
W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL RIH W/ TBJ TO 5620' RU PUMP EIR  
(ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RD RELEASE WL CWI SDON

12-07-21

HOLD SFTY MTG & JSA RU PUMP MIX & SPOT 40 SXS CLASS "C" CMT @ 520' TO SURF WASH  
UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 92**  
**LEA COUNTY, NM**  
**API # 30-025-30131**

12-07-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT RU ROD TONGS PU ON RODS UN-SEAT PUMP  
POOH W/ 142 RODS UN-SET TAC CIRC WELL W/ MLF PU ON TBJ CWI SDON

12-08-21

HOLD SFTY MTG & JSA POOH W/ TBJ TOTAL OF 122 JNTS MIRU WL RIH W/ WL SET  
CIBP @ 3487' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL  
SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL  
SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/  
WL PERF @ 520' POOH W/ WL RD RELEASE WL CWI SDON

12-09-21

HOLD SFTY MTG & JSA RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO  
INJECTION RATE @ 500# MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT  
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 96**  
**LEA COUNTY, NM**  
**API # 30-025-30166**

12-09-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT RU ROD TONGS PU ON RODS UN-SEAT PUMP  
POOH W/ 50 RODS ROD TONGS MALFUNCTIONED WORK ON TONGS CWI SDON

12-10-21

HOLD SFTY MTG & JSA POOH W/ REMAING RODS TOTAL OF 139 RODS PU ON TBJ UN-  
SET TAC CIRC WELL W MLF POOH W/ TBJ TOTAL OF 122 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3487' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT CWI SDON

12-11-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL  
DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE  
WL RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @  
500# MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/  
TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 94**  
**LEA COUNTY, NM**  
**API # 30-025-30145**



12-12-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT PU ON TBJ RELEASE PKR CIRC WELL W/ MLF  
POOH W/ 112 JNTS TBJ CWI SDON

12-13-21

HOLD SFTY MTG & MIRU WL RIH W/ WL SET CIBP @ 3521' POOH W/ WL RIH W/ BAILER &  
DUMP BAIL 35' CMT RIH W/ WL SET CIBP @ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35'  
CMT POOH W/ WL RIH W/ WL SET CIBP @ 1320' POOH W/ WL RIH W/ WL DUMP BAIL  
35' CMT POOH W/ WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL RIH W/  
TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# MIX &  
SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN  
ALL EQUIPMENT READY TO MOVE

**WDQSU # 87**  
**LEA COUNTY, NM**  
**API # 30-025-30084**

12-14-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT CLEAR LOCATION TO ACCEPT EQUIPMENT RU  
ROD TONGS PU ON RODS UN-SEAT PUMP POOH W/ 100 RODS CWI SDON

12-15-21

HOLD SFTY MTG & JSA POOH W/ REMAING RODS TOTAL OF 137 RODS PU ON TBJ UN-  
SET TAC CIRC WELL W/ MLF POOH W/ TBJ TOTAL OF 120 JNTS MIRU WL RIH W/ WL  
SET CIBP @ 3487' POOH W/ WL RIH W/ BAILER & DUMP BAIL 35' CMT RIH W/ WL SET CIBP  
@ 2760' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ WL SET CIBP  
@ 1320' CWI SDON

12-16-21

HOLD SFTY MTG & JSA RU WL RIH W/ WL PERF @ 520' POOH W/ WL RD RELEASE WL  
RIH W/ TBJ TO 520' RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500#  
MIX & SPOT 55 SXS CLASS "C" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG  
DOWN ALL EQUIPMENT READY TO MOVE

**WDQSU # 85**  
**LEA COUNTY, NM**  
**API # 30-025-30008**

12-16-21

HOLD SFTY MTG & JSA MIRU ALL EQUIPMENT PU ON TBJ UN-SET PKR CIRC WELL W/ MLF  
POOH W/ TBJ TOTAL OF 120 CWI SDON

12-17-21

HOLD SFTY MTG & JSA      MIRU WL   RIH W/ WL   SET CIBP @ 3612'   POOH W/ WL   RIH W/  
BAILER & DUMP BAIL 35' CMT   RIH W/ WL   SET CIBP @ 2760'   POOH W/ WL   RIH W/ WL  
DUMP BAIL 35' CMT   POOH W/ WL   RIH W/ WL   SET CIBP @ 1320'   CWI   SDON  
RU WL   RIH W/ WL   PERF @ 520'   POOH W/ WL   RD RELEASE WL   RIH W/ TBJ TO 520'  
RU PUMP   EIR (ESTABLISH INJECTION RATE)   NO INJECTION RATE @ 500#   MIX & SPOT 55 SXS  
CLASS "C" CMT @ 520' TO SURF   WASH UP CMT EQUIP   POOH W/ TBJ   RIG DOWN ALL  
EQUIPMENT   READY TO MOVE

**WDQSU # 35**  
**LEA COUNTY, NM**  
**API # 30-025-12289**

12-18-21

HOLD SFTY MTG & JSA   MIRU ALL EQUIPMENT   ND HEAD   PU ON TBJ   UN-SET PKR   CIRC  
WELL W/ MLF   POOH W/ 115 JNTS TBJ   MIRU WL   RIH W/ WL   SET CIBP @ 3612'   POOH  
W/ WL   RIH W/ BAILER & DUMP BAIL 35' CMT   RIH W/ WL   SET CIBP @ 2760'   POOH W/ WL  
RIH W/ WL   DUMP BAIL 35' CMT   POOH W/ WL   RIH W/ WL   SET CIBP @ 1320'  
RU WL   RIH W/ WL   PERF @ 520'   POOH W/ WL   RD RELEASE WL   CWI   SDON

12-20-21

HOLD JSA & SFTY MTG   RIH W/ TBJ TO 520'   RU PUMP   EIR (ESTABLISH INJECTION RATE)   NO  
INJECTION RATE @ 500#   MIX & SPOT 40 SXS CLASS "C" CMT @ 520' TO SURF   WASH UP CMT  
EQUIP   POOH W/ TBJ   RIG DOWN ALL EQUIPMENT   CUT & COVER HEAD

**END OF PLUGGING OPERATIONS ON THE WEST DOLLARHIDE QUEEN SANDS UNIT**

**WELLBORE DIAGRAM  
WEST DOLLARHIDE QUEEN SAND UNIT #106**

**PROPOSED**

Created:	04/15/21	By:		Well #:	106
Updated:		By:		API	30-025-30157
Lease:	WEST DOOLARHIDE QUEEN SAND UNIT			Unit Ltr.:	C
Field:	QUEEN			Sec.	30
Surf. Loc.:	1470 FWL & 90 FNL			TSHR/Rng:	T:24S R:38E
Bot. Loc.:				Pool Code:	OGRID: 309777
County:	LEA	St.:	NM	Directions:	
Status:					


**Surface Casing**

Size:	8-5/8"
Wt., Grd.:	24#
Depth:	410'
Sxs Cmt:	250
Circulate:	yes
TOC:	surface
Hole Size:	12-1/4"

FORMATION TOPS	
T.Salt	1290'
B. Salt	2610'

**Intermediate Casing**

Size:	5-1/2"
Wt., Grd.:	15.5#/17#
Depth:	4070'
Sxs Cmt:	1000
Circulate:	yes
TOC:	surface
Hole Size:	7-7/8"

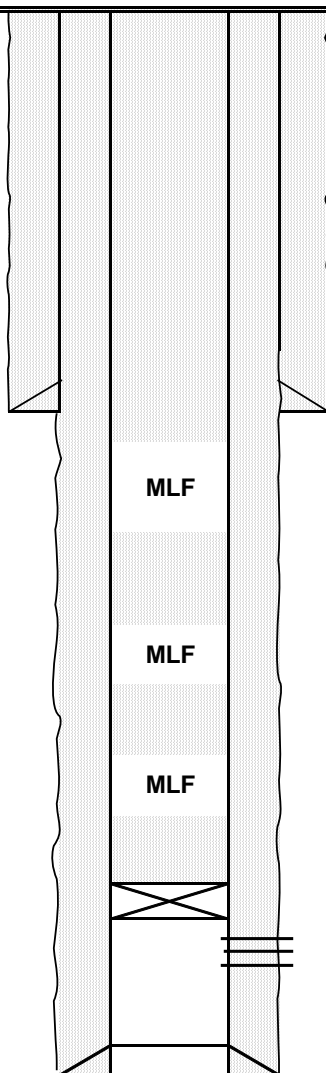

**SPOT 55SX OF CMT FROM 460'-SURFACE.  
VERIFY. (FW/SHOE/SURFACE)**

**SPOT 25SX OF CMT FROM 1340'-1190'.  
WOC&TAG. (T.SALT)**

**SPOT 40SX OF CMT FROM 2785'-2510'.  
WOC&TAG. (YATES/B.SALT)  
SET CIBP@3650' AND SPOT 25SX ON TOP  
FROM 3650'-3450'.(PERFS)**

**Queen: 3738'-3808'(OA)**

**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720

**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720

**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico  
Energy, Minerals and Natural Resources  
Oil Conservation Division  
1220 S. St Francis Dr.  
Santa Fe, NM 87505

CONDITIONS

Action 71647

CONDITIONS

Operator: RAM ENERGY LLC 5100 East Skelly Drive Tulsa, OK 74135	OGRID: 309777
	Action Number: 71647
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
kfortner	None	2/3/2022