
	To Appropriate District	:55 AM	State of New M	lexico		F	orm C-1031
Office <u>District I</u> – (575	5) 393-6161	Energy, N	Minerals and Nat	tural Resources			l July 18, 2013
	Dr., Hobbs, NM 88240				WELL API NO. 30-025-02605		
District II – (57 811 S. First St.,	Artesia, NM 88210	OIL CO	NSERVATIO	SERVATION DIVISION		e of Lease	
<u>District III</u> – (505) 334-6178			20 South St. Fra	South St. Francis Dr.		FEE	
	1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460 Santa Fe, NM 87505			37505	STATE 6. State Oil & C		
1220 S. St. Fran 87505	ncis Dr., Santa Fe, NM				014961		
87303	SUNDRY NO	OTICES AND REP	ORTS ON WELL	S	7. Lease Name	or Unit Agreer	nent Name
	THIS FORM FOR PRO ESERVOIR. USE "API	PPOSALS TO DRILL OF PLICATION FOR PERM	R TO DEEPEN OR P	LUG BACK TO A	STATE AA		
/	Well: Oil Well	Gas Well 🔽	Other		8. Well Number	<sup>r</sup> 1	
2. Name of					9. OGRID Num 372098	iber	
3. Address of	of Operator				10. Pool name o	or Wildcat	
990 Town & 0	Country Blvd., Hous	ton TX, 77024			SWD; YATES		
4. Well Loc	I	660	EAS	 ST	1980	SOI	UTH
	t Letter	_:feet 1	from the	line and	feet fr	om the	line
Sec	tion 35			Range 34E	NMPM	County	LEA
		11. Elevation	*	R, RKB, RT, GR, etc 9' GR	2.)		
	12. Check	k Appropriate B	ox to Indicate	Nature of Notice	, Report or Othe	r Data	
	NOTICE OF	INTENTION	0				_
DEDEODM	NOTICE OF REMEDIAL WORK	INTENTION TO PLUG AND A		REMEDIAL WO	BSEQUENT RE	ALTERING (	
		☐ CHANGE PLA			RILLING OPNS.	P AND A	
	TER CASING	☐ MULTIPLE CO	<del></del>	CASING/CEME		. , , .	
DOWNHOLE	E COMMINGLE [		_				
	OP SYSTEM		_				
OTHER:		1-4-14:	(Cll 1)	OTHER:	nd give pertinent da	4 :11:	
					nd give pertinent da ompletions: Attach		
	osed completion or		Z 19.13.7.14 INM	ic. To Multiple e	ompletions. Attach	welloofe diagi	taili 01
1. UNSET	PACKER AND POOH	I WITH TBG.					
2. RIH CIE	3,750° AND SET @	· .	001 14400 AND TAO	04445			
		CMT F/3,750' – T/3,50 CMT F/1,350' – T/1,10					
		CMT F/300' – T/Surfa					
USE MLF	BETWEEN ALL PLUC	3S					
CLOSED	LOOP ALL FLUIDS TO	O LICENSED FACILIT	Y INSTALL ABOVE	GROUND DRY HOLE	MARKER		
4" DIA 4	יי ' Tall above ground ו	marker	9	See attached condition	ons of approval		
7 017 7	r tan above ground i	Harker			от арриота.		
Spud Date:	10/07/	1956	Rig Release I	Date:			
_			_				
I hereby certif	fy that the informati	on above is true and	d complete to the	best of my knowled	ge and belief.		
			Dogu	oton, Compliance F	) anno antativo	7/40/202	2
SIGNATURE			TITLE	TITLE Regulatory Compliance Representative DATE 7/18/2022			
Type or print	Adrian Covar	rubias	F. mail addra	acovarrubias@ ss:	marathonoil.com p	HONE:	96-3368
Type or print: For State Use			E-man addre	33.	P	HONE.	
	-	14			2		
APPROVED	ВҮ: Уши	1 Forther _	TITLE	Compliance O	thier A D.	ATE 8/9/22	
Conditions of	Approval	ji			10-00		

Plug and Abandonment Procedure Marathon Oil Company

Permian Asset Team

# 2 Current and Proposed WBD

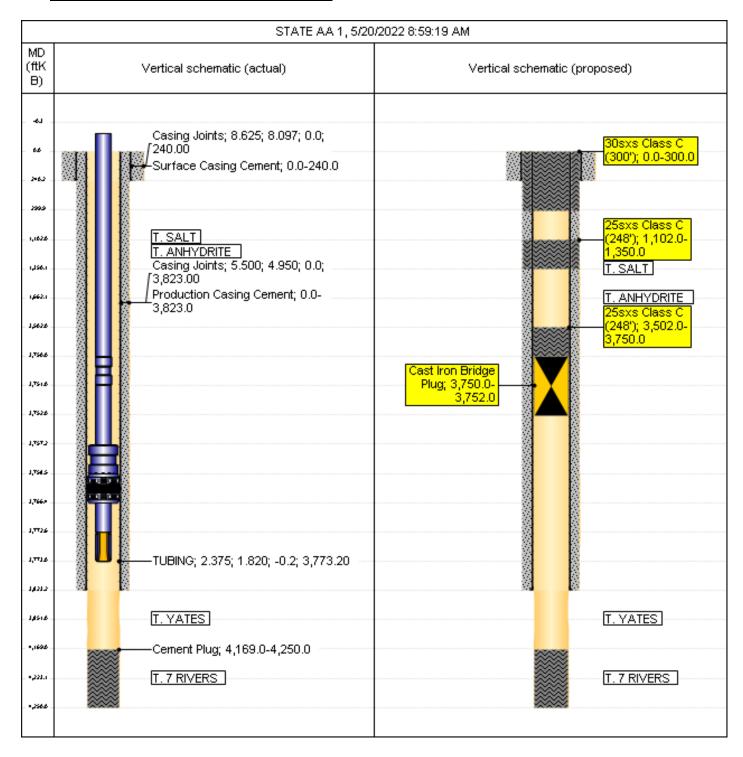

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

### Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

## DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

#### SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

#### SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

COMMENTS

Action 126120

#### **COMMENTS**

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	126120
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### COMMENTS

Created B	Comment	Comment Date
plmartir	DATA ENTRY PM	8/10/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 126120

#### **CONDITIONS**

Operator:	OGRID:
MARATHON OIL PERMIAN LLC	372098
990 Town & Country Blvd.	Action Number:
Houston, TX 77024	126120
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached COA	8/9/2022