	Sundry Print Repo
Well Location: T26S / R34E / SEC 7 / SESE /	County or Parish/State: LEA / NM
Type of Well: OIL WELL	Allottee or Tribe Name:
Unit or CA Name:	Unit or CA Number:
Well Status: Producing Oil Well	Operator: DEVON ENERGY PRODUCTION COMPANY LP
	SESE / Type of Well: OIL WELL Unit or CA Name:

Notice of Intent

Sundry ID: 2701300 Type of Submission: Notice of Intent Date Sundry Submitted: 11/03/2022 Date proposed operation will begin: 12/29/2022

Type of Action: Plug and Abandonment Time Sundry Submitted: 07:12

Procedure Description:

Approval Subject to General Requirements and Special Stipulations Attached

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

ICHABOD_7_FED_4_BLM_NOI_P_A_SIGNED_20221103071131.pdf

Received by OCD: 1 Well Name: iCf	17/2023 7:46:15 AM HABOD 7 FEDERAL	Well Location: T26S / R34E / SEC 7 / SESE /	County or Parish/State: LER 2 of 16
Well Number: 4	4H	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number	: NMNM114990	Unit or CA Name:	Unit or CA Number:
US Well Numb	er: 3002540574	Well Status: Producing Oil Well	Operator: DEVON ENERGY PRODUCTION COMPANY LP

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: JEFF YOUNG

Signed on: NOV 03, 2022 07:11 AM

Name: DEVON ENERGY PRODUCTION COMPANY LP

State: OK

State:

Title: Production Data Analyst

Street Address: 333 W SHERIDAN AVE

City: OKLAHOMA CITY

Phone: (405) 228-2480

Email address: JEFF.YOUNG@DVN.COM

Field

Representative Name: Street Address: City: Phone: Email address:

Zip:

	UNITED STATI EPARTMENT OF THE REAU OF LAND MAN	INTERIOR			C Exp 5 Lease Serial No	ORM APPROVED MB No. 1004-0137 oires: January 31, 2018 MNM114990
Do not use this	NOTICES AND REP form for proposals Use Form 3160-3 (A	to drill or to re	-enter an		6. If Indian, Allottee o	r Tribe Name
	NTRIPLICATE - Other instr	ructions on page 2			7. If Unit of CA/Agree	ement, Name and/or No.
I. Type of Well ↓ Oil Well Gas	Well Other					ICHABOD 7 FEDERAL 4
2. Name of Operator DEVON ENER	RGY PRODUCTION CO., L	P.			9. API Well No. 30-02	25-40574
3a. Address 333 W SHERIDAN AV CITY, OKLAHOMA 73	ENUE, OKLAHOMA	3b. Phone No. (incl. (405) 228-2480	ude area code	2)	10. Field and Pool or I SANDBAR(BONE	
4. Location of Well <i>(Footage, Sec., 7</i> 108' FSL 455' FEL, SEC 7 - T26)			11. Country or Parish, LEA COUNTY, NE	
12. CF	IECK THE APPROPRIATE B	OX(ES) TO INDICA	TE NATURI	OF NOTI	CE, REPORT OR OTH	HER DATA
TYPE OF SUBMISSION			TY	PE OF AC	ΓΙΟΝ	
Notice of Intent	Acidize Alter Casing Casing Repair Change Plans	Deepen Hydraulic New Cons Plug and A			uction (Start/Resume) amation omplete porarily Abandon	Water Shut-Off Well Integrity
Final Abandonment Notice	Convert to Injection	Plug Back	:	Wate	er Disposal	
completed. Final Abandonment N is ready for final inspection.) 1. MIRU P&A UNIT. TOOH 2 2 Set CIBP @ 8850' Tag. Cir 3. Spot 25 sx CI H cmt from 8 4. Spot 25 sx CI C cmt from 6 5. Perf @ 5350'. Sqz 68 sx C	otices must be filed only after 2-7/8" tubing and rods from a c 10# Salt gel. Leak test. 3850'-8761'. WOC & tag. (T 5540'-6290'. WOC & tag. (T Cl C from 5350'-5122'. WOC ware @ 5,298'; B Salt @ 52 Cl C from 3050'-2920'. WOC Cl C from 1050'-2920'. WOC Cl C from 1175' to 635'. (T C from 125' to surface.	all requirements, inc 8948'. 7. KOP @ 8900') (S 7. DV Tool @ 6487' 2 & tag. (In 23 sxs/C 298') 7. & tag. (In 13 sxs/O 7. Shoe @ 800'; T. F	luding reclan hoe)) Dut 45 sxs) ut 26 sxs) (3	otion, have	e been completed and the end of t	
Jeff Young		Title	Production	Techono	lgist	3
Signature		Date	. /	1-2	-22	
	THE SPACE	FOR FEDERA	L OR ST	ATE OF		
Approved by			1			
			Title		[I	Date
Conditions of approval, if any, are atta certify that the applicant holds legal or which would entitle the applicant to co	equitable title to those rights		Office			
Title 18 U.S.C Section 1001 and Title any false, fictitious or fraudulent stater				y and will	fully to make to any de	partment or agency of the United States

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTIIORITY: 30 U.S.C. 181 ct seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-4.


The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

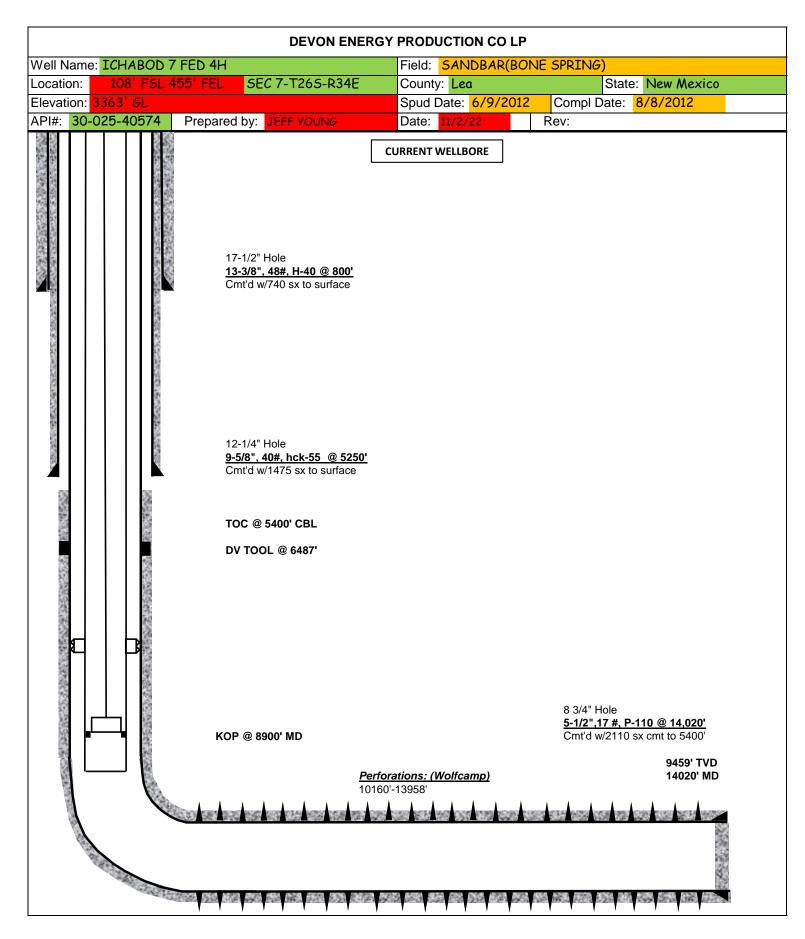

•

	DEVON ENER	GY PRODUCTION CO L	P
Well Name: ICHABOD 7 FE	ED 4H	Field: SANDBAR(B	ONE SPRING)
Location: 108' FSL 455	FEL SEC 7-T26S-R34E	County: Lea	State: New Mexico
Elevation: 3363' GL		Spud Date: 6/9/201	Compl Date: 8/8/2012
API#: 30-025-40574 P	repared by: JEFF YOUNG	Date: 11/2/22	Rev:
	PROPOSED WELLBORE	Proposed: 1. Perf @ 200' 2. Sqz 65 sx Cl C from 3. Cut WH off 3' BGL, S	
	17-1/2" Hole <u>13-3/8", 48#, H-40 @ 800'</u> Cmt'd w/740 sx to surface	Proposed: 1. Perf @ 1175' 2. Sqz 160 sx Cl C from (T. Shoe @ 800'; T. Rus Rustler @ 1122')	1175'-635''. stler@ 696'; T. Salt @ 1070'; B.
		Proposed: 1. Perf @ 2500' 2. Sqz 35 sx Cl C from 2	2500'-2380'. WOC & tag.
	12-1/4" Hole <u>9-5/8", 40#, hck-55 @ 5250'</u> Cmt'd w/1475 sx to surface		5300'-5150'. WOC & tag. Delaware @ 5,298';B. Salt @
	TOC @ 5400' CBL DV TOOL @ 6487'	Proposed: 1. Spot 25 sx Cl C from 6540 <i>(T. DV Tool @ 6487')</i>)'-6290'. WOC & tag.
			Approval Subject to
	Proposed: 1. Set CIBP @ 8850'. Tag. Circ 10# 2. Spot 25 sx Cl H from 8850'-865 (<i>T. KOP @ 8900'</i>)		General Requirements and Special Stipulations
	KOP @ 8900' MD		Attached 8 3/4" Hole <u>5-1/2",17 #, P-110 @ 14,020'</u> Cmt'd w/2110 sx cmt to 5400'
	<u>Per</u> 101	forations: (Wolfcamp) 60'-13958'	9459' TVD 14020' MD

•

Sundry ID	2701300					
	Ton	Bottom	Longth	Tog	Sacks	Notes
Plug Type	Тор	Бошот	Length	Tag	Sacks	Perf and squeeze at
						100' to surface.
						Verify at surface (In
Surface Plug	0.00			Tag/Verify	30.00	10 sxs/Out 20 sxs)
Shoe Plug	742.00	850.00	108.00	Tag/Verify		Dout and any area at
						Perf and squeeze at 1172' to 742'. (In 43
						sxs/Out 85 sxs)
Top of Salt @ 1122	1060.78	1172.00	111.22	Tag/Verify	128.00	WOC and Tag.
				If solid		
				base no		
				need to		
				Tag (CIBP		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak Test all		
				CIBP if no		Perf and squeeze at
				Open		3050' to 2920'. (In
				Perforatio		13 sxs/Out 26 sxs)
3000' between plugs @ 3000	2920.00	3050.00	130.00	ns	39.00	WOC and Tag.
Base of Salt @ 5225	5122.75			Tag/Verify		
Shoe Plug	5147.50	5300.00	152.50	Tag/Verify		
				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				present		
				and/or		
				Mechanic al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				, Tag, Leak		
				Test all		
				CIBP if no		Perf and squeeze
				Open		from 5348' to 5122'.
	E405.00	50.40.00	150.00	Perforatio	00.00	(In 23 sxs/Out 45
Delaware @ 5298	5195.02	5348.00	152.98	ns	68.00	sxs) WOC and Tag.

						On at a sure surt for sur
						Spot cement from
						6537' to 6372'.
DV tool plug	6372.13	6537.00		Tag/Verify	25.00	WOC and Tag.
KOP @ 8900	8761.00	8950.00		If solid		
Shoe Plug	8761.00	8950.00	189.00	Tag/Verify		
				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		Set CIBP at 8850'.
				Test all		Spot cement from
				CIBP if no		8850' to 8761'.
				Open		Class H. Leak test
				Perforatio		CIBP. WOC and
CIBP Plug	8815.00	8850.00	35.00		25.00	
						, , , , , , , , , , , , , , , , , , ,
Perforations Plug (If No CIBP)	10110.00	14008.00	3898.00	Tag/Verify		

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft³/sx Class H: 1.06 ft³/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Low		
Shoe @ Shoe @	800.00 5250.00		
Shoe @	8900.00	TOC @	5400.00
Perforatons Top @	10160.00	Perforations	13958.00
DV Tool @	6487.00	CIBP @	8850.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612 *Received by OCD: 1/17/2023 7:46:15 AM*

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	176517
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

CONNENTS		
Created By	Comment	Comment Date
john.harrison	Accepted for record - NMOCD JRH 3/22/23	3/22/2023

COMMENTS

Page 15 of 16

Action 176517

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	176517
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
john.harrison	None	3/22/2023

Action 176517