

Form 3160-5
(June 2015)UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
OMB No. 1004-0137
Expires: January 31, 2018**SUNDRY NOTICES AND REPORTS ON WELLS**
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.5. Lease Serial No. **NMNM-0177517**

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other2. Name of Operator **OXY USA INC.**3a. Address **PO BOX 4294
HOUSTON, TX 77210**3b. Phone No. (include area code)
(972) 404-3722

7. If Unit of CA/Agreement, Name and/or No.

NMNM-82050X8. Well Name and No. **CATO SAN ANDRES UNIT #129**9. API Well No. **30-005-20116**

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 FNL, 1980 FWL, UNIT C, SEC 23, T8S R30E10. Field and Pool or Exploratory Area
CATO; SAN ANDRES11. Country or Parish, State
CHAVES**12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION				
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off	
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity	
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other	
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon		
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal		

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that the site is ready for final inspection.)

PLEASE SEE ATTACHED FINAL WELLBORE DIAGRAM, AND FINAL PLUGGING REPORT.

Accepted for Record - contact Rick Flores at rflores@blm.gov for reclamation.

Accepted for record – NMOCD

JRH 05/04/2023

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)
SARAH MCKINNEYTitle **REGULATORY ANALYST SR**

Signature



Date

01/04/2023**THE SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

Title **Petroleum Engineer**Date **01/11/2023**

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office **RFO**

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

CASU 129

30-005-20116

Final PA Report: 11/23/22-12/02/22

11-23-22: Crew HTGSM. Road Rig & Personal to location. Spot in & R/U Pulling Unit. 0 PSI on TBG & CSG. Remove Polish Rod. L/D 4-7/8 Rods. Install Polish Rod. Close all Valves & Secure Location

11-28-22: Crew HTGSM. 0 PSI on TBG & CSG. Remove Polish Rod. L/D 93-7/8 Rods. Function Test BOPE. ND WH. Did not have correct screw on flange. NU WH. Spot in Cat Walk, Pipe racks & WS. R/U CMT pump truck. Close all valves. SION

11-29-22: Crew HTGSM. 0 PSI on TBG & CSG. Function Test BOPE. ND WH & NU BOPE. Pulled on TBG & Stuck. Attempted to work free & no luck. R/U Renegade Wireline. RIH w/ Free point tool. Tag up @ 3590. TBG 100% Free @ 3482'. POOH w/ WL. RIH w/ Chemical Cutter. Cut TBG @ 3482'. POOH w/ WL & RD. L/D 1 JT. Install TIW Valve. Close BOPE & Lock Pins. SION

12-01-22: Crew HTGSM. 0 PSI on TBG & CSG. Cont to P/U TBG. Tag CIBP @ 3478'. R/U CMT Pump Truck. Circulated well w/ 60 BBLs of BW @ 2 BPM @ 350 PSI. PSI Test CSG to 500 PSI & held good. Circulated well w/ 25 BBL's of 10# Salt Gel. Spot 6 BBLs (25 sxs) of Class C CMT & Displaced down to 3114'. L/D 89 Jt's of TBG. POOH w/ 22 JT's of TBG. RIH w/ AD1 PKR & 22 JTs of TBG. Set AD1 PKR @ 690'. R/U Key Wireline. RIH w/ Perf Gun. Tag TOC @ 3148'. Perforate CSG @ 1720'. POOH w/ WL & RD. R/U CMT pump truck. Est. Injection Rate @ 1.5 BPM @ 900 PSI. SITP 600 PSI. Pump 33.5 BBLs (140 sxs) of Class C CMT & Displaced w/ 10 BBL's of 1140'. SITP 600 PSI. Close all Valves. & Lock BOPE. SION

12-02-22: Crew HTGSM. 0 PSI on TBG & CSG. P/U 14 JT's of TBG. Tag Top of CMT @ 1131'. L/D WS TBG. R/U Key Wireline. RIH & Perf Gun. Perforate CSG @ 337'. POOH w/ WL & RD. R/U CMT Truck. Est Injection Rate @ 1.5 BPM @ 300 PSI w/ 10 BBL of FW ND BOPE & NU WH. Pump 32 BBLs (135 sxs) of Class C CMT & Circulated to surface. R/D Pulling Unit. R/D Remaining Plugging Equipment. Well is Plugged

Final Wellbore Diagram 1/4/2023

Cato San Andreas Unit # 129


API # 3000520116

Surf Lat 33.61067
Surf Long -103.85210

PERF@ 37'. SQZ 135 SX CL C CMT
337'-0'. (Circulate to Surface)

PERF@ 1720'. SQZ 140 SX CL C CMT
1720'-1131'. (TAG)

Top CIBP @ 3478' (TAG). 25 SX CL C
CMT 3478-3148' (TAG).

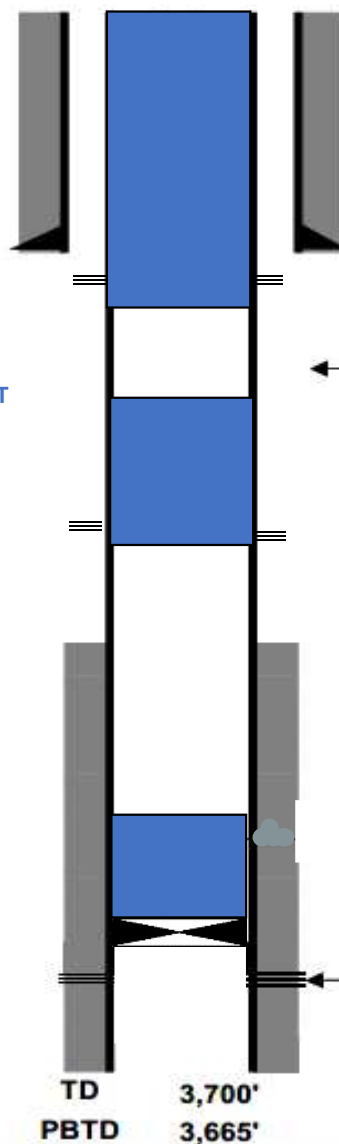

Surface Casing
12 1/4 in. hole @ 287 '
8 5/8 in. casing @ 287 '
w/ 250 sx cement TOC- Surf-Circ

Production Casir
7 7/8 in. hole @ 3700 '
4 1/2 in. casing @ 3700 '
w/ 300 sx cement TOC- 2,309 '

[10540] Cato; San Andreas Perfs
Top 3,528'
Bottom 3,570'

CASU 129

30-005-20116

Final PA Report: 11/23/22-12/02/22

11-23-22: Crew HTGSM. Road Rig & Personal to location. Spot in & R/U Pulling Unit. 0 PSI on TBG & CSG. Remove Polish Rod. L/D 4-7/8 Rods. Install Polish Rod. Close all Valves & Secure Location

11-28-22: Crew HTGSM. 0 PSI on TBG & CSG. Remove Polish Rod. L/D 93-7/8 Rods. Function Test BOPE. ND WH. Did not have correct screw on flange. NU WH. Spot in Cat Walk, Pipe racks & WS. R/U CMT pump truck. Close all valves. SION

11-29-22: Crew HTGSM. 0 PSI on TBG & CSG. Function Test BOPE. ND WH & NU BOPE. Pulled on TBG & Stuck. Attempted to work free & no luck. R/U Renegade Wireline. RIH w/ Free point tool. Tag up @ 3590. TBG 100% Free @ 3482'. POOH w/ WL. RIH w/ Chemical Cutter. Cut TBG @ 3482'. POOH w/ WL & RD. L/D 1 JT. Install TIW Valve. Close BOPE & Lock Pins. SION


12-01-22: Crew HTGSM. 0 PSI on TBG & CSG. Cont to P/U TBG. Tag CIBP @ 3478'. R/U CMT Pump Truck. Circulated well w/ 60 BBLs of BW @ 2 BPM @ 350 PSI. PSI Test CSG to 500 PSI & held good. Circulated well w/ 25 BBL's of 10# Salt Gel. Spot 6 BBLs (25 sxs) of Class C CMT & Displaced down to 3114'. L/D 89 Jt's of TBG. POOH w/ 22 JT's of TBG. RIH w/ AD1 PKR & 22 JTs of TBG. Set AD1 PKR @ 690'. R/U Key Wireline. RIH w/ Perf Gun. Tag TOC @ 3148'. Perforate CSG @ 1720'. POOH w/ WL & RD. R/U CMT pump truck. Est. Injection Rate @ 1.5 BPM @ 900 PSI. SITP 600 PSI. Pump 33.5 BBLs (140 sxs) of Class C CMT & Displaced w/ 10 BBL's of 1140'. SITP 600 PSI. Close all Valves. & Lock BOPE. SION

12-02-22: Crew HTGSM. 0 PSI on TBG & CSG. P/U 14 JT's of TBG. Tag Top of CMT @ 1131'. L/D WS TBG. R/U Key Wireline. RIH & Perf Gun. Perforate CSG @ 337'. POOH w/ WL & RD. R/U CMT Truck. Est Injection Rate @ 1.5 BPM @ 300 PSI w/ 10 BBL of FW ND BOPE & NU WH. Pump 32 BBLs (135 sxs) of Class C CMT & Circulated to surface. R/D Pulling Unit. R/D Remaining Plugging Equipment. Well is Plugged

Final Wellbore Diagram 1/4/2023

Cato San Andreas Unit # 129

API # 3000520116

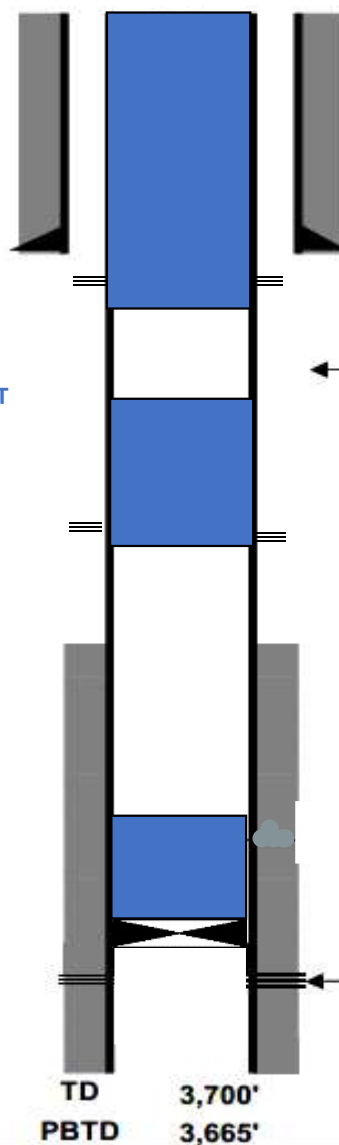Surf Lat 33.61067
Surf Long -103.85210PERF@ 37'. SQZ 135 SX CL C CMT
337'-0'. (Circulate to Surface)PERF@ 1720'. SQZ 140 SX CL C CMT
1720'-1131'. (TAG)Top CIBP @ 3478' (TAG). 25 SX CL C
CMT 3478-3148' (TAG).Surface Casing
12 1/4 in. hole @ 287 '
8 5/8 in. casing @ 287 '
w/ 250 sx cement TOC- Surf-CircProduction Casir
7 7/8 in. hole @ 3700 '
4 1/2 in. casing @ 3700 '
w/ 300 sx cement TOC- 2,309 '[10540] Cato; San Andreas Perfs
Top 3,528'
Bottom 3,570'

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 177471

CONDITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 177471
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
john.harrison	None	5/4/2023