

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: JICARILLA BR C Well Location: T25N / R4W / SEC 15 / County or Parish/State: RIO

SWSW / 36.395194 / -107.245801 ARRIBA / NM

Well Number: 2 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL JICARILLA APACHE

Lease Number: JIC65 Unit or CA Name: Unit or CA Number:

US Well Number: 3003905981 Well Status: Producing Gas Well Operator: HILCORP ENERGY

COMPANY

Notice of Intent

Sundry ID: 2729485

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 05/08/2023 Time Sundry Submitted: 07:17

Date proposed operation will begin: 05/22/2023

Procedure Description: Hilcorp Energy Company requests permission to P&A the subject well per the attached procedures, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 4/26/2023 with Jicarilla/BIA. The Re-Vegetation Plan is attached. A closed loop system will be used. Jicarilla has requested that a surface plate be used for the P&A marker for this location. Please see attached letter.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Jicarilla_BR_C_2_P_A_NOI_20230515113240.pdf

Accepted for record – NMOCD

JRH 05/23/23

eived by OCD: 5/17/2023 7:20:30 AM Well Name: JiCARILLA BR C

Well Location: T25N / R4W / SEC 15 /

SWSW / 36.395194 / -107.245801

County or Parish/State: Rige 2 of

ARRIBA / NM

Well Number: 2

Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name: JICARILLA APACHE

Lease Number: JIC65

Unit or CA Name:

Unit or CA Number:

US Well Number: 3003905981

Well Status: Producing Gas Well

Operator: HILCORP ENERGY

COMPANY

Conditions of Approval

Additional

25N04W15MKpc_Jicarilla_BR_C_002_20230515165347.pdf

2729485_NOIA_BR_C_1_3003905981_KR_05152023_20230515170603.pdf

General_Requirement_PxA_20230515170542.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: KANDIS ROLAND Signed on: MAY 15, 2023 11:32 AM

Name: HILCORP ENERGY COMPANY

Title: Operation Regulatory Tech Street Address: 382 Road 3100

City: Farmington State: NM

Phone: (505) 599-3400

Email address: kroland@hilcorp.com

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

BLM POC Phone: 5055647742

Disposition: Approved

Signature: Kenneth Rennick

BLM POC Title: Petroleum Engineer

BLM POC Email Address: krennick@blm.gov

Disposition Date: 05/15/2023




HILCORP ENERGY COMPANY Jicarilla BR C 2 NOTICE OF INTENT TO PERMANENTLY ABANDON

API #: 3003905981

		JOB PROCEDURES
7	NMOCD Jicarilla	Contact OCD and Jicarilla 2 weeks prior to MIRU (Need PTPW from Jicarilla). Comply with all NMOCD, Jicarilla and HEC safety and environmental regulations.
1.	MIRU service riç	g and associated equipment, record all pressures on wellbore.
2.	Load well, ND tr	ree, NU BOPs and test.
3.	POOH w/ 1" (1.3	315" OD) production tubing, LD.
4.	MU 5-1/2" 15.5#	# GR, clear csg to 3,440', POOH. RIH w/ 5-1/2" 15.5# CICR on pipe and set @ 3,426' (PC Top Perf @ 3,476').
5.		nhibited brine & circulate clean. Pressure test the csg to 560 psi. Monitor for 30 minutes. Run CBL from 3,426' to surface. ing plug designs are subject to change pending CBL results.
6.	cement and spo	' - 3,426' (CIBP @ 3,426' PC Top: 3,455', FRD Top: 3,276', KRD Top: 3,100', Ojo Top: 3,900') Pump 62sx (15.1bbl) Class III "Select" of a 626' inside plug over the CIBP to cover all tops. lit & NMOCD/BLM will be notified if BH pressure is present.
7.	RU ELU, RIH pe	erf circ holes in 5-1/2" csg @ 183'. Establish circulation up 9-5/8" annulus.
8.	Plug #2 11' - 1 shoe.	183' (Surface Shoe @ 133') Pump 52sx (12.7bbl) Class III "Select" cement and circulate in a 172' inside/outside plug over the surface
9.	LD tubing. ND B	BOP and cut off wellhead below surface casing flange as per NMOCD. Top off cement at surface as needed. Weld new P&A maker.




HILCORP ENERGY COMPANY Jicarilla BR C 2 NOTICE OF INTENT TO PERMANENTLY ABANDON

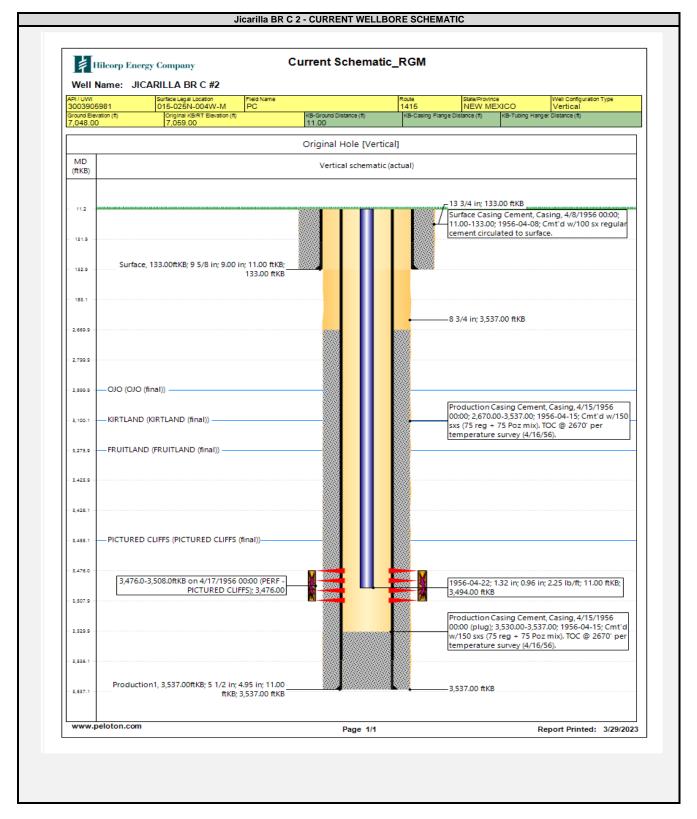



HILCORP ENERGY COMPANY Jicarilla BR C 2 NOTICE OF INTENT TO PERMANENTLY ABANDON

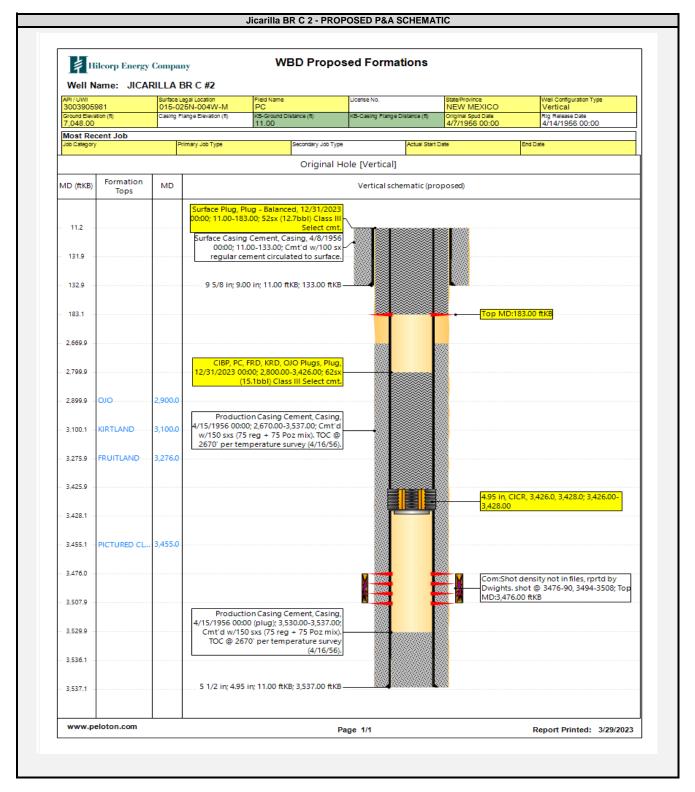



United States Department of the Interior

BUREAU OF INDIAN AFFAIRS Jicarilla Agency P.O. Box 167

Dulce, New Mexico 87528

Branch of Real Estate Services

November 15, 2019

Memorandum

To:

Robert Switzer, Environmental Protection Specialist

Bureau of Land Management, Farmington Field Office

From:

Kurt Sandoval, Realty Officer

Bureau of Indian Affairs, Jicarilla Agency

Subject:

BIA Concurrence concerning Well Pad Monument Makers

Let this serve as concurrence for the agreed upon preferred method to be used when constructing well pad monument markers on Jicarilla Apache Tribal Lands. We will eliminate the 6 ft. dry hole marker and use a permanent metal plate that will be installed at ground level, effective September 2019. The marker will contain the following information:

- Well Pad Lease Number
- Well Pad Location Name and Number
- Well Pad Legal Description, specifically Section, Township and Range
- Well Pad API Number
- Well Pad Plug Date
- Well Pad Operator Name

You may contact our office if you have any questions or concerns at (575) 759-3936. Thank you.

Realty Officer

cc:

Jicarilla Oil and Gas Administration

Hilcorp Energy

Jicarilla BR C 2

36.394663, -107.245416


API-30-039-05981


Jicarilla Lease #64

Final Reclamation Plan

Onsite 4/26/2023 with Kurt Sandoval, Alfred Vigil, Jason Sandoval, Orlando Muniz, Donna Montoya.

- 1. Pick up and remove all trash, metal, cable, and any foreign debris within 200' of location.
- 2. Remove anchors.
- 3. Strip equipment off facility and line drip.
- 4. Enterprise to remove meter run and piping back to dog leg.
- 5. Reclaim location, pushing material back to north, leaving rolling terrain. Build silt trap on west side of location.
- 6. Mulch and seed hill on south side of location.
- 7. Set surface wellhead marker plate.
- 8. Mulch sides of road and reclaim roads back to the main road.
- 9. Install woven wire and T-Post fence at end of both roads at main road.
- 10. Rip compacted soil.
- 11. Re-seed all disturbed areas. Drill where applicable at rate per acre defined by seed mix, and broadcast seed and harrow, at double the rate, all other disturbed areas. South Mix seed mix will be used.

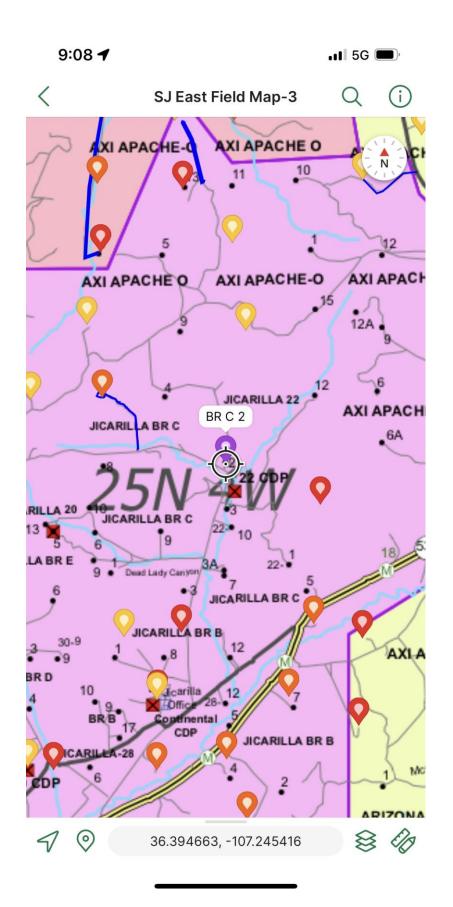

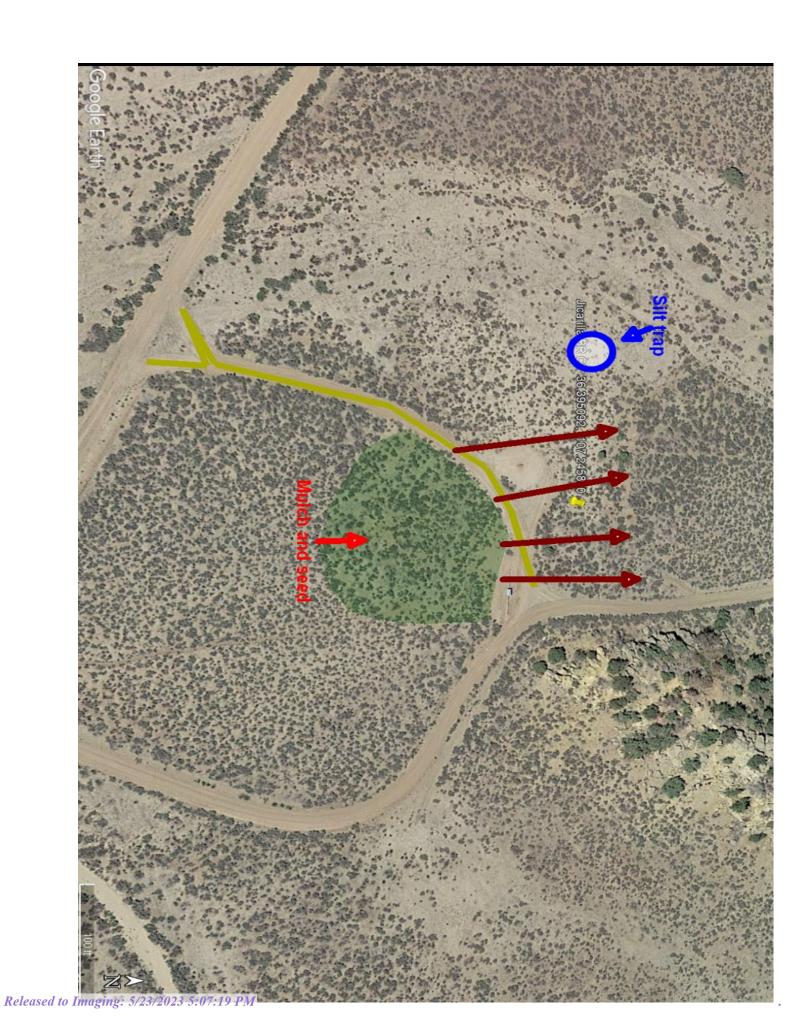

BLM FLUID MINERALS P&A Geologic Report

Date Completed: 5/15/2023

Well No. Jicarilla BR C #002 (API#	Location	990	FSL	&	835	FWL
Lease No. JIC65	Sec. 15	T25N			R04W	
Operator Hilcorp Energy Company	County	Rio Arriba		State	New Mexico	
Total Depth 3537' PBTD 3530' Formation Pictured Cliffs						
AFMSS Sundry ID: 2729485	Elevation (KE	3) 7059'				

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose			Surface		Surface/possible freshwater sands
Nacimiento				2900	Probable water
Ojo Alamo Ss			2900	3108	Aquifer (possible freshwater)
Kirtland Shale			3108	3276	Possible gas
Fruitland			3276	3455	Coal/Gas/Water
Pictured Cliffs Ss			3455	PBTD	Probable Gas
Lewis Shale					
Chacra (lower)					
Cliff House Ss					
Menefee					
Point Lookout Ss					
Mancos Shale					
Gallup					
Greenhorn					
Graneros Shale					
Dakota Ss					
Morrison					

Remarks:

P & A

- Pictured Cliffs perfs 3476' – 3508'.

Reference Well:
1) Formation Tops

Same

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2729485

Attachment to notice of Intention to Abandon

Well: Jicarilla BR C 2

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 5/15/2023

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), through the Automated Fluid Minerals Support System (AFMSS) with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 217543

COMMENTS

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	217543
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created	d By	Comment	Comment Date
john.h	harrison	Accepted for record - NMOCD JRH 5/23/23. BLM approved P&A 5/15/23	5/23/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 217543

CONDITIONS

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	217543
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
john.harrisc	n None	5/23/2023