District I 1625 N. French Dr., Hobbs, NM 88240

Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

Date:

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

.

Form C-101 August 1, 2011 Permit 375539

APPLICATION FOR PERMIT TO DRILL, RE-ENTER, DEEPEN, PLUGBACK, OR ADD A ZONE

	ame and Address rmian Resources C	parating LLC							2. OGRIE	O Number 372165		
	0 N. Marienfeld St S								3. API Nu			
	dland, TX 79701								3. API NU	30-015-5570	6	
4. Property Co			5. Property Name						6. Well N		0	
	5408	OM				6. Well N	132H					
	5400		TREDC	TATE C						15211		
					7. Sur	face Location						
UL - Lot	Section	Township	Range		Lot Idn	Feet From	N/S Line	Feet From		E/W Line	County	
E	33	215	6	27E		2299	N	11	172	W	Eddy	
					8. Proposed I	Bottom Hole Loca	tion					
UL - Lot	Section	Township	Range		Lot Idn	Feet From	N/S Line	Feet From		E/W Line	County	
E	36	215		26E	E	2310	N		100	W	Eddy	
			•		9 Po	ol Information						
CEDAR HILI	LS;BONE SPRING				<i>a</i> . F0					11560		
44 M 1 T		10 M # T		10.0		I Well Information		1.5	0 11			
11. Work Type	w Well	12. Well Type Oll		13. 0	Cable/Rotary		14. Lease Type State	15.		vel Elevation		
16. Multiple		17. Proposed		10 0	ormation					3122 Spud Date		
N			583	10. 1	Bone Sprin	a	19. Contractor	20.		2025		
Depth to Grou	ind water			Dista	ince from nearest from	0		Dist		rest surface wate	r	
•												
🛛 We will be	using a closed-loo	p system in lie	u of lined pits									
				2	1 Proposed Cas	sing and Cement	Program					
Туре	Hole Size	Casing	Size		ing Weight/ft	Setting		Sacks of	Cement	1	Estimated TOC	
Surf	17.5	13.3			54.5	30		24			0	
Int1	12.25	10.7		45.5		79		14			0	
Int2	9.875	8.62	5		32	26	2620		200		0	
Prod	7.875	5.5			20	245	24583		2660		2120	
		-		Coo	ing/Comont Bro	gram: Additional	Commonto					
				Cas	ang/Cement Pro	gram. Additional	Johnnents					
	Туре				2. Proposed Blo ng Pressure	wout Prevention	Program Test Press			Man	ufacturer	
	Double Ram				5000		5000		Manufacturer			
	Double Raili				5000		5000					
22 Lbereby	certify that the infor	mation given ab	ove is true and c	omplete	to the best of m	V		OIL CONSER				
knowledge a		mation given ab		ompiete	to the best of m	у				VISION		
	tify I have complie	d with 19.15.14.	9 (A) NMAC 🖂	and/or 1	9.15.14.9 (B) NM	IAC						
X, if applica					•••••• (_)							
Signature:												
Printed Name:	: Electronical	lly filed by Steph	nanie Rabadue			Approved By:	Ward Rika	а				
Title:	Regulatory	Manager				Title:	Petroleum	Specialist Su	pervisor			
Email Address	° ,	abadue@perm	ianres.com			Approved Date	Approved Date: 11/11/2024 Expiration Date: 11/11/2026				11/2026	

Conditions of Approval Attached

10/22/2024

Phone: 432-260-4388

Received by OCD: 10/22/2024 9:17:30 AM


Submit Electronically OIL CONSERVAT						ural Resources Department			Revised July 9, 2024	
Via OCD Permitting							Submittal			
							Type:		•	
									□ As Drille	ed
			i			ON INFORMATION				
	umber 30-015-	55706	Pool Code	11560		Pool Name Wildca	it; Bone S	SpringCe	dar Hills	; Bone Sprir
Proper	ty Code 335408	00100	Property N			STATE COM			Well Numb	
OGRIE		5	Operator			RCES OPERATING			Ground Lev	vel Elevation 3,122'
		ner: 🗆 State	I NorFee □ 1				vner: 🗹 State	e 🖌 Fee 🗆	I] Tribal 🗌 Fe	,
										Sucrai
					-	ce Location	_			
UL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W	Latitude	Lc	ongitude	County
Е	33	21 S	27 E		2,299' FNL	1,172' FWL	32.4373	303 -1	04.199696	EDDY
				-	Bottom	Hole Location		• •		
JL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W	Latitude	Lc	ongitude	County
Е	36	21 S	26 E		2,310' FNL	100' FWL	32.437	311 -10	04.254176	EDDY
					•					1
Dedicated AcresInfill or Defining WellDefining Well API481.28Infill					Overlapping Spacing Unit (Y/N) Consolidation Code					
Order Numbers.				Well setbacks are	under Comm	on Ownersh	ip: □Yes □I	No		
		Taurahin	Dener	1		ff Point (KOP)	1			County
JL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W	Latitude		ongitude	County
E	33	21 S	27 E		2,299' FNL	1,172' FWL	32.4373	303 -1	04.199696	EDDY
			t	-	1	ke Point (FTP)				
JL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W	Latitude		ongitude	County
Н	32	21 S	27 E		2,310' FNL	100' FEL	32.437235 -		04.203817	EDDY
					Last Ta	ke Point (LTP)				
JL	Section	Township	Range	Lot	Ft. from N/S	Ft. from E/W	Latitude		ongitude	County
Е	36	21 S	26 E		2,310' FNL	100' FWL	32.4373	311 -10	04.254176	EDDY
Jnitize	d Area or A	rea of Uniform	n Interest	Spacing	g Unit Type 🗆 Ho	rizontal 🗆 Vertical	Grou	nd Floor Ele	vation:	
)PER	ATOR CER	TIFICATIONS				SURVEYOR CERTIF	ICATIONS			
best of hat this n the la vell at t unlease	my knowledge organization and including t his location p d mineral int	e and belief, and either owns a v the proposed bo ursuant to a cor	d, if the well is working interes ottom hole loca ntract with an luntary poolin	a vertical of st or unleas ation or has owner of a v	d complete to the r directional well, ed mineral interest a right to drill this working interest or to r a compulsory	I hereby certify that the v actual surveys made by correct to the best of my	me or under m belief.	wn on this pl y superwision	at was plotted and that the s P	from field notes of ame is true and
If this well is a horizontal well, I further certify that this organization has received the consent of at least one lessee or owner of a working interest or unleased mineral interest in each tract (in the target pool or formation) in which any part of the well's completed interval will be located or obtained a compulsory pooling order from the division.					12 Hand				024	
Signatu		ie Wang	_	Date 10/15/	24	Signature and Seal of P	rofessional Sur	veyor		
Printed						Certificate Number	Date of Surv	vey		
Printed Name Cassie Evans								/21/2024		
Ca					12177			21/2024		

Note: No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division. **Released to Imaging: 11/11/2024 9:37:26 AM**

Received by OCD: 10/22/2024 9:17:30 AM ACREAGE DEDICATION PLATS

This grid represents a standard section. You may superimpose a non-standard section, or larger area, over this grid. Operators must outline the dedicated acreage in a red box, clearly show the well surface location and bottom hole location, if it is directionally drilled, with the dimensions from the section lines in the cardinal directions. If this is a horizontal wellbore show on this plat the location of the First Take Point and Last Take Point, and the point within the Completed interval (other than the First Take Point or Last Take Point) that is closest to any outer boundary of the tract.

Surveyors shall use the latest United States government survey or dependent resurvey. Well locations will be in reference to the New Mexico Principal Meridian. If the land is not surveyed, contact the OCD Engineering Bureau. Independent subdivision surveys will not be acceptable.

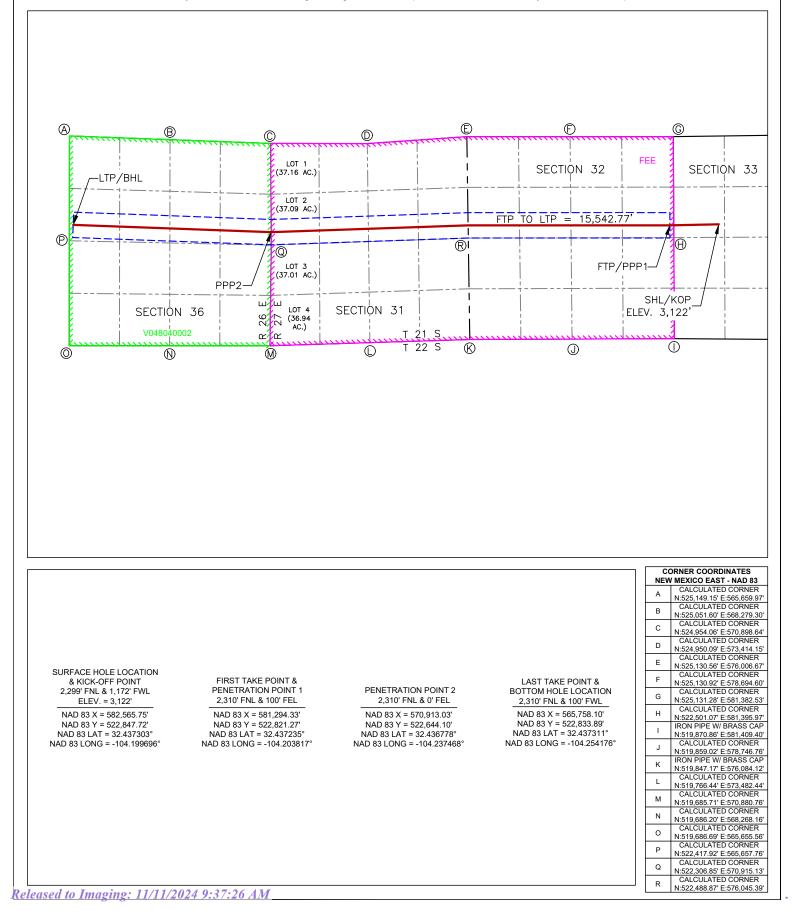

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico **Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

PERMIT CONDITIONS OF APPROVAL

Operator Nan	ne and Address:	API Number:						
Pe	ermian Resources Operating, LLC [372165]	30-015-55706						
30	0 N. Marienfeld St Ste 1000	Well:						
Mi	dland, TX 79701	FRED STATE COM #132H						
OCD	Condition							
Reviewer								
ward.rikala	rard.rikala Notify the OCD 24 hours prior to casing & cement.							
ward.rikala	I.rikala File As Drilled C-102 and a directional Survey with C-104 completion packet.							
ward.rikala	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, th fresh water zone or zones and shall immediately set in cement the water protection string.	e operator shall drill without interruption through the						
ward.rikala	Cement is required to circulate on both surface and intermediate1 strings of casing.							
ward.rikala	I rikala If cement does not circulate on any string, a Cement Bond Log (CBL) is required for that string of casing.							
ward.rikala	1.rikala Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud,							
	drilling fluids and solids must be contained in a steel closed loop system.							
ward.rikala	ard.rikala A [C-103] Sub. Drilling (C-103N) is required within (10) days of spud.							

ward.rikata This well is within the Capitan Reef. The 1st intermediate string shall be sat and cemented back to surface immediately above the top of the Capitan Reef. The 2nd intermediate string shall be sat and cemented back to surface immediately below the base of the Capitan Reef.

Form APD Conditions

Permit 375539

Page 4 of 84

Re	ceived by	• OCD :	10/22/2024 9:17:	:30 AM
----	-----------	----------------	------------------	--------

	E	nergy, Minerals a Oil Co 1220 S	e of New Me nd Natural Res onservation D South St. Fran ta Fe, NM 87	sources Departm ivision cis Dr.	ent Vi	bmit Electronically a E-permitting					
NATURAL GAS MANAGEMENT PLAN This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.											
			<u>1 – Plan D</u> ffective May 25								
I. Operator: <u>Permia</u>	n Resources O	perating, LLC	OGI	RID: <u>372165</u>	Da	te: <u>05/10/2024</u>					
If Other, please describe III. Well(s): Provide the	 II. Type: ☐ Original ☐ Amendment due to ☐ 19.15.27.9.D(6)(a) NMAC ☐ 19.15.27.9.D(6)(b) NMAC ☐ Other. If Other, please describe:										
Well Name		_		Anticip Oil BE Oil BE Diameter	SL/D Gas MCF/D	Anticipated Produced Water BBL/D					
V. Anticipated Schedul proposed to be recomple Well Name											
			Date	Commencemen		Date					

TBD

TBD

TBD

TBD

TBD

TBD

TBD

TBD

8/5/24

8/5/24

Barney 223H Barney 423H

.

TBD

TBD

Fred State Com 111H	TBD	7/3/25	<u>TBD</u>	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 112H	TBD	7/3/25	<u>TBD</u>	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 113H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 114H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 121H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 122H	TBD	7/3/25	TBD	<u>TBD</u>	TBD	TBD
Fred State Com 123H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 124H	TBD	7/3/25	<u>TBD</u>	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 131H	TBD	7/3/25	TBD	<u>TBD</u>	TBD	TBD
Fred State Com 132H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 133H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 134H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 221H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 222H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 223H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 224H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD
Fred State Com 421H	TBD	7/3/25	<u>TBD</u>	<u>TBD</u>	<u>TBD</u>	<u>TBD</u>
Fred State Com 422H	TBD	7/3/25	<u>TBD</u>	<u>TBD</u>	TBD	TBD
Fred State Com 423H	TBD	7/3/25	<u>TBD</u>	<u>TBD</u>	TBD	TBD
Fred State Com 424H	TBD	7/3/25	TBD	<u>TBD</u>	<u>TBD</u>	TBD

VI. Separation Equipment: 🛛 Attach a complete description of how Operator will size separation equipment to optimize gas capture.

VII. Operational Practices: Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F of 19.15.27.8 NMAC.

VIII. Best Management Practices: Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.

Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

□ Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. \boxtimes Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural gas gathering system \Box will \boxtimes will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.

XIII. Line Pressure. Operator \boxtimes does \square does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).

Attach Operator's plan to manage production in response to the increased line pressure.

XIV. Confidentiality: \boxtimes Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

Section 3 - Certifications Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

 \Box Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or

 \boxtimes Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. *If Operator checks this box, Operator will select one of the following:*

Well Shut-In. 🛛 Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

Venting and Flaring Plan. \Box Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- (b) power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (f) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (h) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

(a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or

(b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.

2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Permian Resources Operating, LLC (372165)

Natural Gas Management Plan Descriptions

VI. Separation Equipment:

Permian utilizes a production forecast from our Reservoir Engineering team to appropriately size each permanent, 3-phase separator and heater treater utilized for production operations. Our goal is to maintain 5 minutes of retention time in the test vessel and 20 minutes in the heater treater at peak production rates. The gas produced is routed from the separator to the gas sales line.

VII. Operational Practices:

Drilling

During Permian's drilling operations it is uncommon for venting or flaring to occur. If flaring is needed due to safety concerns, gas will be routed to a flare and volumes will be estimated.

Flowback

During completion/recompletion flowback operations, after separation flowback begins and as soon as it is technically feasible, Permian routes gas though a permanent separator and the controlled facility where the gas is either sold or flared through a high-pressure flare if needed.

Production

Per 19.15.27.8.D, Permian's facilities are designed to minimize waste. Our produced gas will only be vented or flared in an emergency or malfunction situation, except as allowed for normal operations noted in 19.15.27.8.D(2) & (4). All gas that is flared is metered. All gas that may be vented will be estimated.

Performance Standards

Permian utilizes a production forecast from our Reservoir Engineering team to appropriately size each permanent, 3-phase separator and heater treater utilized for production operations.

All of Permian's permanent storage tanks associated with production operations which are routed to a flare or control device are equipped with an automatic gauging system.

All of Permian's flare stacks, both currently installed and for future installation, are:

- 1) Appropriately sized and designed to ensure proper combustion efficiency.
- 2) Equipped with an automatic ignitor or continuous pilot.
- 3) Anchored and located at least 100 feet from the well and storage tanks.

Permian's field operations and HSE teams have implemented an AVO inspection schedule that adheres to the requirements of 19.15.27.8.E(5).

All of our operations and facilities are designed to minimize waste. We routinely employ the following methods and practices:

- Closed-loop systems
- Enclosed and properly sized tanks

- Vapor recovery units to maximize recovery of low-pressure gas streams and potential unauthorized emissions
- Low-emitting or electric engines whenever practical
- Combustors and flare stacks in the event of a malfunction or emergency
- Routine facility inspections to identify leaking components, functioning control devices, such as flares and combustors, and repair / replacement of malfunctioning components where applicable

Measurement or estimation

Permian measures or estimates the volumes of natural gas vented, flared and/or beneficially used for all of our drilling, completing and producing wells. We utilize accepted industry standards and methodology which can be independently verified. Annual GOR testing is completed on our wells and will be submitted as required by the OCD. None of our equipment is designed to allow diversion around metering elements except during inspection, maintenance and repair operations.

VIII. Best Management Practices:

Permian utilizes the following BMPs to minimize venting during active and planned maintenance activities:

- Use a closed-loop process wherever possible during planned maintenance activities, such as blowdowns, liquid removal, and work over operations.
- Employ low-emitting or electric engines for equipment, such as compressors
- Adhere to a strict preventative maintenance program which includes routine facility inspections, identification of component malfunctions, and repairing or replacing components such as hatches, seals, valves, etc. where applicable
- Utilize vapor recovery units (VRU's) to maximize recovery of volumes of low-pressure gas streams and potential unauthorized emissions
- Route low pressure gas and emissions streams to a combustion device to prevent venting where necessary

NEW MEXICO

(SP) EDDY FRED PROJECT FRED STATE COM 132H

OWB

Plan: PWP0

Standard Planning Report - Geographic

03 September, 2024

Database: Company: Project: Site: Well: Wellbore: Design: Project	NE (SF FR OW PW		M 132H		TVD Refe MD Refe North Re			Well FRED ST KB @ 3152.0u KB @ 3152.0u Grid Minimum Curv	sft sft	32H
Map System: Geo Datum: Map Zone:	North	tate Plane 1983 American Datu Mexico Eastern	im 1983		System D	atum:	Μ	ean Sea Level		
Site	FRE	D PROJECT								
Site Position: From: Position Unce	N	1ap 0.0	North Easti usft Slot F	-	582,5	62.55 usft 666.25 usft 3-3/16 "	Latitude: Longitude:			32° 26' 17.407 N 104° 11' 58.894 W
Well	FRE	D STATE COM	132H							
Well Position Position Unce Grid Converg	+E/-\ ertainty	N 0	0.0 usft Ea	orthing: sting: ellhead Elev	vation:	522,847.72 582,565.75	usfi Lo	titude: ngitude: ound Level:		32° 26' 14.291 N 104° 11' 58.905 W 3,122.0 usft
Wellbore	OW	B								
Magnetics	N	lodel Name	Sample	e Date	Declina (°)			Angle °)		Strength าT)
		IGRF200510	12	2/31/2009		8.05		60.33	48,85	3.23229876
Design	PW	2 0								
Audit Notes: Version:			Phas	e. [PROTOTYPE	Tie	on Depth:		0.0	
Vertical Section	on:	D	epth From (T (usft)		+N/-S (usft)	+E (u:	:/-W sft)	Dire	ection (°)	
			0.0		0.0	0	0.0	26	9.95	
Plan Survey T Depth Fro (usft)	om De	pth To	9/3/2024 y (Wellbore)		Tool Name		Remarks			
1	0.0 2	4,582.8 PWP0	(OWB)		MWD OWSG_Rev	2_MWD - St	ar			
Plan Sections	•									
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)	TFO (°)	Target
0.0 1,000.0 1,318.5 8,344.5 9,041.5 19,424.3 19,581.0 24,582.8	0.00 0.00 6.3 90.00 90.00 90.00 90.00	0 0.00 7 268.70 7 268.70 0 269.02 0 269.02 0 269.22 0 272.16	0.0 1,000.0 1,317.8 8,300.5 8,725.0 8,725.0 8,725.0 8,725.0	0.0 0.0 -0.4 -18.1 -26.4 -203.6 -202.0 -13.8	0.0 0.0 -17.7 -797.0 -1,271.4 -11,652.7 -11,809.4 -16,807.6	0.00 0.00 2.00 12.00 0.00 2.00 0.00	0.00 0.00 2.00 12.00 0.00 0.00 0.00	0.00 0.00 0.05 0.00 2.00	0.00 90.00	FTP-FSC 132H PP2-FSC 132H BHL-FSC 132H

9/3/2024 3:43:07PM

COMPASS 5000.17 Build 03

Database:	Compass_17	Local Co-ordinate Reference:	Well FRED STATE COM 132H
Company:	NEW MEXICO	TVD Reference:	KB @ 3152.0usft
Project:	(SP) EDDY	MD Reference:	KB @ 3152.0usft
Site:	FRED PROJECT	North Reference:	Grid
Well:	FRED STATE COM 132H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OWB	-	
Design:	PWP0		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
0.0		0.00	0.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
100.0		0.00	100.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N 32° 26' 14.291 N	104° 11' 58.905 W
200.0		0.00	200.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
300.0		0.00	300.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
400.0		0.00	400.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
500.0		0.00	500.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
600.0		0.00	600.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
700.0		0.00	700.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
800.0	0.00	0.00	800.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
900.0		0.00	900.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
1,000.0		0.00	1,000.0	0.0	0.0	522,847.72	582,565.75	32° 26' 14.291 N	104° 11' 58.905 W
1,100.0		268.70	1,100.0	0.0	-1.7	522,847.68	582,564.01	32° 26' 14.291 N	104° 11' 58.925 W
1,200.0		268.70	1,199.8	-0.2	-7.0	522,847.56	582,558.78	32° 26' 14.290 N	104° 11' 58.986 W
1,300.0		268.70	1,299.5	-0.4	-15.7	522,847.37	582,550.06	32° 26' 14.288 N	104° 11' 59.088 W
1,318.5		268.70	1,317.8	-0.4	-17.7	522,847.32	582,548.07	32° 26' 14.287 N	104° 11' 59.111 W
1,400.0		268.70	1,398.8	-0.6	-26.7	522,847.12	582,539.03	32° 26' 14.285 N	104° 11' 59.217 W
1,500.0		268.70	1,498.2	-0.9	-37.8	522,846.86	582,527.94	32° 26' 14.283 N	104° 11' 59.346 W
1,600.0 1,700.0		268.70 268.70	1,597.6 1,697.0	-1.1 -1.4	-48.9 -60.0	522,846.61 522,846.36	582,516.85 582,505.76	32° 26' 14.281 N 32° 26' 14.278 N	104° 11' 59.475 W 104° 11' 59.605 W
1,800.0		268.70	1,796.4	-1.4 -1.6	-00.0	522,846.11	582,494.67	32° 26' 14.276 N	104° 11' 59.734 W
1,900.0		268.70	1,895.8	-1.9	-82.2	522,845.86	582,483.57	32° 26' 14.274 N	104° 11' 59.864 W
2,000.0		268.70	1,995.1	-2.1	-93.3	522,845.61	582,472.48	32° 26' 14.271 N	104° 11' 59.993 W
2,100.0		268.70	2,094.5	-2.4	-104.4	522,845.35	582,461.39	32° 26' 14.269 N	104° 12' 0.123 W
2,200.0		268.70	2,193.9	-2.6	-115.5	522,845.10	582,450.30	32° 26' 14.267 N	104° 12' 0.252 W
2,300.0		268.70	2,293.3	-2.9	-126.5	522,844.85	582,439.21	32° 26' 14.264 N	104° 12' 0.381 W
2,400.0		268.70	2,392.7	-3.1	-137.6	522,844.60	582,428.12	32° 26' 14.262 N	104° 12' 0.511 W
2,500.0		268.70	2,492.1	-3.4	-148.7	522,844.35	582,417.02	32° 26' 14.260 N	104° 12' 0.640 W
2,600.0	6.37	268.70	2,591.4	-3.6	-159.8	522,844.09	582,405.93	32° 26' 14.257 N	104° 12' 0.770 W
2,700.0		268.70	2,690.8	-3.9	-170.9	522,843.84	582,394.84	32° 26' 14.255 N	104° 12' 0.899 W
2,800.0		268.70	2,790.2	-4.1	-182.0	522,843.59	582,383.75	32° 26' 14.252 N	104° 12' 1.029 W
2,900.0		268.70	2,889.6	-4.4	-193.1	522,843.34	582,372.66	32° 26' 14.250 N	104° 12' 1.158 W
3,000.0		268.70	2,989.0	-4.6	-204.2	522,843.09	582,361.57	32° 26' 14.248 N	104° 12' 1.287 W
3,100.0		268.70	3,088.3	-4.9	-215.3	522,842.84	582,350.48	32° 26' 14.245 N	104° 12' 1.417 W
3,200.0		268.70	3,187.7	-5.1	-226.4	522,842.58	582,339.38	32° 26' 14.243 N	104° 12' 1.546 W
3,300.0		268.70	3,287.1	-5.4	-237.5	522,842.33	582,328.29	32° 26' 14.241 N	104° 12' 1.676 W
3,400.0		268.70	3,386.5	-5.6	-248.6	522,842.08	582,317.20	32° 26' 14.238 N	104° 12' 1.805 W
3,500.0 3,600.0		268.70 268.70	3,485.9 3,585.3	-5.9 -6.1	-259.6 -270.7	522,841.83 522,841.58	582,306.11 582,295.02	32° 26' 14.236 N 32° 26' 14.234 N	104° 12' 1.935 W 104° 12' 2.064 W
3,700.0		268.70	3,684.6	-0.1 -6.4	-270.7	522,841.33	582,283.93	32° 26' 14.231 N	104° 12' 2.193 W
3,800.0		268.70	3,784.0	-0.4 -6.6	-292.9	522,841.07	582,272.83	32° 26' 14.229 N	104° 12' 2.193 W
3,900.0		268.70	3,883.4	-6.9	-304.0	522,840.82	582,261.74	32° 26' 14.227 N	104° 12' 2.452 W
4,000.0		268.70	3,982.8	-7.2	-315.1	522,840.57	582,250.65	32° 26' 14.224 N	104° 12' 2.582 W
4,100.0		268.70	4,082.2	-7.4	-326.2	522,840.32	582,239.56	32° 26' 14.222 N	104° 12' 2.711 W
4,200.0		268.70	4,181.6	-7.7	-337.3	522,840.07	582,228.47	32° 26' 14.219 N	104° 12' 2.841 W
4,300.0		268.70	4,280.9	-7.9	-348.4	522,839.82	582,217.38	32° 26' 14.217 N	104° 12' 2.970 W
4,400.0		268.70	4,380.3	-8.2	-359.5	522,839.56	582,206.29	32° 26' 14.215 N	104° 12' 3.099 W
4,500.0	6.37	268.70	4,479.7	-8.4	-370.6	522,839.31	582,195.19	32° 26' 14.212 N	104° 12' 3.229 W
4,600.0		268.70	4,579.1	-8.7	-381.7	522,839.06	582,184.10	32° 26' 14.210 N	104° 12' 3.358 W
4,700.0	6.37	268.70	4,678.5	-8.9	-392.7	522,838.81	582,173.01	32° 26' 14.208 N	104° 12' 3.488 W
4,800.0	6.37	268.70	4,777.9	-9.2	-403.8	522,838.56	582,161.92	32° 26' 14.205 N	104° 12' 3.617 W
4,900.0		268.70	4,877.2	-9.4	-414.9	522,838.31	582,150.83	32° 26' 14.203 N	104° 12' 3.747 W
5,000.0		268.70	4,976.6	-9.7	-426.0	522,838.05	582,139.74	32° 26' 14.201 N	104° 12' 3.876 W
5,100.0		268.70	5,076.0	-9.9	-437.1	522,837.80	582,128.65	32° 26' 14.198 N	104° 12' 4.005 W
5,200.0		268.70	5,175.4	-10.2	-448.2	522,837.55	582,117.55	32° 26' 14.196 N	104° 12' 4.135 W
5,300.0	6.37	268.70	5,274.8	-10.4	-459.3	522,837.30	582,106.46	32° 26' 14.194 N	104° 12' 4.264 W

9/3/2024 3:43:07PM

Page 3

COMPASS 5000.17 Build 03

Database:	Compass_17	Local Co-ordinate Reference:	Well FRED STATE COM 132H
Company:	NEW MEXICO	TVD Reference:	KB @ 3152.0usft
Project:	(SP) EDDY	MD Reference:	KB @ 3152.0usft
Site:	FRED PROJECT	North Reference:	Grid
Well:	FRED STATE COM 132H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OWB	-	
Design:	PWP0		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
						. ,			_
5,400.0 5,500.0		268.70 268.70	5,374.1 5,473.5	-10.7 -10.9	-470.4 -481.5	522,837.05 522,836.80	582,095.37 582,084.28	32° 26' 14.191 N 32° 26' 14.189 N	104° 12' 4.394 W 104° 12' 4.523 W
5,600.0		268.70	5,572.9	-10.9	-492.6	522,836.54	582,073.19	32° 26' 14.187 N	104° 12' 4.653 W
5,700.0		268.70	5,672.3	-11.4	-503.7	522,836.29	582,062.10	32° 26' 14.184 N	104° 12' 4.782 W
5,800.0		268.70	5,771.7	-11.7	-514.7	522,836.04	582,051.00	32° 26' 14.182 N	104° 12' 4.911 W
5,900.0		268.70	5,871.1	-11.9	-525.8	522,835.79	582,039.91	32° 26' 14.179 N	104° 12' 5.041 W
6,000.0	6.37	268.70	5,970.4	-12.2	-536.9	522,835.54	582,028.82	32° 26' 14.177 N	104° 12' 5.170 W
6,100.0		268.70	6,069.8	-12.4	-548.0	522,835.28	582,017.73	32° 26' 14.175 N	104° 12' 5.300 W
6,200.0		268.70	6,169.2	-12.7	-559.1	522,835.03	582,006.64	32° 26' 14.172 N	104° 12' 5.429 W
6,300.0		268.70	6,268.6	-12.9	-570.2	522,834.78	581,995.55	32° 26' 14.170 N	104° 12' 5.559 W
6,400.0 6,500.0		268.70 268.70	6,368.0 6,467.4	-13.2 -13.4	-581.3 -592.4	522,834.53 522,834.28	581,984.46 581,973.36	32° 26' 14.168 N 32° 26' 14.165 N	104° 12' 5.688 W 104° 12' 5.817 W
6,600.0		268.70	6,566.7	-13.4	-592.4 -603.5	522,834.03	581,962.27	32° 26' 14.163 N 32° 26' 14.163 N	104° 12' 5.947 W
6,700.0		268.70	6,666.1	-13.9	-614.6	522,833.77	581,951.18	32° 26' 14.161 N	104° 12' 6.076 W
6,800.0		268.70	6,765.5	-14.2	-625.7	522,833.52	581,940.09	32° 26' 14.158 N	104° 12' 6.206 W
6,900.0		268.70	6,864.9	-14.5	-636.8	522,833.27	581,929.00	32° 26' 14.156 N	104° 12' 6.335 W
7,000.0		268.70	6,964.3	-14.7	-647.8	522,833.02	581,917.91	32° 26' 14.154 N	104° 12' 6.465 W
7,100.0		268.70	7,063.7	-15.0	-658.9	522,832.77	581,906.81	32° 26' 14.151 N	104° 12' 6.594 W
7,200.0		268.70	7,163.0	-15.2	-670.0	522,832.52	581,895.72	32° 26' 14.149 N	104° 12' 6.724 W
7,300.0		268.70	7,262.4	-15.5	-681.1	522,832.26	581,884.63	32° 26' 14.146 N	104° 12' 6.853 W
7,400.0		268.70	7,361.8	-15.7	-692.2	522,832.01	581,873.54	32° 26' 14.144 N	104° 12' 6.982 W
7,500.0		268.70	7,461.2	-16.0	-703.3	522,831.76	581,862.45	32° 26' 14.142 N	104° 12' 7.112 W
7,600.0 7,700.0		268.70 268.70	7,560.6 7,659.9	-16.2 -16.5	-714.4 -725.5	522,831.51 522,831.26	581,851.36 581,840.27	32° 26' 14.139 N 32° 26' 14.137 N	104° 12' 7.241 W 104° 12' 7.371 W
7,700.0		268.70	7,059.9	-16.7	-725.5	522,831.01	581,829.17	32° 26' 14.137 N 32° 26' 14.135 N	104° 12' 7.500 W
7,900.0		268.70	7,858.7	-17.0	-747.7	522,830.75	581,818.08	32° 26' 14.132 N	104° 12' 7.630 W
8,000.0		268.70	7,958.1	-17.2	-758.8	522,830.50	581,806.99	32° 26' 14.130 N	104° 12' 7.759 W
8,100.0		268.70	8,057.5	-17.5	-769.9	522,830.25	581,795.90	32° 26' 14.128 N	104° 12' 7.888 W
8,200.0		268.70	8,156.9	-17.7	-780.9	522,830.00	581,784.81	32° 26' 14.125 N	104° 12' 8.018 W
8,300.0		268.70	8,256.2	-18.0	-792.0	522,829.75	581,773.72	32° 26' 14.123 N	104° 12' 8.147 W
8,344.5		268.70	8,300.5	-18.1	-797.0	522,829.64	581,768.78	32° 26' 14.122 N	104° 12' 8.205 W
8,350.0		268.73	8,305.9	-18.1	-797.6	522,829.62	581,768.14	32° 26' 14.122 N	104° 12' 8.212 W
8,375.0 8,400.0		268.82 268.87	8,330.7 8,355.1	-18.2 -18.3	-801.3 -806.3	522,829.54 522,829.44	581,764.43 581,759.44	32° 26' 14.121 N 32° 26' 14.120 N	104° 12' 8.256 W 104° 12' 8.314 W
8,400.0		268.90	8,379.3	-18.4	-812.6	522,829.32	581,753.17	32° 26' 14.120 N 32° 26' 14.119 N	104° 12' 8.387 W
8,450.0		268.92	8,403.2	-18.5	-820.1	522,829.18	581,745.65	32° 26' 14.118 N	104° 12' 8.475 W
8,475.0		268.93	8,426.6	-18.7	-828.9	522,829.01	581,736.88	32° 26' 14.116 N	104° 12' 8.577 W
8,500.0		268.95	8,449.5	-18.9	-838.8	522,828.83	581,726.91	32° 26' 14.114 N	104° 12' 8.693 W
8,525.0	28.03	268.95	8,471.9	-19.1	-850.0	522,828.62	581,715.75	32° 26' 14.113 N	104° 12' 8.824 W
8,550.0		268.96	8,493.6	-19.3	-862.3	522,828.40	581,703.43	32° 26' 14.110 N	104° 12' 8.967 W
8,575.0		268.97	8,514.7	-19.6	-875.8	522,828.16	581,689.99	32° 26' 14.108 N	104° 12' 9.124 W
8,600.0		268.97	8,535.0	-19.8	-890.3	522,827.90	581,675.47	32° 26' 14.106 N	104° 12' 9.294 W
8,625.0 8,650.0		268.98 268.98	8,554.6 8,573.3	-20.1 -20.4	-905.9 -922.4	522,827.62 522,827.32	581,659.90 581,643.33	32° 26' 14.103 N 32° 26' 14.101 N	104° 12' 9.475 W 104° 12' 9.669 W
8,675.0		268.99	8,591.1	-20.4	-922.4	522,827.01	581,625.81	32° 26' 14.098 N	104° 12' 9.873 W
8,700.0		268.99	8,608.0	-21.0	-958.4	522,826.69	581,607.37	32° 26' 14.095 N	104° 12' 10.088 W
8,725.0		268.99	8,623.9	-21.4	-977.7	522,826.35	581,588.08	32° 26' 14.092 N	104° 12' 10.314 W
8,750.0		269.00	8,638.8	-21.7	-997.8	522,826.00	581,567.98	32° 26' 14.088 N	104° 12' 10.548 W
8,775.0	58.03	269.00	8,652.6	-22.1	-1,018.6	522,825.63	581,547.13	32° 26' 14.085 N	104° 12' 10.791 W
8,800.0		269.00	8,665.2	-22.5	-1,040.2	522,825.26	581,525.59	32° 26' 14.081 N	104° 12' 11.043 W
8,825.0		269.00	8,676.8	-22.9	-1,062.3	522,824.87	581,503.42	32° 26' 14.078 N	104° 12' 11.301 W
8,850.0		269.01	8,687.1	-23.2	-1,085.1	522,824.48	581,480.67	32° 26' 14.074 N	104° 12' 11.567 W
8,875.0		269.01 269.01	8,696.3 8 704 2	-23.6 -24.1	-1,108.3 -1,132.0	522,824.07 522,823.66	581,457.41 581,433.71	32° 26' 14.071 N 32° 26' 14.067 N	104° 12' 11.838 W 104° 12' 12.115 W
8,900.0 8,925.0		269.01	8,704.2 8,710.9	-24.1 -24.5	-1,132.0 -1,156.1	522,823.00 522,823.25	581,409.62	32° 26' 14.067 N 32° 26' 14.063 N	104 12 12.115 W 104° 12' 12.396 W
0,020.0	10.00	200.01	0,710.0	24.0	1,100.1	522,020.20	001,100.02	32 20 17.000 N	

9/3/2024 3:43:07PM

COMPASS 5000.17 Build 03

Database:	Compass 17	Local Co-ordinate Reference:	Well FRED STATE COM 132H
Company:	NEW MEXICO	TVD Reference:	KB @ 3152.0usft
Project:	(SP) EDDY	MD Reference:	KB @ 3152.0usft
Site:	FRED PROJECT	North Reference:	Grid
Well:	FRED STATE COM 132H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OWB		
Design:	PWP0		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
. ,									-
8,950.0 8,975.0		269.02 269.02	8,716.3 8,720.4	-24.9 -25.3	-1,180.5 -1,205.2	522,822.83 522,822.40	581,385.22 581,360.56	32° 26' 14.059 N 32° 26' 14.055 N	104° 12' 12.681 W 104° 12' 12.968 W
9,000.0		269.02	8,720.4	-25.3 -25.7	-1,205.2	522,822.40	581,335.73	32° 26' 14.053 N 32° 26' 14.051 N	104° 12' 12.908 W
9,000.0		269.02	8,724.7	-25.7	-1,255.0	522,821.55	581,310.78	32° 26' 14.047 N	104° 12' 13.549 W
9,041.5		269.02	8,725.0	-26.4	-1,271.4	522,821.27	581,294.33	32° 26' 14.045 N	104° 12' 13.741 W
9,100.0		269.02	8,725.0	-27.4	-1,330.0	522,820.27	581,235.80	32° 26' 14.036 N	104° 12' 14.424 W
9,200.0		269.02	8,725.0	-29.2	-1,429.9	522,818.57	581,135.81	32° 26' 14.020 N	104° 12' 15.591 W
9,300.0		269.02	8,725.0	-30.9	-1,529.9	522,816.86	581,035.83	32° 26' 14.004 N	104° 12' 16.758 W
9,400.0	90.00	269.02	8,725.0	-32.6	-1,629.9	522,815.15	580,935.84	32° 26' 13.989 N	104° 12' 17.925 W
9,500.0	90.00	269.02	8,725.0	-34.3	-1,729.9	522,813.45	580,835.86	32° 26' 13.973 N	104° 12' 19.091 W
9,600.0		269.02	8,725.0	-36.0	-1,829.9	522,811.74	580,735.87	32° 26' 13.957 N	104° 12' 20.258 W
9,700.0		269.02	8,725.0	-37.7	-1,929.9	522,810.03	580,635.88	32° 26' 13.941 N	104° 12' 21.425 W
9,800.0		269.02	8,725.0	-39.4	-2,029.9	522,808.33	580,535.90	32° 26' 13.926 N	104° 12' 22.592 W
9,900.0		269.02	8,725.0	-41.1	-2,129.8	522,806.62	580,435.91	32° 26' 13.910 N	104° 12' 23.758 W
10,000.0		269.02	8,725.0	-42.8	-2,229.8	522,804.92	580,335.93	32° 26' 13.894 N	104° 12' 24.925 W
10,100.0		269.02	8,725.0	-44.5	-2,329.8	522,803.21	580,235.94	32° 26' 13.879 N	104° 12' 26.092 W
10,200.0		269.02	8,725.0	-46.2	-2,429.8	522,801.50	580,135.96	32° 26' 13.863 N	104° 12' 27.259 W
10,300.0 10,400.0		269.02 269.02	8,725.0 8,725.0	-47.9 -49.6	-2,529.8 -2,629.8	522,799.80 522,798.09	580,035.97 579,935.99	32° 26' 13.847 N 32° 26' 13.831 N	104° 12' 28.425 W 104° 12' 29.592 W
10,400.0		269.02	8,725.0	-49.0 -51.3	-2,029.8	522,796.38	579,836.00	32° 26' 13.831 N 32° 26' 13.816 N	104° 12' 30.759 W
10,600.0		269.02	8,725.0	-53.0	-2,829.7	522,794.68	579,736.02	32° 26' 13.800 N	104° 12' 30.739 W
10,700.0		269.02	8,725.0	-54.8	-2,929.7	522,792.97	579,636.03	32° 26' 13.784 N	104° 12' 33.092 W
10,800.0		269.02	8,725.0	-56.5	-3,029.7	522,791.26	579,536.04	32° 26' 13.769 N	104° 12' 34.259 W
10,900.0		269.02	8,725.0	-58.2	-3,129.7	522,789.56	579,436.06	32° 26' 13.753 N	104° 12' 35.426 W
11,000.0		269.02	8,725.0	-59.9	-3,229.7	522,787.85	579,336.07	32° 26' 13.737 N	104° 12' 36.593 W
11,100.0		269.02	8,725.0	-61.6	-3,329.7	522,786.15	579,236.09	32° 26' 13.721 N	104° 12' 37.760 W
11,200.0	90.00	269.02	8,725.0	-63.3	-3,429.7	522,784.44	579,136.10	32° 26' 13.706 N	104° 12' 38.926 W
11,300.0	90.00	269.02	8,725.0	-65.0	-3,529.6	522,782.73	579,036.12	32° 26' 13.690 N	104° 12' 40.093 W
11,400.0		269.02	8,725.0	-66.7	-3,629.6	522,781.03	578,936.13	32° 26' 13.674 N	104° 12' 41.260 W
11,500.0		269.02	8,725.0	-68.4	-3,729.6	522,779.32	578,836.15	32° 26' 13.658 N	104° 12' 42.427 W
11,600.0		269.02	8,725.0	-70.1	-3,829.6	522,777.61	578,736.16	32° 26' 13.643 N	104° 12' 43.593 W
11,700.0		269.02	8,725.0	-71.8	-3,929.6	522,775.91	578,636.18	32° 26' 13.627 N	104° 12' 44.760 W
11,800.0		269.02	8,725.0	-73.5	-4,029.6	522,774.20	578,536.19	32° 26' 13.611 N	104° 12' 45.927 W
11,900.0		269.02 269.02	8,725.0	-75.2 -76.9	-4,129.5	522,772.49	578,436.20	32° 26' 13.595 N	104° 12' 47.094 W
12,000.0		269.02	8,725.0 8,725.0	-76.9 -78.6	-4,229.5 -4,329.5	522,770.79 522,769.08	578,336.22 578,236.23	32° 26' 13.579 N	104° 12' 48.260 W 104° 12' 49.427 W
12,100.0 12,200.0		269.02	8,725.0	-78.0	-4,329.5 -4,429.5	522,767.37	578,136.25	32° 26' 13.564 N 32° 26' 13.548 N	104° 12' 49.427 W
12,200.0		269.02	8,725.0	-82.1	-4,529.5	522,765.67	578,036.26	32° 26' 13.532 N	104° 12' 50.554 W
12,400.0		269.02	8,725.0	-83.8	-4,629.5	522,763.96	577,936.28	32° 26' 13.516 N	104° 12' 52.927 W
12,500.0		269.02	8,725.0	-85.5	-4,729.5	522,762.26	577,836.29	32° 26' 13.501 N	104° 12' 54.094 W
12,600.0		269.02	8,725.0	-87.2	-4,829.4	522,760.55	577,736.31	32° 26' 13.485 N	104° 12' 55.261 W
12,700.0		269.02	8,725.0	-88.9	-4,929.4	522,758.84	577,636.32	32° 26' 13.469 N	104° 12' 56.428 W
12,800.0	90.00	269.02	8,725.0	-90.6	-5,029.4	522,757.14	577,536.34	32° 26' 13.453 N	104° 12' 57.594 W
12,900.0	90.00	269.02	8,725.0	-92.3	-5,129.4	522,755.43	577,436.35	32° 26' 13.437 N	104° 12' 58.761 W
13,000.0	90.00	269.02	8,725.0	-94.0	-5,229.4	522,753.72	577,336.36	32° 26' 13.422 N	104° 12' 59.928 W
13,100.0		269.02	8,725.0	-95.7	-5,329.4	522,752.02	577,236.38	32° 26' 13.406 N	104° 13' 1.095 W
13,200.0		269.02	8,725.0	-97.4	-5,429.4	522,750.31	577,136.39	32° 26' 13.390 N	104° 13' 2.261 W
13,300.0		269.02	8,725.0	-99.1	-5,529.3	522,748.60	577,036.41	32° 26' 13.374 N	104° 13' 3.428 W
13,400.0		269.02	8,725.0	-100.8	-5,629.3	522,746.90	576,936.42	32° 26' 13.358 N	104° 13' 4.595 W
13,500.0		269.02	8,725.0	-102.5	-5,729.3	522,745.19	576,836.44	32° 26' 13.342 N	104° 13' 5.762 W
13,600.0		269.02	8,725.0	-104.2	-5,829.3	522,743.49	576,736.45	32° 26' 13.327 N	104° 13' 6.928 W
13,700.0		269.02	8,725.0	-105.9	-5,929.3	522,741.78	576,636.47	32° 26' 13.311 N	104° 13' 8.095 W
13,800.0		269.02	8,725.0	-107.6	-6,029.3	522,740.07	576,536.48	32° 26' 13.295 N	104° 13' 9.262 W
13,900.0 14,000.0		269.02 269.02	8,725.0 8,725.0	-109.4 -111.1	-6,129.3 -6,229.2	522,738.37 522,736.66	576,436.50 576,336.51	32° 26' 13.279 N 32° 26' 13.263 N	104° 13' 10.429 W 104° 13' 11.595 W
14,000.0	90.00	209.02	0,725.0	-(11.1	-0,229.2	JZZ,1 30.00	570,330.51	52 20 13.203 N	104 13 11.393 W

9/3/2024 3:43:07PM

COMPASS 5000.17 Build 03

Database:	Compass 17	Local Co-ordinate Reference:	Well FRED STATE COM 132H
Company:		TVD Reference:	KB @ 3152.0usft
Project:	(SP) EDDY	MD Reference:	KB @ 3152.0usft
Site:	FRED PROJECT	North Reference:	Grid
Well:	FRED STATE COM 132H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OWB		
Design:	PWP0		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
								32° 26' 13.248 N	-
14,100.0 14,200.0		269.02 269.02	8,725.0 8,725.0	-112.8 -114.5	-6,329.2 -6,429.2	522,734.95 522,733.25	576,236.52 576,136.54	32° 26' 13.248 N 32° 26' 13.232 N	104° 13' 12.762 W 104° 13' 13.929 W
14,300.0		269.02	8,725.0	-114.3	-6,529.2	522,731.54	576,036.55	32° 26' 13.216 N	104° 13' 15.096 W
14,400.0		269.02	8,725.0	-117.9	-6,629.2	522,729.83	575,936.57	32° 26' 13.200 N	104° 13' 16.262 W
14,500.0		269.02	8,725.0	-119.6	-6,729.2	522,728.13	575,836.58	32° 26' 13.184 N	104° 13' 17.429 W
14,600.0		269.02	8,725.0	-121.3	-6,829.2	522,726.42	575,736.60	32° 26' 13.168 N	104° 13' 18.596 W
14,700.0	90.00	269.02	8,725.0	-123.0	-6,929.1	522,724.72	575,636.61	32° 26' 13.152 N	104° 13' 19.763 W
14,800.0	90.00	269.02	8,725.0	-124.7	-7,029.1	522,723.01	575,536.63	32° 26' 13.137 N	104° 13' 20.929 W
14,900.0		269.02	8,725.0	-126.4	-7,129.1	522,721.30	575,436.64	32° 26' 13.121 N	104° 13' 22.096 W
15,000.0		269.02	8,725.0	-128.1	-7,229.1	522,719.60	575,336.66	32° 26' 13.105 N	104° 13' 23.263 W
15,100.0		269.02	8,725.0	-129.8	-7,329.1	522,717.89	575,236.67	32° 26' 13.089 N	104° 13' 24.430 W
15,200.0		269.02	8,725.0	-131.5	-7,429.1	522,716.18	575,136.69	32° 26' 13.073 N	104° 13' 25.596 W
15,300.0		269.02 269.02	8,725.0	-133.2	-7,529.1	522,714.48	575,036.70	32° 26' 13.057 N	104° 13' 26.763 W
15,400.0 15,500.0		269.02	8,725.0 8,725.0	-135.0 -136.7	-7,629.0 -7,729.0	522,712.77 522,711.06	574,936.71 574,836.73	32° 26' 13.041 N 32° 26' 13.025 N	104° 13' 27.930 W 104° 13' 29.097 W
15,600.0		269.02	8,725.0	-138.4	-7,829.0	522,709.36	574,736.74	32° 26' 13.023 N 32° 26' 13.010 N	104° 13' 30.263 W
15,700.0		269.02	8,725.0	-140.1	-7,929.0	522,707.65	574,636.76	32° 26' 12.994 N	104° 13' 31.430 W
15,800.0		269.02	8,725.0	-141.8	-8,029.0	522,705.95	574,536.77	32° 26' 12.978 N	104° 13' 32.597 W
15,900.0		269.02	8,725.0	-143.5	-8,129.0	522,704.24	574,436.79	32° 26' 12.962 N	104° 13' 33.764 W
16,000.0		269.02	8,725.0	-145.2	-8,229.0	522,702.53	574,336.80	32° 26' 12.946 N	104° 13' 34.930 W
16,100.0	90.00	269.02	8,725.0	-146.9	-8,328.9	522,700.83	574,236.82	32° 26' 12.930 N	104° 13' 36.097 W
16,200.0	90.00	269.02	8,725.0	-148.6	-8,428.9	522,699.12	574,136.83	32° 26' 12.914 N	104° 13' 37.264 W
16,300.0		269.02	8,725.0	-150.3	-8,528.9	522,697.41	574,036.85	32° 26' 12.898 N	104° 13' 38.431 W
16,400.0		269.02	8,725.0	-152.0	-8,628.9	522,695.71	573,936.86	32° 26' 12.882 N	104° 13' 39.597 W
16,500.0		269.02	8,725.0	-153.7	-8,728.9	522,694.00	573,836.87	32° 26' 12.867 N	104° 13' 40.764 W
16,600.0		269.02	8,725.0	-155.4	-8,828.9	522,692.29	573,736.89	32° 26' 12.851 N	104° 13' 41.931 W
16,700.0		269.02	8,725.0	-157.1	-8,928.8	522,690.59	573,636.90	32° 26' 12.835 N	104° 13' 43.098 W
16,800.0 16,900.0		269.02 269.02	8,725.0 8,725.0	-158.8 -160.5	-9,028.8 -9,128.8	522,688.88 522,687.18	573,536.92 573,436.93	32° 26' 12.819 N 32° 26' 12.803 N	104° 13' 44.264 W 104° 13' 45.431 W
17,000.0		269.02	8,725.0	-162.3	-9,128.8	522,685.47	573,336.95	32° 26' 12.787 N	104° 13' 46.598 W
17,100.0		269.02	8,725.0	-164.0	-9,328.8	522,683.76	573,236.96	32° 26' 12.771 N	104° 13' 47.765 W
17,200.0		269.02	8,725.0	-165.7	-9,428.8	522,682.06	573,136.98	32° 26' 12.755 N	104° 13' 48.931 W
17,300.0		269.02	8,725.0	-167.4	-9,528.8	522,680.35	573,036.99	32° 26' 12.739 N	104° 13' 50.098 W
17,400.0	90.00	269.02	8,725.0	-169.1	-9,628.7	522,678.64	572,937.01	32° 26' 12.723 N	104° 13' 51.265 W
17,500.0	90.00	269.02	8,725.0	-170.8	-9,728.7	522,676.94	572,837.02	32° 26' 12.707 N	104° 13' 52.432 W
17,600.0		269.02	8,725.0	-172.5	-9,828.7	522,675.23	572,737.03	32° 26' 12.691 N	104° 13' 53.598 W
17,700.0		269.02	8,725.0	-174.2	-9,928.7	522,673.52	572,637.05	32° 26' 12.675 N	104° 13' 54.765 W
17,800.0		269.02	8,725.0	-175.9	-10,028.7	522,671.82	572,537.06	32° 26' 12.659 N	104° 13' 55.932 W
17,900.0		269.02	8,725.0	-177.6	-10,128.7	522,670.11	572,437.08	32° 26' 12.643 N	104° 13' 57.099 W
18,000.0 18,100.0		269.02 269.02	8,725.0	-179.3	-10,228.7	522,668.41	572,337.09	32° 26' 12.628 N	104° 13' 58.265 W
18,200.0		269.02	8,725.0 8,725.0	-181.0 -182.7	-10,328.6 -10,428.6	522,666.70 522,664.99	572,237.11 572,137.12	32° 26' 12.612 N 32° 26' 12.596 N	104° 13' 59.432 W 104° 14' 0.599 W
18,200.0		269.02	8,725.0	-184.4	-10,428.0 -10,528.6	522,663.29	572,037.12	32° 26' 12.580 N	104° 14' 0.399 W
18,400.0		269.02	8,725.0	-186.1	-10,628.6	522,661.58	571,937.15	32° 26' 12.564 N	104° 14' 1.700 W
18,500.0		269.02	8,725.0	-187.8	-10,728.6	522,659.87	571,837.17	32° 26' 12.548 N	104° 14' 4.099 W
18,600.0		269.02	8,725.0	-189.6	-10,828.6	522,658.17	571,737.18	32° 26' 12.532 N	104° 14' 5.266 W
18,700.0		269.02	8,725.0	-191.3	-10,928.6	522,656.46	571,637.19	32° 26' 12.516 N	104° 14' 6.433 W
18,800.0		269.02	8,725.0	-193.0	-11,028.5	522,654.75	571,537.21	32° 26' 12.500 N	104° 14' 7.599 W
18,900.0		269.02	8,725.0	-194.7	-11,128.5	522,653.05	571,437.22	32° 26' 12.484 N	104° 14' 8.766 W
19,000.0		269.02	8,725.0	-196.4	-11,228.5	522,651.34	571,337.24	32° 26' 12.468 N	104° 14' 9.933 W
19,100.0		269.02	8,725.0	-198.1	-11,328.5	522,649.63	571,237.25	32° 26' 12.452 N	104° 14' 11.100 W
19,200.0		269.02	8,725.0	-199.8	-11,428.5	522,647.93	571,137.27	32° 26' 12.436 N	104° 14' 12.266 W
19,300.0		269.02	8,725.0	-201.5	-11,528.5	522,646.22	571,037.28	32° 26' 12.420 N	104° 14' 13.433 W
19,400.0		269.02	8,725.0 8 725 0	-203.2	-11,628.5	522,644.52	570,937.30 570,913.03	32° 26' 12.404 N	104° 14' 14.600 W
19,424.3	90.00	269.02	8,725.0	-203.6	-11,652.7	522,644.10	510,913.03	32° 26' 12.400 N	104° 14' 14.883 W

9/3/2024 3:43:07PM

COMPASS 5000.17 Build 03

Database:	Compass 17	Local Co-ordinate Reference:	Well FRED STATE COM 132H
Company:	NEW MEXICO	TVD Reference:	KB @ 3152.0usft
Project:	(SP) EDDY	MD Reference:	KB @ 3152.0usft
Site:	FRED PROJECT	North Reference:	Grid
Well:	FRED STATE COM 132H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OWB		
Design:	PWP0		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
19,500.0		270.54	8,725.0	-203.9	-11,728.4	522,643.81	570,837.30	32° 26' 12.398 N	- 104° 14' 15.767 W
19,581.0		270.34	8,725.0	-203.9	-11,809.4	522,645.71	570,756.37	32° 26' 12.396 N 32° 26' 12.417 N	104° 14' 15.707 W
19,600.0	90.00	272.16	8,725.0	-202.0	-11,828.4	522,646.43	570,737.34	32° 26' 12.425 N	104° 14' 16.933 W
19,700.0		272.10	8,725.0	-197.5	-11,928.3	522,650.19	570,637.41	32° 26' 12.463 N	104° 14' 18.099 W
19,800.0		272.16	8,725.0	-193.8	-12,028.3	522,653.95	570,537.48	32° 26' 12.501 N	104° 14' 19.265 W
19,900.0		272.16	8,725.0	-190.0	-12,128.2	522,657.72	570,437.55	32° 26' 12.539 N	104° 14' 20.431 W
20,000.0		272.16	8,725.0	-186.2	-12,228.1	522,661.48	570,337.62	32° 26' 12.577 N	104° 14' 21.597 W
20,100.0		272.16	8,725.0	-182.5	-12,328.1	522,665.24	570,237.70	32° 26' 12.615 N	104° 14' 22.763 W
20,200.0	90.00	272.16	8,725.0	-178.7	-12,428.0	522,669.00	570,137.77	32° 26' 12.653 N	104° 14' 23.929 W
20,300.0	90.00	272.16	8,725.0	-175.0	-12,527.9	522,672.76	570,037.84	32° 26' 12.691 N	104° 14' 25.095 W
20,400.0	90.00	272.16	8,725.0	-171.2	-12,627.8	522,676.53	569,937.91	32° 26' 12.729 N	104° 14' 26.261 W
20,500.0	90.00	272.16	8,725.0	-167.4	-12,727.8	522,680.29	569,837.98	32° 26' 12.767 N	104° 14' 27.427 W
20,600.0	90.00	272.16	8,725.0	-163.7	-12,827.7	522,684.05	569,738.05	32° 26' 12.806 N	104° 14' 28.593 W
20,700.0		272.16	8,725.0	-159.9	-12,927.6	522,687.81	569,638.12	32° 26' 12.844 N	104° 14' 29.760 W
20,800.0		272.16	8,725.0	-156.1	-13,027.6	522,691.58	569,538.19	32° 26' 12.882 N	104° 14' 30.926 W
20,900.0		272.16	8,725.0	-152.4	-13,127.5	522,695.34	569,438.26	32° 26' 12.920 N	104° 14' 32.092 W
21,000.0		272.16	8,725.0	-148.6	-13,227.4	522,699.10	569,338.33	32° 26' 12.958 N	104° 14' 33.258 W
21,100.0		272.16	8,725.0	-144.9	-13,327.3	522,702.86	569,238.40	32° 26' 12.996 N	104° 14' 34.424 W
21,200.0		272.16	8,725.0	-141.1	-13,427.3	522,706.62	569,138.47	32° 26' 13.034 N	104° 14' 35.590 W
21,300.0		272.16	8,725.0	-137.3	-13,527.2	522,710.39	569,038.54	32° 26' 13.072 N	104° 14' 36.756 W
21,400.0		272.16	8,725.0	-133.6	-13,627.1	522,714.15	568,938.62	32° 26' 13.110 N	104° 14' 37.922 W
21,500.0		272.16	8,725.0	-129.8	-13,727.1	522,717.91	568,838.69	32° 26' 13.148 N	104° 14' 39.088 W
21,600.0 21,700.0		272.16 272.16	8,725.0 8,725.0	-126.0 -122.3	-13,827.0 -13,926.9	522,721.67 522,725.44	568,738.76 568,638.83	32° 26' 13.186 N 32° 26' 13.224 N	104° 14' 40.254 W 104° 14' 41.420 W
21,700.0		272.10	8,725.0	-122.3	-13,920.9	522,729.20	568,538.90	32° 26' 13.262 N	104° 14' 41.420 W 104° 14' 42.586 W
21,900.0		272.10	8,725.0	-114.8	-14,126.8	522,732.96	568,438.97	32° 26' 13.300 N	104° 14' 43.752 W
22,000.0		272.16	8,725.0	-111.0	-14,226.7	522,736.72	568,339.04	32° 26' 13.338 N	104° 14' 44.918 W
22,100.0		272.16	8,725.0	-107.2	-14,326.6	522,740.48	568,239.11	32° 26' 13.376 N	104° 14' 46.084 W
22,200.0		272.16	8,725.0	-103.5	-14,426.6	522,744.25	568,139.18	32° 26' 13.414 N	104° 14' 47.250 W
22,300.0		272.16	8,725.0	-99.7	-14,526.5	522,748.01	568,039.25	32° 26' 13.453 N	104° 14' 48.416 W
22,400.0		272.16	8,725.0	-96.0	-14,626.4	522,751.77	567,939.32	32° 26' 13.491 N	104° 14' 49.582 W
22,500.0	90.00	272.16	8,725.0	-92.2	-14,726.4	522,755.53	567,839.39	32° 26' 13.529 N	104° 14' 50.748 W
22,600.0	90.00	272.16	8,725.0	-88.4	-14,826.3	522,759.30	567,739.47	32° 26' 13.567 N	104° 14' 51.914 W
22,700.0	90.00	272.16	8,725.0	-84.7	-14,926.2	522,763.06	567,639.54	32° 26' 13.605 N	104° 14' 53.080 W
22,800.0	90.00	272.16	8,725.0	-80.9	-15,026.1	522,766.82	567,539.61	32° 26' 13.643 N	104° 14' 54.246 W
22,900.0		272.16	8,725.0	-77.1	-15,126.1	522,770.58	567,439.68	32° 26' 13.681 N	104° 14' 55.412 W
23,000.0		272.16	8,725.0	-73.4	-15,226.0	522,774.34	567,339.75	32° 26' 13.719 N	104° 14' 56.578 W
23,100.0		272.16	8,725.0	-69.6	-15,325.9	522,778.11	567,239.82	32° 26' 13.757 N	104° 14' 57.744 W
23,200.0		272.16	8,725.0	-65.9	-15,425.9	522,781.87	567,139.89	32° 26' 13.795 N	104° 14' 58.911 W
23,300.0		272.16	8,725.0	-62.1	-15,525.8	522,785.63	567,039.96	32° 26' 13.833 N	104° 15' 0.077 W
23,400.0	90.00	272.16	8,725.0	-58.3	-15,625.7	522,789.39	566,940.03	32° 26' 13.871 N	104° 15' 1.243 W
23,500.0		272.16	8,725.0	-54.6	-15,725.7	522,793.16	566,840.10	32° 26' 13.909 N	104° 15' 2.409 W
23,600.0		272.16	8,725.0	-50.8	-15,825.6	522,796.92	566,740.17	32° 26' 13.947 N	104° 15' 3.575 W
23,700.0 23,800.0		272.16	8,725.0 8,725.0	-47.0	-15,925.5	522,800.68	566,640.24 566,540.31	32° 26' 13.985 N	104° 15' 4.741 W 104° 15' 5.907 W
23,800.0		272.16 272.16	8,725.0 8,725.0	-43.3 -39.5	-16,025.4 -16,125.4	522,804.44 522,808.20	566,440.39	32° 26' 14.023 N 32° 26' 14.061 N	104° 15' 5.907 W
24,000.0		272.10	8,725.0	-35.8	-16,225.3	522,800.20	566,340.46	32° 26' 14.099 N	104° 15' 8.239 W
24,100.0		272.16	8,725.0	-32.0	-16,325.2	522,815.73	566,240.53	32° 26' 14.137 N	104° 15' 9.405 W
24,200.0		272.16	8,725.0	-28.2	-16,425.2	522,819.49	566,140.60	32° 26' 14.175 N	104° 15' 10.571 W
24,300.0		272.16	8,725.0	-24.5	-16,525.1	522,823.25	566,040.67	32° 26' 14.213 N	104° 15' 11.737 W
24,400.0		272.16	8,725.0	-20.7	-16,625.0	522,827.02	565,940.74	32° 26' 14.251 N	104° 15' 12.903 W
24,500.0		272.16	8,725.0	-16.9	-16,724.9	522,830.78	565,840.81	32° 26' 14.288 N	104° 15' 14.069 W
24,582.8	90.00	272.16	8,725.0	-13.8	-16,807.6	522,833.89	565,758.10	32° 26' 14.320 N	104° 15' 15.034 W

9/3/2024 3:43:07PM

Page 7

COMPASS 5000.17 Build 03

Database: Company: Project: Site: Well: Wellbore: Design:	Compass_17 NEW MEXICO (SP) EDDY FRED PROJECT FRED STATE COM 132H OWB PWP0					TVD Reference:KIMD Reference:KINorth Reference:G			Well FRED STATE COM 132H KB @ 3152.0usft KB @ 3152.0usft Grid Minimum Curvature		
Design Targets Target Name - hit/miss target	Dip Aı	nale	Dip Dir.	TVD	+N/-S	+E/-W	Northing	Eas	tina		
- Shape	(°)	•	(°)	(usft)	(usft)	(usft)	(usft)	(us	•	Latitude	Longitude
PP2-FSC 132H - plan hits target - Point		0.00	0.00	8,725.0	-203.6	-11,652.7	522,644.10	570	,913.03	32° 26' 12.400 N	104° 14' 14.883 W
BHL-FSC 132H - plan hits target - Point		0.00	0.00	8,725.0	-13.8	-16,807.6	522,833.89	565	5,758.10	32° 26' 14.320 N	104° 15' 15.034 W
FTP-FSC 132H - plan hits target - Point		0.00	0.00	8,725.0	-26.4	-1,271.4	522,821.27	581	,294.33	32° 26' 14.045 N	104° 12' 13.741 W

Plan Annotations										
Measured Depth (usft)	Vertical Depth (usft)	Local Coor +N/-S (usft)	rdinates +E/-W (usft)	Comment						
1.000.0	1.000.0	0.0	0.0	Start Build 2.00						
1.318.5	1.317.8	-0.4	-17.7	Start 7026.0 hold at 1318.5 MD						
8.344.5	8.300.5	-18.1	-797.0	Start DLS 12.00 TFO 0.32						
9.041.5	8.725.0	-26.4	-1.271.4	Start 10382.8 hold at 9041.5 MD						
19,424.3	8,725.0	-203.6	-11,652.7	Start DLS 2.00 TFO 90.00						
19,581.0	8,725.0	-202.0	-11,809.4	Start 5001.8 hold at 19581.0 MD						
24,582.8	8,725.0	-13.8	-16,807.6	TD at 24582.8						

Permian Resources - Fred State Com 132H

1. Geologic Formations

Formation	Lithology	Elevation	TVD	Target
Rustler	Sandstone	2922	230	No
Top of Salt	Salt	2672	480	No
Tansill	Sandstone	2522	630	No
Yates	Anhydrite/Shale	2253	899	No
Seven Rivers	Limestone	2002	1150	No
Capitan	Sandstone	1922	1230	No
Delaware Sands	Sandstone	532	2620	No
Brushy Canyon	Sandstone	-1708	4860	No
Bone Spring Lime	Limestone/Shale	-1928	5080	No
1st Bone Spring Sand	Sandstone/Limestone/Shale	-3141	6293	No
2nd Bone Spring Sand	Sandstone/Limestone/Shale	-5908	9060	No
3rd Bone Spring Sand	Sandstone/Limestone/Shale	-5253	8405	Yes
Wolfcamp	Shale	-5583	8735	No

2. Blowout Prevention

BOP installed and tested before drilling	Size?	Min. Required WP	Туре		x	Tested to:		
			Anr	nular	х	2500 psi		
			Blind	Ram	х			
12.25	13-5/8"	5M	Pipe	Ram	х	5000 psi		
			Double Ram			5000 psi		
			Other*					
			Annular		х	2500 psi		
			Blind Ram x	Х				
9.875	13-5/8"	5M	Pipe	Ram	Х	5000 psi		
			Double Ram			5000 psi		
			Other*					
			Anr	nular	х	2500 psi		
			Blind Ram x		х			
7.875	13-5/8"	5M	Pipe	Ram	Х	5000 psi		
			Doubl	e Ram	am 5000	5000 psi		
			Other*					

Equipment: BOPE will meet all requirements for above listed system per 43 CFR 3172. BOPE with working pressure ratings in excess of anticipated maximum surface pressure will be utilized for well control from drill out of surface casing to TMD. The system may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all of the components installed will be functional, tested, and will meet all requirements per 43 CFR 3172. The wellhead will be a multibowl speed head allowing for hangoff of intermediate casing of the surface x intermedicate annulus without breaking the connection between the BOP & wellhead. A variance is requested to utilize a flexible choke line (flexhose) from the BOP to choke manifold.

Requesting Variance? YES

Variance request: Multibowl Wellhead, Flexhose, Breaktesting, Offline Cementing Variances. Attachments in Section 8.

Testing Procedure: Operator requests to ONLY test broken pressure seals per API Standard 53 and the attachments in Section 8. The BOP test shall be performed before drilling out of the surface casing shoe and will occur at a minimum: a. when initially installed, b. whenever any seal subject to test pressure is broken, c. following related repairs, d. at 21-day intervals. Testing of the ram type preventer(s) and annual type preventer(s) shall be tested per 43 CFR 3172. The BOPE configuration, choke manifold layout, and accumulator system will be in compliance with 43 CFR 3172. Bleed lines will discharge 100' from wellhead in non-H2S scenarios and 150' from wellhead in H2S scenarios.

Choke Diagram Attachment: 5M Choke Manifold BOP Diagram Attachment: BOP Schematics

3. Casing

String	Hole Size	Casing Size	Тор	Bottom	Top TVD	Bottom TVD	Length	Grade	Weight	Connection	Collapse SF	Burst SF	Joint SF Type	Joint SF	Body SF Type	Body SF
Surface	17.5	13.375	0	300	0	300	300	J55	54.5	BTC	7.62	8.26	Dry	7.81	Dry	7.33
Intermediate 1	12.25	10.75	0	790	0	790	790	J55	45.5	BTC SCC	12.14	3.36	Dry	7.82	Dry	5.26
Intermediate 2	9.875	8.625	0	2620	0	2620	2620	P110 HS	32	MO-FXL	5.87	2.54	Dry	4.29	Dry	6.22
Production	7.875	5.5	0	9465	0	8725	9465	P110RY	20	GeoConn	1.65	1.72	Dry	1.99	Dry	1.99
Production	7.875	5.5	9465	24583	8725	8725	15118	P110RY	20	GeoConn	1.65	1.72	Dry	1.99	Dry	1.99
								BLM Mi	in Safe	ety Factor	1.125	1		1.6		1.6

Non API casing spec sheets and casing design assumptions attached.

4. Cement

String	Lead/Tail	Top MD	Bottom MD	Quanity (sx)	Yield	Density	Cu Ft	Excess %	Cement Type	Additives
Surface	Tail	0	300	240	1.34	14.8	320	50%	Class C	Accelerator
Intermediate 1	Lead	0	630	100	1.88	12.9	170	50%	Class C	EconoCem-HLC + 5% Salt + 5% Kol-Seal
Intermediate 1	Tail	630	790	40	1.34	14.8	50	50%	Class C	Retarder
Intermediate 2	Lead	0	2090	130	2.96	11	360	50%	Class C	EconoCem-HLC + 5% Salt + 5% Kol-Seal
Intermediate 2	Tail	2090	2620	70	1.33	14.8	90	25%	Class C	Salt
Production	Lead	2120	8350	620	2.41	11.5	1480	40%	Class H	POZ, Extender, Fluid Loss, Dispersant, Retarder
Production	Tail	8350	24583	2040	1.73	12.5	3520	25%	Class H	POZ, Extender, Fluid Loss, Dispersant, Retarder

Permian Resources requests to pump a two-stage cement job on the 8-5/8" intermediate casing string, with the first stage being pumped conventionally with the calculated top of cement at the Capitan and the second stage performed as a bradenhead squeeze with planned cement from the Capitan to surface. If cement is not visually confirmed to circulate to surface, the final cement top after the second stage job will be verified by Echo-meter. If necessary, a top out consisting of 1,500 sack of Class C cement + 3% Salt + Bentonite Gel (2.30 yld, 12.9 ppg) will be executed as a contingency. If cement is still unable to circulate to surface, another Echo-meter run will be performed for cement top verification.

Permian Resources will include the Echo-meter verified fluid top and the volume of displacement fluid above the cement slurry in the annulus in all post-drill sundries on wells utilizing this cement program.

Permian Resources will report to the BLM the volume of fluid (limited to 5 bbls) used to flush intermediate casing valves following backside cementing procedures.

Permian Resources requests to pump an Optional Lead if well conditions dictate in an attempt to bring cement inside the surface casing. If cement reaches the desired height, the BLM will be notified and the second stage bradenhead squeeze and subsequent TOC verification will be negated.

Permian Resources requests the option to conduct the bradenhead squeeze and TOC verification offline as per standard approval from BLM when unplanned remediation is needed and batch drilling is approved. In the event the bradenhead is conducted, we will ensure the first stage cement job is cemented properly and the well is static with floats holding and no pressure on the csg annulus as with all other casing strings where batch drilling operations occur before moving off the rig. The TA cap will also be installed per Cactus procedure and pressure inside the casing will be monitored via the valve on the TA cap as per standard batch drilling ops.

5. Circulating Medium

Mud System Type: Closed Will an air or gas system be used: No

Describe what will be on location to control well or mitigate oter conditions: Sufficient quantities of mud materials will be on the well site at all times for the purpose of assuring well control and maintaining wellbore integrity. Surface interval will employ fresh water mud. The intermediate hole will utilize a saturated brine fluid to inhibit salt washout. The production hole will employ brine based and oil base fluid to inhibit formation reactivity and of the appropriate density to maintain well control.

Describe the mud monitoring system utilized: Centrifuge separation system. Open tank monitoring with EDR will be used for drilling fluids and return volumes. Open tank monitoring will be used for cement and cuttings return volumes. Mud properties will be monitored at least every 24 hours using industry accepted mud check practices.

Cuttings Volume: 9310 Cu Ft

Circulating Medium Table						
Top Depth	Bottom Depth	Mud Type	Min Weight	Max Weight		
0	300	Spud Mud	8.6	9.5		
300	790	Salt Saturated	10	10		
790	2620	Fresh Water	8.6	9.5		
2620	9465	OBM or Cut Brine	9	10		

6. Test, Logging, Coring

List of production tests including testing procedures, equipment and safety measures: Will utilize MWD/LWD from intermediate hole to TD of the well. List of open and cased hole logs run in the well: DIRECTIONAL SURVEY Coring operation description for the well: N/A

7. Pressure

Anticipated Bottom Hole Pressure	4540	psi
Anticipated Surface Pressure	2618	psi
Anticipated Bottom Hole Temperature	144	°F
Anticipated Abnormal pressure, temp, or geo hazards	No	

Permian Resources BOP Break Testing Variance Procedure

Subject: Request for a Variance Allowing break Testing of the Blowout Preventer Equipment (BOPE). Permian Resources requests a variance to ONLY test broken pressure seals on the BOPE and function test BOP when skidding a drilling rig between multiple wells on a pad.

Background

Title 43 CFR 3172, Drilling Operations, Sections 6.b.9.iv states that the BOP test must be performed whenever any seal subject to test pressure is broken. The current interpretation of the Bureau of Land Management (BLM) requires a complete BOP test and not just a test of the affected component. 43 CFR 3172.13, Variances from minimum standards states, "An operator may request the authorized officer to approve a variance from any of the minimum standards prescribed in <u>§§ 3172.6</u> through <u>3172.12</u>. All such requests shall be submitted in writing to the appropriate authorized officer and provide information as to the circumstances which warrant approval of the variance(s) requested and the proposed alternative methods by which the related minimum standard(s) are to be satisfied. The authorized officer, after considering all relevant factors, if appropriate, may approve the requested variance(s) if it is determined that the proposed alternative(s) meet or exceed the objectives of the applicable minimum standard(s).". Permian Resources feels the break testing the BOPE is such a situation. Therefore, as per 43 CFR 3172.13, Permian Resources submits this request for the variance.

Supporting Documentation

The language used in 43 CFR 3172 became effective on December 19, 1988 and has remained the standard for regulating BLM onshore drilling operations for over 30 years. During this time, there have been significant changes in drilling technology. The BLM continues to use the variance request process to allow for the use of modern technology and acceptable engineering practices that have arisen since 43 CFR 3172 was originally released. The Permian Resources drilling rig fleet has many modern upgrades that allow the intact BOP stack to be moved between well slots on a multi-well pad, as well as, wellhead designs that incorporate quick connects facilitating release of the BOP from the wellhead without breaking any BOP stack components apart. These technologies have been used extensively offshore, and other regulators, API, and many operators around the world have endorsed break testing as safe and reliable.

Figure 1: Winch System attached to BOP Stack

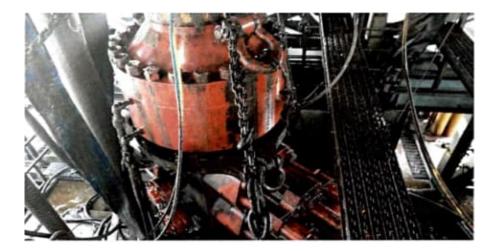


Figure 2: BOP Winch System



American Petroleum Institute (API) standards, specification and recommended practices are considered the industry standard and are consistently utilized and referenced by the industry. 43 CFR 3172 recognizes API recommended Practices (RP) 53 in its original development. API Standard 53, Well Control Equipment Systems for Drilling Wells (Fifth Edition, December 2018, Annex C, Table C.4) recognizes break testing as an acceptable practice. Specifically, API Standard 53, Section 5.3.7.1 states "A pressure test of the pressure containing component shall be performed following the disconnection or repair, limited to the affected component." See Table C.4 below for reference.

	Pressure Test-Low	Pressure Test—High Pressure**					
Component to be Pressure Tested	Pressure** psig (MPa)	Change Out of Component, Elastomer, or Ring Gasket	No Change Out of Component, Elastomer, or Ring Gasket				
Annular preventer®	250 to 350 (1.72 to 2.41)	RWP of annular preventer	MASP or 70% annular RWP, whichever is lower.				
Fixed pipe, variable bore, blind, and BSR preventers∞	250 to 350 (1.72 to 2.41)	RWP of ram preventer or wellhead system, whichever is lower	ЧТР				
Choke and kill line and BOP side outlet valves below ram preventers (both sides)	250 to 350 (1.72 to 2.41)	RWP of side outlet valve or wellhead system, whichever is lower	ITP				
Choke manifold—upstream of chokes*	250 to 350 (1.72 to 2.41)	RWP of ram preventers or wellhead system, whichever is lower	ITP				
Choke manifold—downstream of chokes*	250 to 350 (1.72 to 2.41)	RWP of valve(s), line(s), or M whichever is lower	ASP for the well program,				
Kelly, kelly valves, drill pipe safety valves, IBOPs	250 to 350 (1.72 to 2.41)	MASP for the well program					
No visible leaks. The pressure shall remain stable ⁶ Annular(s) and VBR(s) shall be pre ⁷ For pad drilling operations, moving pressure-controlling connections ⁸ For surface offshore operations, th	ssure tested on the largest and sm: from one wellhead to another within when the integray of a pressure set in BOPs shall be pressure test land operations, the ram BOPs sha	ressure shall not decrease below the allest OD drill pipe to be used in well in the 21 days, pressure testing is req al is broken. Ted with the ram locks engaged and ill be pressure tested with the ram lo	program. ured for pressure-containing an the closing and locking pressur				

The Bureau of Safety and Environmental Enforcement (BSEE), Department of Interior, has also utilized the API standards, specification and best practices in the development of its offshore oil and gas regulations and incorporates them by reference within its regulations.

Break testing has been approved by the BLM in the past with other operators based on the detailed information provided in this document.

Permian Resources feels break testing and our current procedures meet the intent of 43 CFR 3172 and often exceed it. There has been no evidence that break testing results in more components failing than seen on full BOP tests. Permian Resources internal standards require complete BOPE tests more often than that of 43 CFR 3172 (every 21 days). In addition to function testing the annular, pipe rams and blind rams after each BOP nipple up, Permian Resources performs a choke drill with the rig crew prior to drilling out every casing shoe. This is additional training for the rig crew that exceeds the requirements of 43 CFR 3172.

Procedures

1) Permian Resources will use this document for our break testing plan for New Mexico Delaware Basin. The summary below will be referenced in the APD or Sundry Notice and receive approval prior to implementing this variance.

2) Permian Resources will perform BOP break testing on multi-wells pads where multiple intermediate sections can be drilled and cased within the 21-day BOP test window.

a)A full BOP test will be conducted on the first well on the pad.

b)The first intermediate hole section drilled on the pad will be the deepest. All the remaining hole sections will be the same formation depth or shallower.

c) A full BOP test will be required if the intermediate hole section being drilled has a MASP over 5M.

d) A full BOP test will be required prior to drilling any production hole.

3) After performing a complete BOP test on the first well, the intermediate hole section will be drilled and cased, two breaks would be made on the BOP equipment.

a) Between the HCV valve and choke line connection

b)Between the BOP quick connect and the wellhead

4) The BOP is then lifted and removed from the wellhead by a hydraulic system.

5) After skidding to the next well, the BOP is moved to the wellhead by the same hydraulic system and installed.

6) The connections mentioned in 3a and 3b will then be reconnected.

7) Install test plug into the wellhead using test joint or drill pipe.

8) A shell test is performed against the upper pipe rams testing the two breaks.


9) The shell test will consist of a 250 psi low test and a high test to the value submitted in the APD or Sundry (e.g. 5,000 psi or 10,000psi).

10) Function tests will be performed on the following components: lower pipe rams, blind rams, and annular.

11) For a multi-well pad the same two breaks on the BOP would be made and on the next wells and steps 4 through 10 would be repeated.

12) A second break test would only be done if the intermediate hole section being drilled could not be completed within the 21 day BOP test window.

Note: Picture below highlights BOP components that will be tested during batch operations

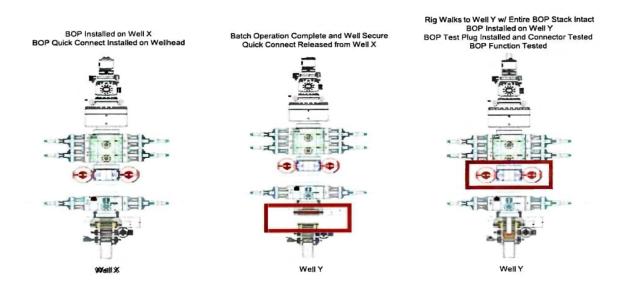

Summary

A variance is requested to ONLY test broken pressure seals on the BOP equipment when moving from wellhead to wellhead which is in compliance with API Standard 53. API Standard 53 states, that for pad drilling operations, moving from one wellhead to another within 21 days, pressure testing is required for pressure-containing and pressure-controlling connections when the integrity of a pressure seal is broken.

The BOP will be secured by a hydraulic carrier or cradle. The BLM will be contacted if a Well Control

event occurs prior to the commencement of a BOPE Break Testing operation.


Based on public data and the supporting documentation submitted herein to the BLM, we will request permission to ONLY retest broken pressure seals if the following conditions are met:

1) After a full BOP test is conducted on the first well on the pad.

2) The first intermediate hole section drilled on the pad will be the deepest. All the remaining hole sections will be the same depth or shallower.

3) A full BOP test will be required if the intermediate hole section being drilled has a MASP over 5M.

4) A full BOP test will be required prior to drilling the production hole.

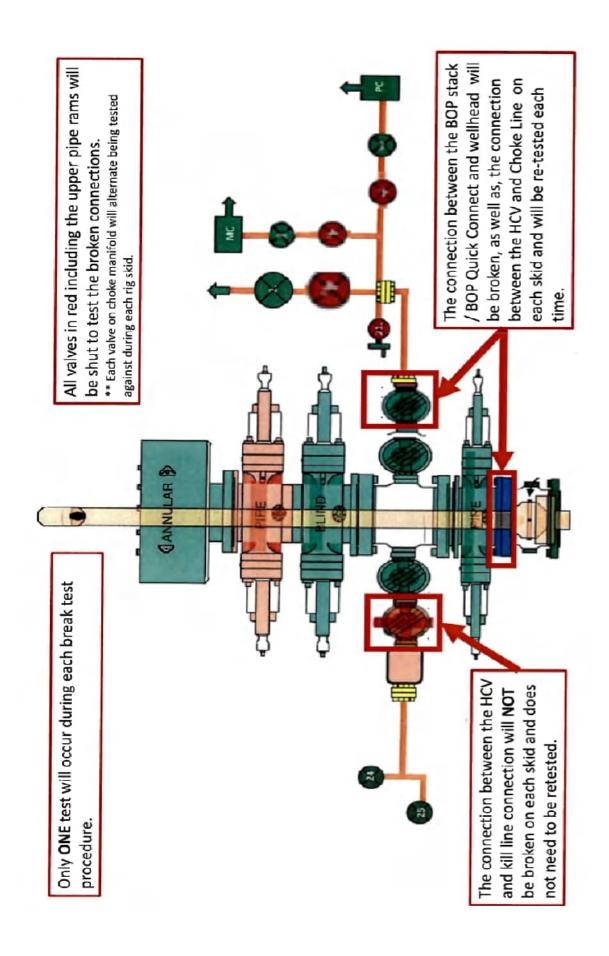

Permian Resources Multi-Well Pad Batch Drilling Procedure

<u>Surface Casing</u> - PR intends to Batch set all surface casing to a depth approved in the APD. Surface Holes will be batch drilled by a rig. Appropriate notifications will be made prior to spudding the well, running and cementing casing and prior to skidding to the rig to the next well on pad.

- 1. Drill Surface hole to Approved Depth with Rig and perform wellbore cleanup cycles. Trip out and rack back drilling BHA.
- 2. Run and land planned surface casing see Illustration 1-1 Below to depth approved in APD.
- 3. Set packoff and test to 5k psi
- 4. Offline Cement
- 5. Install wellhead with pressure gauge and nightcap. Nightcap is shown on final wellhead Stack up Illustration #2-2.
- 6. Skid Rig to adjacent well to drill Surface hole.
- Surface casing test will be performed by the rig in order to allow ample time for Cement to develop 500psi compressive strength. Casing test to 0.22 psi/ft or 1500 psi whichever is greater - not to exceed 70% casing burst.

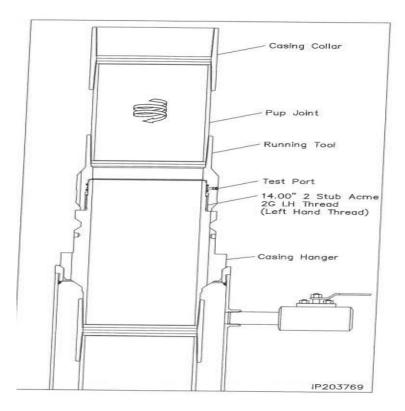


Illustration 1-1

<u>Intermediate Casing</u> – PR intends to Batch set all intermediate casing strings to a depth approved in the APD. Intermediate Holes will be batch drilled by the rig. Appropriate notifications will be made prior to testing BOPE, and prior to running/cementing all casing strings.

- 1. Rig will remove the nightcap and install and test BOPE.
- 2. Test Surface casing per COA WOC timing (.22 psi/ft or 1500 psi whichever is greater) not to exceed 70% casing burst. Cement must have achieved 500psi compressive strength prior to test.
- 3. Install wear bushing then drill out surface casing shoe-track plus 20' and conduct FIT to minimum of the MW equivalent anticipated to control the formation pressure to the next casing point.
- 4. Drill Intermediate hole to approved casing point. Trip out of hole with BHA to run Casing.
- 5. Remove wear bushing then run and land Intermediate Casing with mandrel hanger in wellhead.
- 6. Cement casing to surface with floats holding.
- 7. Washout stack then run wash tool in wellhead and wash hanger and pack-off setting area.
- 8. Install pack-off and test void to 5,000 psi for 15 minutes. Nightcap shown on final wellhead stack up illustration 2-2 on page 3.
- 9. Test casing per COA WOC timing (.22 psi/ft or 1500 psi whichever is greater) not to exceed 70% casing burst. Cement must have achieved 500psi compressive strength prior to test.
- 10. Install nightcap skid rig to adjacent well to drill Intermediate hole.


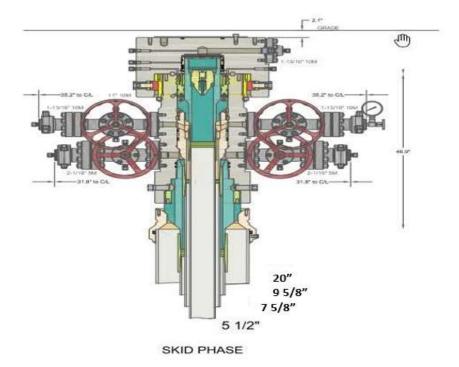


Illustration 2-2


<u>Production Casing</u> – PR intends to Batch set all Production casings with Rig. Appropriate notifications will be made prior Testing BOPE, and prior to running/cementing all casing strings.

- 1. Drilling Rig will remove the nightcap and install and test BOPE.
- 2. Install wear bushing then drill Intermediate shoe-track plus 20' and conduct FIT to minimum MW equivalent to control the formation pressure to TD of well.
- 3. Drill Vertical hole to KOP Trip out for Curve BHA.
- 4. Drill Curve, landing in production interval Trip for Lateral BHA.
- 5. Drill Lateral / Production hole to Permitted BHL, perform cleanup cycles and trip out to run Production Casing.
- 6. Remove wear bushing then run Production casing to TD landing casing mandrel in wellhead.
- 7. Cement Production string with floats holding.
- 8. Run in with wash tool and wash wellhead area install pack-off and test void to 5,000psi for 15 minutes.
- 9. Install BPV in Production mandrel hanger Nipple down BOPE and install nightcap.
- 10. Test nightcap void to 5,000 psi for 30 minutes per illustration 2-2
- 11. Skid rig to adjacent well on pad to drill production hole.

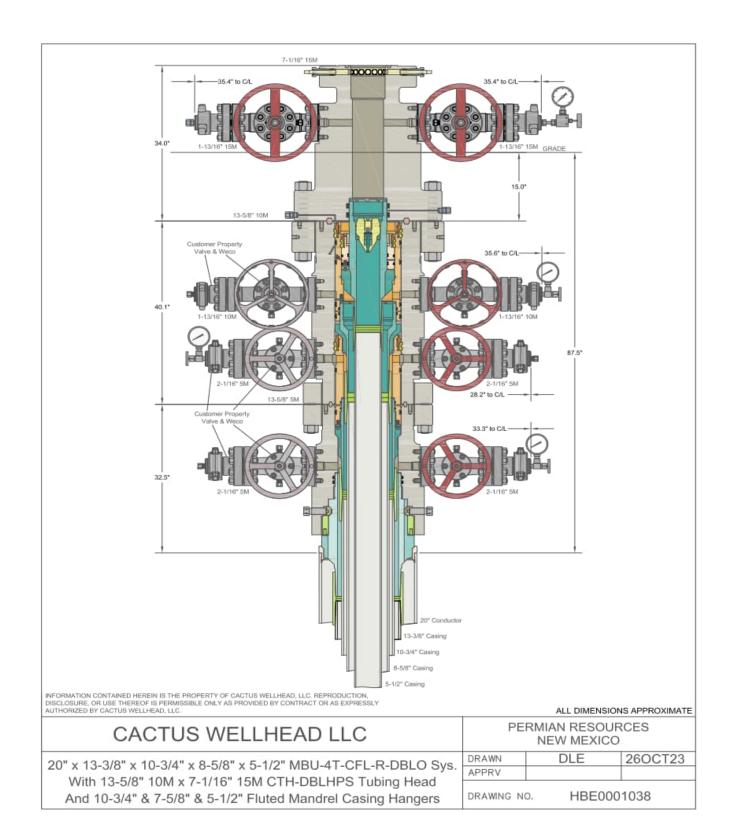


Permian Resources Offline Cementing Procedure Surface & Intermediate Casing


- 1. Drill hole to Total Depth with Rig and perform wellbore cleanup cycles.
- 2. Run and casing to Depth.
- 3. Land casing with mandrel.
- 4. Circulate 1.5 csg capacity.
- 5. Flow test Confirm well is static and floats are holding.
- 6. Set Annular packoff and pressure test. Test to 5k.
- 7. Nipple down BOP and install cap flange.
- 8. Skid rig to next well on pad
- 9. Remove cap flange (confirm well is static before removal)
 - a) If well is not static use the casing outlet valves to kill well
 - b) Drillers method will be used in well control event
 - c) High pressure return line will be rigged up to lower casing valve and run to choke manifold to control annular pressure
 - d) Kill mud will be circulated once influx is circulated out of hole
 - e) Confirm well is static and remove cap flange to start offline cement operations
- 10. Install offline cement tool.
- 11. Rig up cementers.
- 12. Circulate bottoms up with cement truck
- 13. Commence planned cement job, take returns through the annulus wellhead valve
- 14. After plug is bumped confirm floats hold and well is static
- 15. Rig down cementers and equipment
- 16. Install night cap with pressure gauge to monitor.

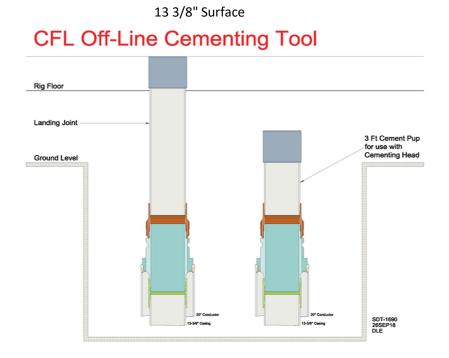


Intermediate

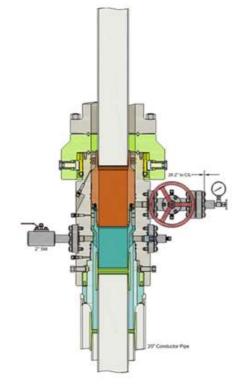


Run 7 5/8" Casing Land Casing on 7 5/8" Mandrel Hanger Cement 7 5/8" Casing Retrieve Running Tool

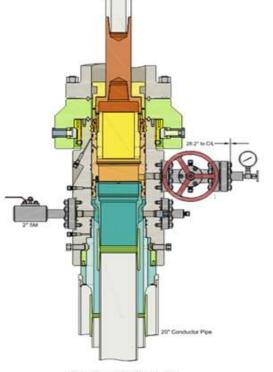

Run 9 5/8" Packoff Test Upper and Lower Seals Engage Lockring Retrieve Running Tool

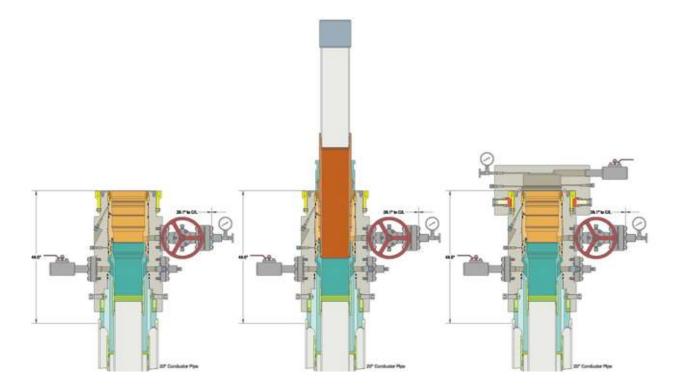



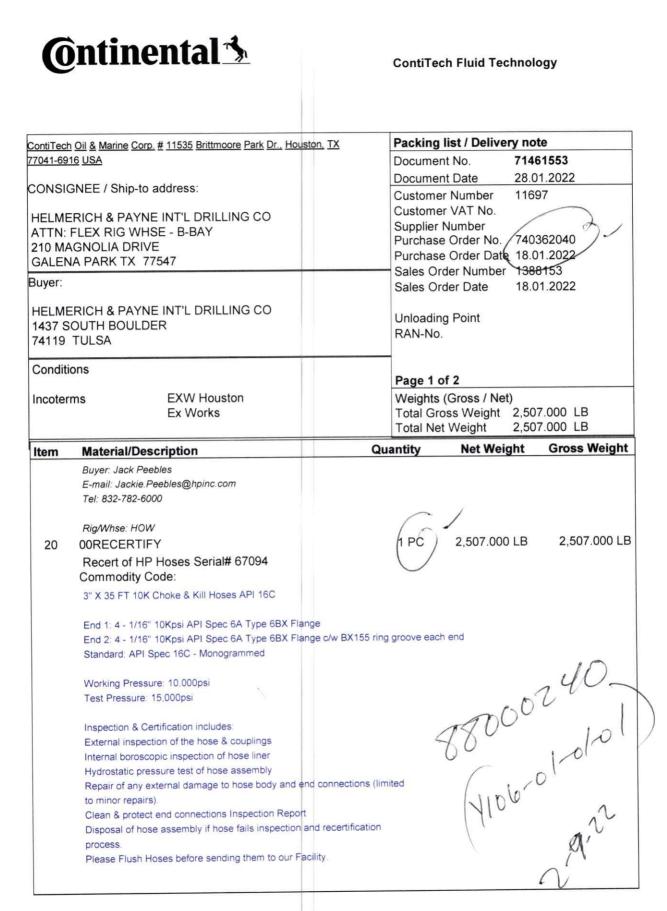

ContiTech Rubber Industrial Kft. H-6728 Szeged Budapesti út 10. P. O. Box 152 Szeged H-6701 Phone:(62)566-700, Fax:(62)566-713 Tax Number: 11087209-2-06 EU Community VAT: HU11087209 Registration No.: Cg. 0609-002502 Registry Court: Csongrád Megyei Cégbíróság

Released to Imaging: 11/11/2024 9:37:26 AM

COMMERZBANK ZRT. (HUF) H-1054 Budapest, Széchenyi rakpart 8. H-1245 Budapest P.O. Box 1070 Account No. 14220108-26830003 IBAN: HUB 1422 0108 2683 0003 0000 0000 SWIFT: COBA HU HXXXX COMMERZBANK AG Hannover (EUR) 30159 Hannover, Theaterstr. 11-12. Account No: 3 066 156 00 Sort Code: 250 400 66. BIC: COBADEFF250 IBAN: DE41250400660306615600

Hydrostatic Test Certificate

-		ContiTech
Certificate Number H100122	COM Order Reference 1388153	Customer Name & Address HELMERICH & PAYNE DRILLING CO
Customer Purchase Order No:	740362040	1434 SOUTH BOULDER AVE TULSA, OK 74119
Project:		USA
Test Center Address	Accepted by COM Inspection	Accepted by Client Inspection
ContiTech Oil & Marine Corp. 11535 Brittmoore Park Drive Houston, TX 77041 USA	Signed: O2/09/22	

We certify that the goods detailed hereon have been inspected as described below by our Quality Management System, and to the best of our knowledge are found to conform the requirements of the above referenced purchase order as issued to ContiTech Oil & Marine Corporation.

Item	Part No.		Description	Qnty	Serial Number	Work. Press. (psi)	Test Press. (psi)	Test Time (minutes)
20	RECERTIFICATION	3'	" ID 10K Choke and Kill Hose x 35ft OAL	1	67094	10,000	15,000	60
	Record In	formation		Pressure	e Chart			
	Start Time	1/27/2022 13:21:21	· 3. 16000	-1				
1	End Time	1/27/2022 14:38:28	1 1				Pressure	
- 1	Interval	00:01:00	14000-					
1	Number	78	12000		01			
- 1	MaxValue	15849		1.et	th Oll &			
	MinValue	-3	10000-	181	151			
	AvgValue	14240		191	12	1		
	RecordName	67094-sh	8000	17	1	61		
	RecordNumber	199	6000	G	10	1		
Ī	Gauge Inf	formation	4000-	11		/	-	
	Model	ADT680			-/			
- 1	SN	21817380014	2000-		ac			
- 1	Range	(0-40000)psi					L	
- 1	Unit	psi						



H₂S CONTINGENCY PLAN

FOR

Permian Resources Corporation Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H Gabagool Fed Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H Eddy County, New Mexico

> 09-27-2024 This plan is subject to updating

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Table of Contents

Sectio	n 1.0 – Introduction
١.	Purpose
II.	Scope & Applicability
Sectio	n 2.0 - Plan Implementation3
١.	Activation Requirements
11.	Emergency Evacuation
III.	Emergency Response Activities
	n 3.0 - Potential Hazardous Conditions4
Sectio	n 4.0 - Notification of H2S Release Event6
١.	Local & State Law Enforcement
11.	General Public
III.	New Mexico Oil Conservation Division
IV.	New Mexico Environment Department
٧.	Bureau of Land Management
Sectio	n 5.0 - Emergency Contact List7
١.	Permian Resources Management Personnel
11.	Eddy County Sheriff
III.	New Mexico State Highway Patrol
IV.	Fire / EMS
٧.	Carlsbad Memorial Hospital
VI.	Emergency Response Contractors
VII.	New Mexico Oil Conservation Division
VIII.	New Mexico Environment Department
IX.	Bureau of Land Management
Х.	Other Agencies
Sectio	n 6.0 – Drilling Location Information9-12
١.	Site Safety Information
II.	Directions to Location
III.	Plat of Location including GPS Coordinates
IV.	Routes of Ingress & Egress (MAP)
۷.	ROE Map
VI.	Residences in ROE
VII.	Public Roads in ROE
Sectio	n 7.0 – Hazard Communication13-15
I.	Physical Characteristics of Hydrogen Sulfide Gas
II.	Human Health Hazards / Toxicological Information
III.	Environmental Hazards
Sectio	n 8.0 - Regulatory Information15-17
I.	OSHA Information
11.	New Mexico Oil Conservation Division & Bureau of Land Management
	n 9.0 - Training Requirements17
Sectio	n 10.0 - Personal Protective Equipment18

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Appendices

I. Appendix A – H₂S SDS

II. Appendix B – SO₂ SDS

Section 1.0 – Introduction

I. Purpose

The purpose of this contingency plan (Plan) is to provide Permian Resources Corporation. (Permian Resources) with an organized plan of action for alerting and protecting Permian Resources employees, the general public, and any potential first responders prior to any intentional release or immediately following the accidental / unintentional release of a potentially hazardous volume / concentration of Hydrogen Sulfide Gas (H2S).

II. Scope & Applicability

This Plan applies to all planned, unplanned, uncontrolled and/or unauthorized releases of hazardous concentrations of H₂S or any associated hazardous byproducts of combustion, occurring at any Permian Resources owned or operated facilities including but not limited to: wells, flowlines, pipelines, tank batteries, production facilities, SWD facilities, compressor stations, gas processing plants, drilling / completions / workover operations, and any other applicable company owned property.

Section 2.0 - Plan Implementation

I. Activation Requirements

In accordance with the requirements of Bureau of Land Management Onshore Order #6 and NMAC 19.15.11, this Plan shall be activated in advance of any authorized, planned, unplanned, uncontrolled, or unauthorized release of a hazardous volume / concentration of H_2S gas, or SO^2 , which could potentially adversely impact the workers, general public or the environment.

II. Emergency Evacuation

In the event of an unplanned, uncontrolled, or unauthorized release of a hazardous volume / concentration of H_2S gas, the first priority is to ensure the safety of the workers and general public. Upon discovery and subsequent determination of an applicable release, which cannot be quickly mitigated, immediately by using 911, notify local authorities to begin the process of alerting the general public, evacuate any residents within the Radius of Exposure (ROE), and limit any general public or employee access to any areas within the ROE of the affected facility.

III. Emergency Response Activities

The purpose of emergency response actions is to take steps to quickly mitigate / stop the ongoing release of the hazardous source of H₂S. Upon discovery of any hazardous release, immediately notify Permian

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Resources management to activate the Emergency Response Team (ERT). Once Permian Resources supervision arrives and assesses the situation, a work plan identifying the proper procedures shall be developed to stop the release.

Section 3.0 - Potential Hazardous Conditions & Response Actions

During a planned or unplanned release of H₂S, there are several hazardous conditions that are presented both to employees, the general public, and emergency responders. These specific hazardous conditions are identified in the tables below.

H2S OPERATING CONDITIONS – RESPONSE ACTIONS TO CONSIDER	✓
H ₂ S CONDITION 1: POTENTIAL DANGER TO LIFE AND HEALTH -> WARNING SI GREEN	GN
H ₂ S concentration <10 ppm detected by location monitors	
General Actions During Condition 1	
Notify Site Supervisor / Permian Resources Person-in-Charge (PIC) of any observed increase in ambient H ₂ S concentrations	
All personnel check safety equipment is in adequate working order & store in accessible location	
Sensitize crews with safety meetings.	
Limit visitors and non-essential personnel on location	
Continuously monitor H ₂ S concentrations and check calibration of sensors	
Ensure H ₂ S scavenger is on location.	
H₂S CONDITION 2: MODERATE DANGER TO LIFE AND HEALTH → WARNING SIGN YELLOW	
H ₂ S concentration >10 ppm and < 30 ppm in atmosphere detected by location monitors:	
General Actions During Condition 2	
Sound H ₂ S alarm and/or display yellow flag.	
Account for on-site personnel	
Upon sounding of an area or personal H ₂ S monitor alarm when 10 ppm is reached, proceed to a safe briefing area upwind of the location immediately (see MA-4 , Figure 5-1).	
Don proper respiratory protection.	
Alert other affected personnel	
If trained and safe to do so undertake measures to control source H2S discharge and eliminate possible ignition sources. Initiate Emergency Shutdown procedures as deemed necessary to correct or control the specific situation.	
Account for on-site personnel at safe briefing area.	
Stay in safe briefing area if not working to correct the situation.	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Keep Site Supervisor / Permian Resources PIC informed. Notify applicable government agencies (**Appendix A**) If off-site impact; notify any neighbors within Radius of Exposure (**ROE**), **Fig 5.11**

Continuously monitor H₂S until readings below 10 ppm.

Evacuated area shall not be re-entered except by trained and authorized personnel utilizing appropriate respiratory protection; or until "all clear" sounded by Permian Resources PIC / Site Supervisor.

H ₂ S CONDITION 3: EXTREME DANGER TO LIFE AND HEALTH \rightarrow WARNING SIGN RED	

> 30 ppm H ₂ S concentration in air detected by location monitors: Extreme danger to life	
General Actions During Condition 3	
Sound H ₂ S alarm and/or display red flag.	
Account for on-site personnel	
Move away from H_2S source and get out of the affected area.	
Proceed to designated safe briefing area; alert other affected personnel.	
Account for personnel at safe briefing area.	
If trained and safe to do so undertake measures to control source H2S discharge and eliminate possible ignition sources. Initiate Emergency Shutdown procedures as deemed necessary to correct or control the specific situation.	
Notify vehicles or situation and divert all traffic away from location.	
Permian Resources Peron-in-Charge will make appropriate community notifications.	
Red warning flag must be on display until the situation has been corrected and the Permian Resources Person-in-Charge determines it is safe to resume operations under Condition 1 .	
Notify management of the condition and action taken. If H ₂ S concentration is increasing and steps to correct the situation are not successful – or at any time if well control is questionable – alert all responsible parties for possible activation of the H ₂ S Contingency Plan. If well control at the surface is lost, determine if situation warrants igniting the well.	
If uncontrolled flow at the surface occurs, the Permian Resources PIC, with approval, if possible, from those coordinating the emergency (as specified in the site-specific H ₂ S Contingency Plan) are responsible for determining if the situation warrants igniting the	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

flow of the uncontrolled well. This decision should be made only as a last resort and in a situation where it is obvious that human life is in danger and there is no hope of controlling the flow under prevailing conditions.	
If the flow is ignited, burning H ₂ S will be converted to sulfur dioxide (SO ₂), which is also highly toxic. Do not assume that area is safe after the flow is ignited. If the well is ignited, evacuation of the area is mandatory, because SO ₂ will remain in low-lying places under no-wind conditions.	
 Keep Site Supervisor / Permian Resources PIC informed. Notify applicable government agencies and local law enforcement (Appendix A) If off-site impact; notify any neighbors within the Radius of Exposure (ROE), see example in Figure 5-11. 	
Continuously monitor H ₂ S until readings fall below 10 ppm.	
Evacuated area shall not be re-entered except by trained and authorized personnel utilizing appropriate respiratory protection; or until "all clear" sounded by Permian Resources PIC / Site Supervisor.	
IF ABOVE ACTIONS CANNOT BE ACCOMPLISHED IN TIME TO PREVENT EXPOSURE TO THE PUBLIC	
Alert public (directly or through appropriate government agencies) who may be subject to potentially harmful exposure levels.	
Make recommendations to public officials regarding blocking unauthorized access to the unsafe area and assist as appropriate.	
Make recommendations to public officials regarding evacuating the public and assist as appropriate.	
Monitor ambient air in the area of exposure (after following abatement measures) to determine when it is safe for re-entry.	

Section 4.0 - Notification of H₂S Release Event

I. Local & State Law Enforcement

Prior to the planned / controlled release of a hazardous concentration of H_2S gas or any associated byproducts of the combustion of H_2S gas, notify local law enforcement agencies regarding the contents of this plan.

In the event of the discovery of an unplanned/uncontrolled release of a hazardous concentration of H₂S gas or any associated byproducts of combustion, immediately notify local and/or state law enforcement agencies of the situation and ask for their assistance.

II. General Public

In the event of a planned or unplanned release of a hazardous concentration of H₂S gas or any associated byproducts of combustion, notify local law enforcement agencies and ask for their assistance in alerting

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

the general public and limiting access to any public roads that may be impacted by such a release.

III. New Mexico Oil Conservation Division

The Permian Resources HSE Department will make any applicable notification to the New Mexico OCD regarding any release of a hazardous concentration of H₂S Gas or any associated byproducts of combustion.

IV. New Mexico Environment Department

The Permian Resources HSE Department will make any applicable notifications to the NMED regarding any release of a hazardous concentration of H₂S gas or any associated byproducts of combustion.

V. Bureau of Land Management

The Permian Resources Regulatory Department will make any applicable notifications to the BLM regarding any release of a hazardous concentration of H_2S gas or any associated byproducts of combustion.

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Section 5.0 - Emergency Contact List

EMERGENCY CONTACT LIST					
P	PERMIAN RESOURCES CORPORATION.				
POSITION	NAME	OFFICE	CELL	ALT PHONE	
	Opera	itions			
Operations Superintendent	Rick Lawson		432.530.3188		
TX Operations Superintendent	Josh Graham	432.940.3191	432.940.3191		
NM Operations Superintendent	Manual Mata	432.664.0278	575.408.0216		
Drilling Manager	Jason Fitzgerald	432.315.0146	318.347.3916		
Drilling Engineer	Parker Simmons	432.400.1038	281.536.9813		
Production Manager	Levi Harris	432.219.8568	720.261.4633		
SVP Development Ops	Clayton Smith	720.499.1416	361.215.2494		
SVP Production Ops	Casey McCain	432.695.4239	432.664.6140		
·	HSE & Re	gulatory	1		
H&S Manager	Adam Hicks	720.499.2377	903.426.4556		
Regulatory Manager	Stephanie Rabadue		432.260.4388		
Environmental Manager	Montgomery Floyd	432-315-0123	432-425-8321		
HSE Consultant	Blake Wisdom		918-323-2343		
	Local, State, & F	ederal Agen	cies		
Eddy County Sheriff		575-887-7551		911	
New Mexico State Highway Patrol		505-757-2297		911	
Carlsbad Fire / EMS		575-885-3125		911	
Carlsbad Memorial Hospital		575-887-4100			
Secorp – Safety Contractor	Ricky Stephens		(325)-262-0707		
New Mexico Oil Conservation Division – District 1 Office – Hobbs, NM.		575-393-6161			
New Mexico Environment Department – District III Office – Hobbs, NM		575-397-6910			
New Mexico Oil Conservation Division – Hobbs, NM	24 Hour Emergency	575-393-6161			
Bureau of Land Management – Carlsbad, NM		575-706-2779			
Eddy County PET Inspector		575-361-2822			
U.S. Fish & Wildlife		502-248-6911			

•

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Section 6.0 – Drilling Location Information

I. Site Safety Information

- 1. Safe Briefing Area
 - a. There shall be two areas that will be designated as "SAFE BRIEFING AREAS". If H_2S is detected in concentrations equal to or in excess of 10 ppm all personnel not assigned emergency duties are to assemble in the designated Safe Briefing area for instructions. These two areas shall be positioned in accessible locations to facilitate the availability of self-contained breathing air devices. The briefing areas shall be positioned no less than 250' from the wellhead and in such locations that at least one briefing area will be upwind from the well at all times.

2. Wind Indicators

- a. 4 Windsocks will be installed at strategic points on the facility.
- 3. Danger Signs
 - a. A warning sign indicating the possible well conditions will be displayed at the location entrance.

DANGER POISONOUS GAS HYDROGEN SULFIDE DO NOT APPROACH IF AMBER LIGHTS ARE FLASHING

- 4. <u>H₂S Detectors and Alarms</u>
 - a. Continuous monitoring type H₂S detectors, capable of sensing a minimum of 5ppm H₂S in air will be located centrally located at the tanks, heater treater, and combustor. Continuous monitoring type SO₂ detector will also be located at the combustor. The automatic H₂S alarm/flashing light will be located at the site entrance and in front of tank battery.
- 5. Safety Trailer
 - a. A safety trailer equipped with an emergency cascade breathing air system with 2 ea. Work/escape packs, a stretcher, 2 OSHA approved full body harnesses, and a 20# Class ABC fire extinguisher shall be available at the site in close proximity to the safe briefing area. The cascade system shall be able to be deployed to the drill floor when needed to provide safe breathing air to the workers as needed.
- 6. <u>Well Control Equipment</u>
 - a. The location shall have a flare line to a remote automatic ignitor and back up flare gun, placed 150' from the wellhead.
 - b. The location shall be equipped with a remotely operated choke system and a mud gas separator.

7. Mud Program

a. Company shall have a mud program that contains sufficient weight and additives to control H_2S .

Permian Resources Corporation	H₂S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

8. <u>Metallurgy</u>


- a. All drill strings, casing, tubing, wellhead, BOP, spools, kill lines, choke manifold and lines, and valves shall be suitable for anticipated H_2S volume and pressure.
- 9. Communication
 - a. The location shall be equipped with a means of effective communication such as a cell phones, intercoms, satellite phones or landlines.

II. Directions to Location

BEGINNING AT THE INTERSECTION OF U.S. HIGHWAY 62 AND U.S. HIGHWAY 285 IN CARLSBAD, PROCEED EAST ON U.S. HIGHWAY 62/180 FOR 2.6 MILES. TURN LEFT ONTO E ORCHARD LN AND TRAVEL 0.7 MILES AND TURN LEFT ON LEASE ROAD. PROCEED TO LOCATION.

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Plat of Location

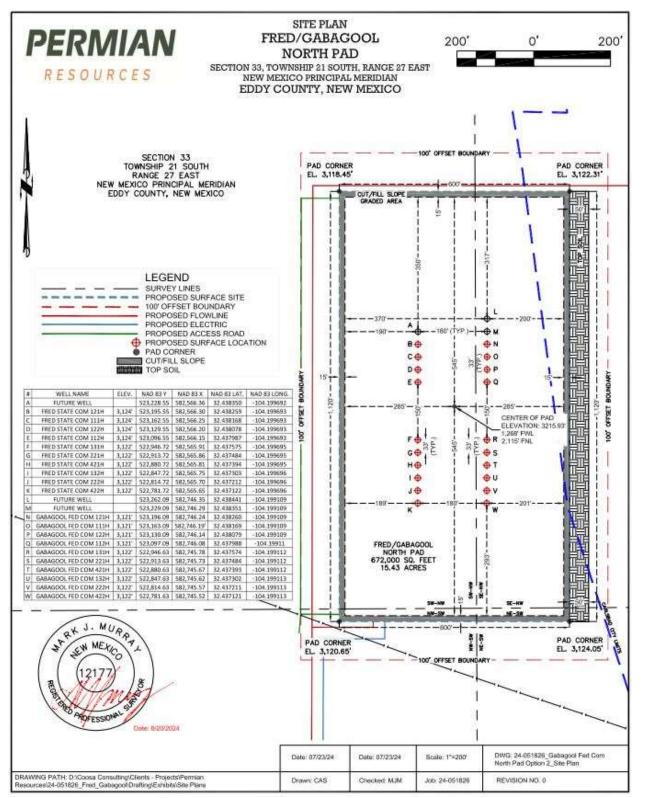

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

1. Routes of Ingress & Egress (MAP)



2. Residences in proximity to the 3000' Radius of Exposure (ROE) (MAP)

There are no residences or public gathering places with the 3000' ROE, 100 PPM, 300 PPM, or 500 PPM ROE.

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Map of 3000' ROE Perimeter



100 PPM, 300 PPM, & 500 PPM Max ROE under worst case scenario

Enter H₂S in PPM	1500	
Enter Gas flow in mcf/day (maximum worst case conditions)	2500	
500 ppm radius of exposure (public road)	<u>105</u>	feet
300 ppm radius of exposure	<u>146</u>	feet
100 ppm radius of exposure (public area)	<u>230</u>	feet

- Location NAD 83 GPS Coordinates *Lat: 32.438350, Long: -104.199692*
- 3. Public Roads in proximity of the Radius of Exposure (ROE)

There are no public roads that would be within the 500 PPM ROE. The closest public road is NM East Canal St, which is 860' from the location.

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Section 7.0 – Hazard Communication

I. Physical Characteristics of Hydrogen Sulfide Gas

Hydrogen sulfide (H₂S) is a colorless, poisonous gas that is soluble in water. It can be present in crude oils, condensates, natural gas and wastewater streams.

 H_2S is heavier than air with a vapor density of 1.189 (air = 1.0); however, H_2S is most often mixed with other gases. These mixtures of H_2S and other gases can be heavier or lighter than air. If the H_2S -containing mixture is heavier, it can collect in low areas such as ditches, ravines, firewalls, and pits; in storage tanks; and in areas of poor ventilation. Please see physical properties in **Table 7.0**.

With H₂S the sense of smell is rapidly lost allowing lethal concentrations to be accumulated without warning. The toxicity of hydrogen sulfide at varying concentrations is indicated in the **Table 7.1**.

Warning: Do not use the mouth-to-mouth method if a victim ingested or inhaled hydrogen sulfide. Give artificial respiration with the aid of a pocket mask equipped with a one-way valve or other proper respiratory medical device.

Table 7.0. Physical Properties of H₂S

Properties of H2S	Description	
Vapor Density > 1 = 1.189 Air = 1	 H2S gas is slightly heavier than air, which can cause it to settle in low places and build in concentration. Produced as a mixture with other gases associated with oil and gas production. 	
Flammable Range 4.3%-46% 43000 ppm – 460000 ppm	 H2S can be extremely flammable / explosive when these concentrations are reached by volume in air. 	

Although H₂S is primarily a respiratory hazard, it is also flammable and forms an explosive mixture at concentrations of 4.3%–46.0% (40,000ppm – 460,000 ppm) by volume in air.

H₂S can be encountered when:

- Venting and draining equipment.
- Opening equipment (separators, pumps, and tanks).
- Opening piping connections ("line breaking").
- Gauging and sampling storage tanks.
- Entering confined spaces.
- Working around wastewater pits, skimmers, and treatment facilities.
- II. Human Health Hazards Toxicological Information

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Table 7.1. Hazards & Toxicity

Concentration	Symptoms/Effects
(ppm)	
0.00011-0.00033 ppm	Typical background concentrations
0.01-1.5 ppm	Odor threshold (when rotten egg smell is first noticeable to some). Odor becomes more offensive at 3-5 ppm. Above 30 ppm, odor described as sweet or sickeningly sweet.
2-5 ppm	Prolonged exposure may cause nausea, tearing of the eyes, headaches or loss of sleep. Airway problems (bronchial constriction) in some asthma patients.
20 ppm	Possible fatigue, loss of appetite, headache, irritability, poor memory, dizziness.
50-100 ppm	Slight conjunctivitis ("gas eye") and respiratory tract irritation after 1 hour. May cause digestive upset and loss of appetite.
100 ppm	Coughing, eye irritation, loss of smell after 2-15 minutes (olfactory fatigue). Altered breathing, drowsiness after 15-30 minutes. Throat irritation after 1 hour. Gradual increase in severity of symptoms over several hours. Death may occur after 48 hours.
100-150 ppm	Loss of smell (olfactory fatigue or paralysis).
200-300 ppm	Marked conjunctivitis and respiratory tract irritation after 1 hour. Pulmonary edema may occur from prolonged exposure.
500-700 ppm	Staggering, collapse in 5 minutes. Serious damage to the eyes in 30 minutes. Death after 30-60 minutes.
700-1000 ppm	Rapid unconsciousness, "knockdown" or immediate collapse within 1 to 2 breaths, breathing stops, death within minutes.
1000-2000 ppm	Nearly instant death

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

III. Environmental Hazards

H₂S and its associated byproducts from combustion presents a serious environmental hazard. Sulphur Dioxide SO₂ is produced as a constituent of flaring H₂S Gas and can present hazards associated, which are similar to H₂S. Although SO₂ is heavier than air, it will be picked up by a breeze and carried downwind at elevated temperatures. Since Sulfur Dioxide is extremely irritating to the eyes and mucous membranes of the upper respiratory tract, it has exceptionally good warning powers in this respect. The following table indicates the toxic nature of the gas. Please see the attached SDS in Appendix B for reference.

SULFUR DIOXIDE TOXICITY		
Concentration Effects		Effects
%SO ₂	PPM	
0.0005	3 to 5	Pungent odor-normally a person can detect SO ₂ in this range.
0.0012	12	Throat irritation, coughing, and constriction of the chest tearing and smarting of eyes.
0.15	150	So irritating that it can only be endured for a few minutes.
0.05	500	Causes a sense of suffocation, even with first breath.

Section 8.0 - Regulatory Information

I. OSHA & NIOSH Information

II. Table 8.0. OSHA & NIOSH H₂S Information

PEL, IDLH, TLV	Description	
NIOSH PEL 10 PPM	 PEL is the Permissible Exposure Limit that an employee may be exposed up to 8 hr / day. 	
OSHA General Industry Ceiling PEL – 20 PPM	 The maximum exposure limit, which cannot be exceeded for any length of time. 	
IDLH 100 PPM	 Immediately Dangerous to Life and Health 	
Permian Resources PEL 10 PPM	 Permian Resources Policy Regarding H2S for employee safety 	

III. New Mexico OCD & BLM – H₂S Concentration Threshold Requirements

New Mexico NMAC 19.15.11 and Onshore Order #6 identify two Radii of Exposure (ROE) that identify potential danger to the public and require additional compliance measures. Permian Resources is required to install safety devices, establish safety procedures and develop a written H₂S contingency plan for sites where the H₂S concentrations are as follows.

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Table 8.1. Calculating H₂S Radius of Exposure

H₂S Radius of Exposure	Description	Control and Equipment Requirements
100 ppm	Distance from a release to where the H ₂ S concentration in the air will dilute below 100ppm	 ROE > 50-ft and includes any part of a "public area" (residence, school, business, etc., or any area that can be expected to be populated). ROE > 3,000-ft
500 ppm	Distance from a release to where the H ₂ S concentration in the air will dilute below 500ppm	ROE > 50-ft and includes any part of a public road (public roads are tax supported roads or any road used for public access or use)

Calculating H₂S Radius of Exposure

The ROE of an H₂S release is calculated to determine if a potentially hazardous volume of H₂S gas at 100 or 500 parts per million (ppm) is within a regulated distance requiring further action. If information about the concentration of H₂S and the potential gas release volume is known, the location of the Muster Areas will be set, and safety measures will be implemented based on the calculated radius of exposure (ROE). NMAC 19.15.11 – Hydrogen Sulfide Safety defines the ROE as the radius constructed with the gas's point of escape as its center and its length calculated by the following Pasquill-Gifford equations:

To determine the extent of the **<u>100 ppm ROE</u>**:

 $x = [(1.589) \text{ (mole fraction H}_2S)(Q)]^{(.6258)}$.

To determine the extent of the **<u>500 ppm ROE</u>**:

 $x = [(0.4546) \text{ (mole fraction H}_2S)(Q)]^{(.6258)}$.

Table 8.2. Calculating H2S Radius of Exposure

ROE Variable	Description	
X =	ROE in feet	
Q =	Max volume of gas released determined to be released in cubic feet per day (ft ³ /d) normalized to standard temperature and pressure, 60°F and 14.65 psia	
Mole fraction H ₂ S =	Mole fraction of H ₂ S in the gaseous mixture released.	

The volume used as the escape rate in determining the ROE is specified in the rule as follows:

- The maximum daily volume rate of gas containing H₂S handled by that system element for which the ROE is calculated.
- For existing gas wells, the current adjusted open-flow rate, or the operator's estimate of the well's capacity to flow against zero back-pressure at the wellhead.

Permian Resources Corporation	H ₂ S Contingency Plan Fred State Com 121H, 111H, 122H,	Eddy County, New Mexico
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

New Mexico Oil Conservation Division & BLM Site Requirements under NMAC 19.15.11 & Onshore Order #6

- Two cleared areas will be designated as Safe Briefing Areas. During an emergency, personnel will assemble in one of these areas for instructions from the Permian Resources Person-in-Charge. Prevailing wind direction should be considered in locating the briefing areas 200' or more on either side of the well head. One area should offset the other at an angle of 45° to 90° with respect to prevailing wind direction to allow for wind shifts during the work period.
- In the event of either an intentional or accidental releases of hydrogen sulfide, safeguards to protect the general public from the harmful effects of hydrogen sulfide must be in place for operations. A summary of the provisions in each of three H₂S ROE cases is included in Table 8.3.
 - **CASE 1** -100 ppm ROE < 50'
 - **CASE 2** 100 ppm ROE is 50' or greater, but < 3000' and does not penetrate public area.
 - **CASE 3** -100 ppm ROE is 50' or greater and penetrates a public area or 500 ppm ROE includes a public road. Also if 100 ppm ROE > 3000' regardless of public area.

NMAC 19.15.11 & BLM COMPLIANCE REQUIREMENTS - DRILLING & PRODUCTION			
PROVISION	CASE 1	CASE 2	CASE 3
H ₂ S Concentration Test	Х	Х	Х
H-9	Х	Х	Х
Training	Х	Х	Х
District Office Notification	Х	Х	Х
Drill Stem Tests Restricted	X*	X*	Х
BOP Test	X*	X*	Х
Materials		Х	Х
Warning and Marker		Х	Х
Security		Х	Х
Contingency Plan			Х
Control and Equipment Safety			Х
Monitors		X**	X**
Mud (ph Control or Scavenger)			X*
Wind Indicators		X**	X
Protective Breathing Equipment		X**	X
Choke Manifold, Secondary Remote Control, and Mud-Gas Separator			X
Flare Stacks			X*

Table 8.3. NMAC 19.15.11 Compliance Requirements Drilling & Production

Section 9.0 - Training Requirements

Training

The following elements are considered a minimum level of training for personnel assigned to operations who may encounter H₂S as part of routine or maintenance work.

• The hazards, characteristics, and properties of hydrogen sulfide (H₂S) and (SO₂).

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

- Sources of H₂S and SO₂.
- Proper use of H₂S and SO₂ detection methods used at the workplace.
- Recognition of, and proper response to, the warning signals initiated by H₂S and SO₂ detection systems in use at the workplace.
- Symptoms of H₂S exposure; symptoms of SO₂ exposure
- Rescue techniques and first aid to victims of H₂S and SO₂ exposure.
- Proper use and maintenance of breathing equipment for working in H₂S and SO₂ atmospheres, as appropriate theory and hands-on practice, with demonstrated proficiency (29 *CFR* Part 1910.134).
- Workplace practices and relevant maintenance procedures that have been established to protect personnel from the hazards of H₂S and SO₂.
- Wind direction awareness and routes of egress.
- Confined space and enclosed facility entry procedures (if applicable).
- Emergency response procedures that have been developed for the facility or operations.
- Locations and use of safety equipment.
- Locations of safe briefing areas.

Refresher training will be conducted annually.

Section 10.0 - Personal Protective Equipment

I. <u>Personal H₂S Monitors</u>

All personnel engaged in planned or unplanned work activity to mitigate the release of a hazardous concentration of H₂S shall have on their person a personal H2S monitor.

- II. Fixed H₂S Detection and Alarms
 - 4 channel H₂S monitor
 - 4 wireless H₂S monitors
 - H₂S alarm system (Audible/Red strobe)
 - Personal gas monitor for each person on location
 - Gas sample tubes

III. Flame Resistant Clothing

All personnel engaged in planned or unplanned work activity associated with this Plan shall have on the appropriate level of FRC clothing.

IV. <u>Respiratory Protection</u>

The following respiratory protection equipment shall be available at each drilling location.

- Working cascade system available on rig floor and pit system & 750' of air line hose
- Four (4) breathing air manifolds
- Four (4) 30-minute rescue packs

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

- Five (5) work/Escape units
- Five (5) escape units
- One (1) filler hose for the work/escape/rescue units

Supplied air (airline or SCBA) respiratory protection against hydrogen sulfide exposure is required in the following situations:

- When routine or maintenance work tasks involve exposure to H₂S concentrations of 10 ppm or greater.
- When a fixed location area monitor alarms, and re-entry to the work area is required to complete a job.
- When confined spaces are to be entered without knowledge of H₂S levels present, or if initial measurements are to be taken of H₂S levels.
- During rescue of employees suspected of H₂S overexposure.
- For specific tasks identified with significant exposure potential and outlined in local program guidelines.
- All respiratory equipment for hydrogen sulfide must be of the supplied-air type, equipped with pressure-demand regulators and operated in the pressure-demand mode only. This is the only type of respiratory protection recommended for hydrogen sulfide application. Equipment should be approved by NIOSH/MSHA or other recognized national authority as required. If airline units are used, a five-minute egress bottle should also be carried.
- Gas masks or other air-purifying respirators MUST NEVER BE USED FOR HYDROGEN SULFIDE due to the poor warning properties of the gas.
- Use of respiratory protection should be accompanied by a written respiratory protection program.

Permian Resources Corporation	H ₂ S Contingency Plan Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H,	Eddy County, New Mexico
	422H Gabagool Fed Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H	

Appendix A H₂S SDS

•

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Hydrogen sulfide Safety Data Sheet E-46

Hydrogen sulfide Safety Data Sheet E-4611 according to the Hazardous Products Regulation (February 11, 2015) Date of issue: 10-15-1979 Revision date: 08-10-2016 Supersedes: 10-15-2013

SECTION 1: Identification	
1.1. Product identifier	
Product form	: Substance
Name	: Hydrogen suffide
CAS No	: 7783-06-4
Formula	: H2S
Other means of identification	: Hydrogen sulfide
Product group	Core Products
1.2. Recommended use and restri	ctions on use
Recommended uses and restrictions	: Industrial use Use as directed
1.3. Supplier	
Praxair Canada inc. 1200 – 1 City Centre Drive Mississauga - Canada L5B 1M2 T 1-905-803-1600 - F 1-905-803-1682 www.praxair.ca	
1.4. Emergency telephone number	(
Emergency number	: 1-800-383-0042 Call emergency number 24 hours a day only for spills, leaks, fire, exposure, or accidents involving this product. For routine information, contact your supplier or Praxair sales representative.
SECTION 2: Hazard identification	on:
2.1. Classification of the substance	
Concerning the second sec	e or mixing .
GHS-CA classification	
GHS-CA classification Flam. Gas 1 H220 Liquefied gas H280 Acute Tox. 2 (Inhalation: gas) H330	
GHS-CA classification Flam. Gas 1 H220 Liquefied gas H280 Acute Tox. 2 (Inhalation: gas) H330 STOT SE 3 H335	
GHS-CA classification Flam. Gas 1 H220 Liquefied gas H280 Acute Tox. 2 (inhalation: gas) H330 STOT SE 3 H335 2.2. GHS Label elements, includin	
GHS-CA classification Flam. Gas 1 H220 LiqueFled gas H280 Acute Tox. 2 (Inhalation: gas) H330 STOT SE 3 H336 Z.2. GHS Label elements, includin GHS-CA labetling	
GHS-CA classification Flam. Gas 1 H220 Liquefied gas H280 Acute Tox. 2 (Inhalation: gas) H330 STOT SE 3 H335	
GHS-CA classification Flam. Gas 1 H220 Liquefied gas H280 Acute Tox. 2 (inhalation: gas) H330 STOT SE 3 H335 Z.2. GHS Label elements, includin GHS-CA labelling Hazard pictograms	g precautionary statements $i \longrightarrow i \longrightarrow$

This document is only controlled while on the Prizzer Canada Inc. website and a copy of this controlled version is available for download. Praxer cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

EN (English)

SDS ID : E-4611

1/9

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

PRAXAIR	Hydrogen s	et E-4611		
	according to the Hazardous Products Regulation (February 11, 2015)			
	Date of issue: 10-15-1979	Revision date: 08-1	0-2016	Supersedes: 10-15-2013
	Avoid release Wear protection Leaking gas I In case of lea Store locked Dispose of co Protect from Close valve a Do not open When returni	e only outdoors or in a to the environment ive gloves, protective of fire: Do not extinguish, ikage, eliminate all ign up ontents/container in ac	clothing, eye , unless leak ition source coordance wi t temperatur en empty to equipmen k tight valve	e protection, respiratory protection, and/or face s can be stopped safely s ith container Supplier/owner instructions e exceeds 52°C (125°F) t prepared for use outlet cap or plug
.3. Other hazards				
Other hazards not contributing to the classification	: Contact with	liquid may cause cold	burns/frostb	ite.
2.4. Unknown acute toxicity (G	HS-CA)			
No data available	and the second se			
SECTION 3: Composition/inf	ormation on ingradu	ante		
1.1 Substances	of mation of myreure	-111.0		
	Lease the C	L an anna a	Language and	
Name Hydrogen suffide	CAS No. (CAS No) 7783-06-4	% (Vol.)	the second se	n Name (synonyms) sulfide (H2S) / Hydrogen sulphide / Sulfur hydride /
(Main constituent)	ferendi (199-98-3			I hydrogen / Dihydrogen sulphide / Hydrogensulfide
3.2. Mixtures				
Not applicable				
SECTION 4: First-aid measur				
4.1. Description of first aid mea				
First-aid measures after inhalation	A REAL PROPERTY AND A REAL	esh air and keen at re	st in a positi	on comfortable for breathing. If not breathing,
				trained personnel should give oxygen. Call a
	and the second second second second		12. La 12. La 12. La 12.	liquid, immediately warm frostbite area with
First-aid measures after skin contact	warm water n skin. Maintai returned to th	not to exceed 105°F (4 in skin warming for at l ne affected area, In car	I1°C). Wate least 15 min se of massiv	r temperature should be tolerable to normal
	warm water n skin. Maintai returned to th with warm wa Immediately away from th	to to exceed 105°F (4 in skin warming for at l a affected area. In car ater. Seek medical eva flush eyes thoroughly	H°C). Wate least 15 min se of massiv aluation and with water fo	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as soon as possible.
First-aid measures after eye contact	warm water n skin. Maintai returned to th with warm wa Immediately away from th ophthalmolog	to to exceed 105°F (4 in skin warming for at l e affected area. In car ater. Seek medical eva flush eyes thoroughly e eyeballis to ensure th	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surface	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as soon as possible, or at least 15 minutes. Hold the eyelids open and ses are flushed thoroughly. Contact an
First-aid measures after eye contact First-aid measures after ingestion	warm water n skin. Maintai returned to th with warm wa i Immediately i away from th ophthalmolog i Ingestion is n	not to exceed 105°F (4 in skin warming for all e affected area. In ca ater. Seek medical eve flush eyes thoroughly e eyeballs to ensure th jat immediately, not considered a poten	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surface	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as scon as possible, or at least 15 minutes. Hold the eyelids open and res are flushed thoroughly. Contact an
First-aid measures after eye contact First-aid measures after ingestion 5.2. Most important symptoms	warm water n skin. Maintai returned to th with warm wa i Immediately i away from th ophthalmolog i Ingestion is n	not to exceed 105°F (4 in skin warming for all e affected area. In ca ater. Seek medical eve flush eyes thoroughly e eyeballs to ensure th jat immediately, not considered a poten	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surface	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as scon as possible, or at least 15 minutes. Hold the eyelids open and res are flushed thoroughly. Contact an
First-aid measures after eye contact First-aid measures after ingestion 4.2. Most important symptoms No additional information available	warm water n skin. Maintai returned to th with warm wa i Immediately f away from th ophthalmolog : Ingestion is n and effects (acute and de	not to exceed 105°F (4 in skin warming for all e affected area. In ca ater. Seek medical eva flush eyes thoroughly e eyeballs to ensure th jist immediately, not considered a poten relayed)	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surface	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as scon as possible, or at least 15 minutes. Hold the eyelids open and res are flushed thoroughly. Contact an
First-aid measures after eye contact First-aid measures after ingestion 4.2. Most important symptoms No additional information available 4.3. Immediate medical attention	warm water n skin. Maintai returned to th with warm wa : Immediately f away from th ophthalmolog : Ingestion is n and effects (acute and de on and special treatment.	not to exceed 105°F (4 in skin warming for all e affected area. In ca atter. Seek medical eva flush eyes thoroughly e eyeballs to ensure th jist immediately, not considered a poten elayed) If necessary	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surfac titial route of	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as soon as possible, or at least 15 minutes. Hold the eyelids open and ses are flushed thoroughly. Contact an
First-aid measures after eye contact First-aid measures after ingestion 4.2. Most important symptoms No additional information available 4.3. Immediate medical attention Other medical advice or treatment	warm water n skin. Maintai returned to th with warm wa : Immediately I away from th ophthalmolog : Ingestion is n and effects (acute and de on and special treatment, : Obtain medic	not to exceed 105°F (4 in skin warming for all e affected area. In ca atter. Seek medical eva flush eyes thoroughly e eyeballs to ensure th jist immediately, not considered a poten elayed) If necessary	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surfac titial route of	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as scon as possible, or at least 15 minutes. Hold the eyelids open and ses are flushed thoroughly. Contact an exposure,
First-aid measures after eye contact First-aid measures after ingestion 4.2. Most important symptoms No additional information available 4.3. Immediate medical attention Other medical advice or treatment SECTION 5: Fire-fighting measures	warm water n skin. Maintai returned to th with warm wa : Immediately i away from th ophthalmolog : Ingestion is n and effects (acute and de on and special treatment, : Obtain medic	not to exceed 105°F (4 in skin warming for all e affected area. In ca atter. Seek medical eva flush eyes thoroughly e eyeballs to ensure th jist immediately, not considered a poten elayed) If necessary	I1°C). Wate least 15 min se of massiv aluation and with water for hat all surfac titial route of	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as scon as possible, or at least 15 minutes. Hold the eyelids open and ses are flushed thoroughly. Contact an exposure,
First-aid measures after eye contact First-aid measures after ingestion 4.2. Most important symptoms No additional information available 4.3. Immediate medical attention Other medical advice or treatment SECTION 5: Fire-fighting measures 5.1. Suitable extinguishing measures	warm water n skin. Maintai returned to th with warm wa : Immediately i away from th ophthalmolog : Ingestion is n and effects (acute and de on and special treatment, : Obtain medic asures:	not to exceed 105°F (4 in skin warming for at li e affected area. In car ater. Seek medical eva flush eyes thoroughly e eyeballs to ensure the jist immediately, iot considered a poten etayed) if necessary cal assistance. Treat w	(1°C). Wate least 15 min se of massivaluation and with water for hat all surfact tial route of hith corticoster with corticoster	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove dothing while showering treatment as soon as possible, or at least 15 minutes. Hold the eyelids open and res are flushed thoroughly. Contact an exposure, eroid spray as soon as possible after inhalation.
No additional information available 4.3. Immediate medical attention Other medical advice or treatment SECTION 5: Fire-fighting means	warm water n skin. Maintai returned to th with warm wa : Immediately i away from th ophthalmolog : Ingestion is n and effects (acute and de on and special treatment, : Obtain medic asures:	not to exceed 105°F (4 in skin warming for all e affected area. In car ater. Seek medical eva flush eyes thoroughly e eyeballs to ensure the jist immediately, not considered a poten elayed) if necessary all assistance. Treat w de, Dry chemical, Wat	(1°C). Wate least 15 min se of massivaluation and with water for hat all surfact tial route of hith corticoster with corticoster	r temperature should be tolerable to normal utes or until normal coloring and sensation have re exposure, remove clothing while showering treatment as soon as possible. or at least 15 minutes. Hold the eyelids open and ses are flushed thoroughly. Contact an exposure.

5.2. Unsuitable extinguishing media

No additional information available

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

PRAXAIR	according to the Hazardous P	IL E-4011 roducts Regulation (February 11, 201)	15)
	Date of issue: 10-15-1979	Revision date: 08-10-2016	Supersedes: 10-15-2013
5.3. Specific hazards arising fro	om the hazardous product	t.	
Fire hazard	flames, Flamn Vapors can be equipment, st point, Explosit	nable vapors may spread from le e ignited by pilot lights, other flam atic discharge, or other ignition se	r leaking gas catches fire, do not extinguish ak, creating an explosive reignition hazard, ees, smoking, sparks, heaters, electrical purces at locations distant from product handling re entering an area, especially a confined area, ice.
Explosion hazard	: EXTREMELY	FLAMMABLE GAS. Forms expl	osive mixtures with air and oxidizing agents.
Reactivity	: No reactivity h	azard other than the effects desc	cribed in sub-sections below.
Reactivity in case of fire	: No reactivity h	azard other than the effects desc	cribed in sub-sections below.
5.4. Special protective equipme	ent and precautions for fir	e-lighters	
Firefighting instructions		xic, flammable liquefied gas	
	and protective flow of gas if s safe to do so.	clothing. Immediately cool conta afe to do so, while continuing co	Use self-contained breathing apparatus (SCBA) liners with water from maximum distance. Stop oling water spray. Remove ignition sources if fire if safe to do so. On-site fire brigades must regulations.
Special protective equipment for fire fig	hters : Standard prot fighters.	ective clothing and equipment (S	elf Contained Breathing Apparatus) for fire
Other information	: Containers an by TC.).	e equipped with a pressure relief	device. (Exceptions may exist where authorized
SECTION 6: Accidental releas	AD ADMINISTRATION OF A DECIMAL OF		
		Attrancy procedures	
6.1. Personal precautions, prot	ective equipment and emi : DANGER! To	xic, flammable liquefied gas . F	Forms explosive mixtures with air and oxidizing m danger area. Use self-contained breathing
6.1. Personal precautions, prot General measures	ective equipment and emu : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin	xic, flammable liquefied gas. If diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks on g area, especially confined areas	Forms explosive mixtures with air and oxidizing m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so liated area. Flammable vapors may spread from r flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device.
6.1. Personal precautions, prot General measures 6.2. Methods and materials for	ective equipment and emu : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin	xic, flammable liquefied gas. If diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks on g area, especially confined areas	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so liated area. Flammable vapors may spread from r flames. Explosive atmospheres may linger.
6.1. Personal precautions, prot General measures	ective equipment and ema : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contaminating contaminating	xic, flammable liquefied gas. If diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks or ig area, especially confined areas up ease. Reduce vapour with fog or the surrounding environment. P	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so liated area. Flammable vapors may spread from r flames. Explosive atmospheres may linger.
6.1. Personal precautions, prot General measures 6.2. Methods and materials for Methods for cleaning up	ective equipment and emu : DANGER! To agents. Imme apparatus why fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contents/conta supplier for an	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks on g area, especially confined areas to person and the special special special person and the special special special special the surrounding environment. P ainer in accordance with local/reg	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so listed area. Flammable vapors may spread from r flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device.
6.1. Personal precautions, prot General measures 6.2. Methods and materials for Methods for cleaning up 6.3. Reference to other section	ective equipment and emu : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contents/conta supplier for an	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks or g area, especially confined areas to person the surrounding environment. P ainer in accordance with local/reg ny special requirements,	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so listed area. Flammable vapors may spread from r flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device.
6.1. Personal precautions, prot General measures 6.2. Methods and materials for- Methods for cleaning up 6.3. Reference to other section For further information refer to section	ective equipment and emu : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contents/cont supplier for ar s on 8: Exposure controls/p	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks or g area, especially confined areas to person the surrounding environment. P ainer in accordance with local/reg ny special requirements,	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so listed area. Flammable vapors may spread from r flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device.
6.1. Personal precautions, prot General measures 6.2. Methods and materials for Methods for cleaning up 6.3. Reference to other section For further information refer to section SECTION 7: Handling and sto	ective equipment and ema : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contents/conti supplier for area on 8: Exposure controls/p prage	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks or g area, especially confined areas to person the surrounding environment. P ainer in accordance with local/reg ny special requirements,	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so listed area. Flammable vapors may spread from r flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device.
E.1. Personal precautions, prot General measures Methods and materials for Methods for cleaning up C.3. Reference to other section For further information refer to section SECTION 7: Handling and sto 7.1. Precautions for safe handli	ective equipment and ema : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contents/conti supplier for area on 8: Exposure controls/p prage ing	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks o ing area, especially confined areas of up ease. Reduce vapour with fog or the surrounding environment. P ainer in accordance with local/reg y special requirements.	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with ad liquid with water. Shut off flow if safe to do so liated area. Flammable vapors may spread from r flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device. fine water spray. Prevent waste from revent soil and water pollution. Dispose of jonal/national/international regulations. Contact
6.1. Personal precautions, prot General measures 6.2. Methods and materials for Methods for cleaning up 6.3. Reference to other section For further information refer to section SECTION 7: Handling and sto 7.1. Precautions for safe handli	ective equipment and ema : DANGER! To agents. Imme apparatus wh fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contaminating contents/cont supplier for an s on 8: Exposure controls/p prage ing : Leak-check s)	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spres or move container to a well-vent d explode if reignited by sparks or g area, especially confined areas to person the surrounding environment. P ainer in accordance with local/reg ny special requirements,	m danger area. Use self-contained breathing of ignition if safe to do so, Reduce vapors with a liquid with water. Shut off flow if safe to do so ilated area. Flammable vapors may spread from flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device. fine water spray. Prevent waste from trevent soil and water pollution. Dispose of jonal/national/international regulations. Contact
6.1. Personal precautions, prot General measures 6.2. Methods and materials for Methods for cleaning up 6.3. Reference to other section For further information refer to section SECTION 7: Handling and sto	ective equipment and ema : DANGER! To agents. Imme apparatus whi fog or fine wat Ventilate area leak and could Before enterin containment and cleaning : Try to stop rel contents/cont supplier for ar s on 8: Exposure controls/p prage ing : Leak-check sy All piped syste Keep away for	xic, flammable liquefied gas. F diately evacuate all personnel fro ere needed. Remove all sources ter spray, taking care not to spre- or move container to a well-vent d explode if reignited by sparks or g area, especially confined areas of up ease. Reduce vapour with fog or the surrounding environment. P ainer in accordance with local/reg y special requirements.	m danger area. Use self-contained breathing of ignition if safe to do so. Reduce vapors with a liquid with water. Shut off flow if safe to do ilated area. Flammable vapors may spread from flames. Explosive atmospheres may linger. s, check atmosphere with an appropriate device fine water spray. Prevent waste from trevent soil and water pollution. Dispose of jonal/national/international regulations. Contact e a flame nust be grounded en flames and other ignition sources. No

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Hydrogen sulfide

according to the Hazardous Products Regulation (February 11, 2015) Date of issue: 10-15-1979 Revision date: 08-10-2016 Supersedes: 10-15-2013

7.2. Conditions for safe storage, including any incompatibilities Storage conditions : Store only where temperature will not exceed 125"F (52"C). Post "No Smoking/No Open Flames" signs in storage and use areas. There must be no sources of ignition. Separate

packages and protect against potential fire and/or explosion damage following appropriate codes and requirements (e.g, NFPA 30, NFPA 55, NFPA 70, and/or NFPA 221 in the U.S.) or according to requirements determined by the Authority Having Jurisdiction (AHJ). Always secure containers upright to keep them from falling or being knocked over. Install valve protection cap, if provided, firmly in place by hand when the container is not in use. Store full and empty containers separately. Use a first-in, first-out inventory system to prevent storing full containers for long periods. For other precautions in using this product, see section 16

OTHER PRECAUTIONS FOR HANDLING, STORAGE, AND USE: When handling product under pressure, use piping and equipment adequately designed to withstand the pressures to be encountered. Never work on a pressurized system. Use a back flow preventive device in the piping. Gases can cause rapid suffocation because of oxygen deficiency; store and use with adequate ventilation. If a leak occurs, close the container valve and blow down the system in a safe and environmentally correct manner in compliance with all international, federal/national, state/provincial, and local laws; then repair the leak. Never place a container where it may become part of an electrical circuit.

Hydrogen sulfide (7783-06-4	4)		
USA - ACGIH	ACGIH TLV-TWA (ppm)	1 ppm	
USA - ACGIH	ACGIH TLV-STEL (ppm)	5 ppm	
USA - OSHA	OSHA PEL (Ceiling) (ppm)	20 ppm	
Canada (Quebec)	VECD (mg/m ³)	21 mg/m ^a	
Canada (Quebec)	VECD (ppm)	15 ppm	
Canada (Quebec)	VEMP (mg/m ^a)	14 mg/m³	
Canada (Quebec)	VEMP (ppm)	10 ppm	
Alberta	OEL Ceiling (mg/m ^a)	21 mg/m ^a	
Alberta	OEL Ceiling (ppm)	15 ppm	
Alberta	OEL TWA (mg/m ³)	14 mg/m ³	
Alberta	OEL TWA (ppm)	10 ppm	
British Columbia	OEL Celling (ppm)	10 ppm	
Manitoba	OEL STEL (ppm)	5 ppm	
Manitoba	OEL TWA (ppm)	1 ppm	
New Brunswick	OEL STEL (mg/m ^a)	21 mg/m³	
New Brunswick	OEL STEL (ppm)	16 ppm	
New Brunswick	OEL TWA (mg/m ^o)	14 mg/m ^a	
New Brunswick	OEL TWA (ppm)	10 ppm	
New Foundland & Labrador	OEL STEL (ppm)	5 ppm	
New Foundland & Labrador	OEL TWA (ppm)	1 ppm	
Nova Scotia	OEL STEL (ppm)	5 ppm	
Nova Scotia	OEL TWA (ppm)	1 ppm	
Nunavut	OEL Ceiling (mg/m³)	28 mg/m*	
Nunavut	OEL Ceiling (ppm)	20 ppm	
Nunavut	OEL STEL (mg/m²)	21 mg/m ^a	
Nunavut	OEL STEL (ppm)	15 ppm	
Nunavut	OEL TWA (mg/m ²)	14 mg/m ^a	
Nunavut	OEL TWA (ppm)	10 ppm	
Northwest Territories	OEL STEL (ppm)	15 ppm	

This document is only controlled while on the Praxeir Canada Inc. website and a copy of this controlled version is available for download. Praxeir cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Hydrogen sulfide

according to the Hazardous Products Regulation (February 11, 2015) Date of issue: 10-15-1979 Revision date: 08-10-2016 Supersedes: 10-15-2013

Hydrogen sulfide (7783-0	16-4)		
Northwest Territories	OEL TWA (ppm)	10 ppm	
Ontario	OEL STEL (ppm)	15 ppm	
Ontario	OEL TWA (ppm)	10 ppm	
Prince Edward Island	OEL STEL (ppm)	5 ppm	
Prince Edward Island	OEL TWA (ppm)	1 ppm	
Québec	VECD (mg/m ³)	21 mg/m ^a	
Québec	VECD (ppm)	15 ppm	
Québec	VEMP (mg/m ^a)	14 mg/m ²	
Québec	VEMP (ppm)	10 ppm	
Saskatchewan	OEL STEL (ppm)	15 ppm	
Saskatchewan	OEL TWA (ppm)	10 ppm	
Yukon	OEL STEL (mg/m ²)	27 mg/m ^a	
Yukon	OEL STEL (ppm)	15 ppm	
Yukon	OEL TWA (mg/m²)	15 mg/m ^a	
Yukan	OEL TWA (ppm)	10 ppm	

Appropriate engineering controls 8.2

Appropriate engineering controls

: Use corrosion-resistant equipment. Use an explosion-proof local exhaust system. Local exhaust and general ventilation must be adequate to meet exposure standards. MECHANICAL (GENERAL): Inadequate - Use only in a closed system. Use explosion proof equipment and lighting.

8.3. Individual protection measures/Personal protective equipment

Personal protective equipment



: Safety glasses. Face shield. Gloves.

Hand protection

Eye protection

Respiratory protection

Thermal hazard protection

Other information

: Wear work gloves when handling containers. Wear heavy rubber gloves where contact with product may occur.

: Wear goggles and a face shield when transfilling or breaking transfer connections. Select in accordance with the current CSA standard Z94.3, "Industrial Eye and Face Protection", and any provincial regulations, local bylaws or guidelines,

Respiratory protection: Use respirator or air supplied respirator when working in confined space or where local exhaust or ventilation does not keep exposure below TLV. Select in accordance with provincial regulations, local bylaws or guidelines. Selection should be based on the current CSA standard Z94.4, "Selection, Care, and Use of Respirators." Respirators should also be approved by NIOSH and MSHA. For emergencies or instances with unknown exposure levels, use a self-contained breathing apparatus (SCBA).
: Wear cold insulating gloves when transfilling or breaking transfer connections. Standard EN 511. Cold insulation gloves

: Other protection : Safety shoes for general handling at customer sites. Metatarsal shoes and culless trousers for cylinder handling at packaging and filling plants. Select in accordance with the current CSA standard Z195, "Protective Foot Wear", and any provincial regulations, local bylaws or guidelines. For working with flammable and oxidizing materials, consider the use of flame resistant anti-static safety clothing.

9.1. Information on basic	physical and chemical properties
Physical state	; Gas
Appearance	: Colorless gas. Colorless liquid at low temperature or under high pressure.
Molecular mass	: 34 g/mol
Colour	: Colourless.
Odour	: Odour can persist. Poor warning properties at low concentrations. Rotten eggs.
Odour threshold	: Odour threshold is subjective and inadequate to warn of overexposure.

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

PRAXAIR	afety Data Sheet E-461 cording to the Hazardous Products Regu	lation (February 11, 20	15)
D	le of issue: 10-15-1979 Revision	date: 08-10-2016	Supersedes: 10-15-2013
pН	: Not applicable.		
pH solution	: No data available		
Relative evaporation rate (butylacetate=1)	: No data available		
Relative evaporation rate (ether=1)	: Not applicable.		
Melting point	: -86 °C		
Freezing point	: -82.9 °C		
Boiling point	: -60.3 °C		
Flash point	: Not applicable.		
Critical temperature	: 100.4 °C		
Auto-ignition temperature	: 260 °C		
Decomposition temperature	: No data available		
Vapour pressure	: 1880 kPa		
Vapour pressure at 50 °C	: No data available		
Critical pressure	: 8940 kPa		
Relative vapour density at 20 °C	: >=		
Relative density	: No data available		
Relative density of saturated gas/air mixtu	e : No data available		
Density	: No data available		
Relative gas density	: 1.2		
Solubility	: Water: 3980 mg/l		
Log Pow	: Not applicable.		
Log Kow	: Not applicable.		
Viscosity, kinematic	: Not applicable.		
2019년 2017년 201 1월 19 19 19 19 19 19 19 19 19 19 19 19 19			

: Not applicable.

Viscosity, kinematic (calculated value) (40 °C)	: No data available
Explosive properties	: Not applicable.
Oxidizing properties	: None.
Flammability (solid, gas)	: 4.3 × 46 vol %
9.2. Other information	
Gas group	: Liquefied gas
Additional information	: Gas/vapour heavier than air. May accumulate in confined spaces, particularly at or below ground level

10.1. Reactivity	
Reactivity	: No reactivity hazard other than the effects described in sub-sections below.
Chemical stability	: Stable under normal conditions.
Possibility of hazardous reactions	: May react violently with oxidants. Can form explosive mixture with air.
Conditions to avoid	 Avoid moisture in installation systems. Keep away from heat/sparks/open flames/hot surfaces – No smoking.
Incompatible materials	: Ammonia. Bases. Bromine pentafluoride, Chlorine trifluoride, chromium trioxide, (and heat). Copper, (powdered), Fluorine, Lead, Lead oxide, Mercury, Nitric acid, Nitrogen trifluoride, nitrogen sulfide, Organic compounds, Oxidizing agents, Oxygen difluoride, Rubber, Sodium, (and moisture). Water,
Hazardous decomposition products	: Thermal decomposition may produce : Sulfur, Hydrogen.

11.1. Information on toxicolo	ical effects	
Acute toxicity (oral)	: Not classified	
Acute toxicity (dermal)	: Not classified	

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

EN (English)

Viscosity, dynamic

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Hydrogen sulfide Safety Data Sheet E-4611 according to the Hazardous Products Regulation (Pebruary 11, 2015) Date of issue: 10-15-1979 Revision date: 08-10-2016 Supersedes: 10-15-2013

Acute toxicity (inhalation)	: Inhalation:gas: FATAL IF INHALED.
Hydrogen sulfide (\f)7783-06-4	
LC50 inhalation rat (mg/l)	0.99 mg/l (Exposure time: 1 h)
LC50 inhalation rat (ppm)	356 ppm/4h
ATE CA (gases)	356.0000000 ppmv/4h
ATE CA (vapours)	0.9900000 mg/V4h
ATE CA (dust,mist)	0.99000000 mg/l/4h
Skin corrosion/irritation	: Not classified
	pH: Not applicable.
Serious eye damage/irritation	: Not classified
	pH: Not applicable.
Respiratory or skin sensitization	: Not classified
Germ cell mutagenicity	: Not classified
Carcinogenicity	: Not classified
Reproductive toxicity	: Not classified
Specific target organ toxicity (single exposure)	: MAY CAUSE RESPIRATORY IRRITATION.
Specific target organ toxicity (repeated exposure)	: Not classified
Aspiration hazard	: Not classified

12.1. Toxicity	
Ecology - general	: VERY TOXIC TO AQUATIC LIFE.
Hydrogen sulfide (7783-06-4)	
LC50 fish 1	0.0448 mg/l (Exposure time: 96 h - Species: Lepomis macrochirus [flow-through])
LC50 fish 2	0.016 mg/l (Exposure time: 96 h - Species: Pimephales promelas [flow-through])
12.2. Persistence and degradat	siiny
Hydrogen sulfide (7783-06-4)	
Persistence and degradability	Not applicable for inorganic gases.
12.3. Bioaccumulative potentia	
Hydrogen sulfide (7783-06-4)	
BCF fish 1	(no bloaccumulation expected)
Log Pow	Not applicable.
Log Kow	Not applicable.
Bioaccumulative potential	No data available.
12.4. Mobility in soil	
Hydrogen sulfide (7783-06-4)	
Mobility in soil	No data available.
Log Pow	Not applicable.
Log Kow	Not applicable.
Ecology - soil	Because of its high volatility, the product is unlikely to cause ground or water pollution
12.5. Other adverse effects	
Other adverse effects	: May cause pH changes in aqueous ecological systems.
Effect on the ozone layer	: None
Effect on global warming	: No known effects from this product

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Hydrogen sulfide PRAYAIR Safety Data Sheet E-4611 according to the Hazardous Products Regulation (February 11, 2015) Date of issue: 10-15-1979 Revision date: 08-10-2016 Supersedes: 10-15-2013 SECTION 13: Disposal considerations 13.1. Disposal methods Waste disposal recommendations : Do not attempt to dispose of residual or unused quantities. Return container to supplier. SECTION 14: Transport information 14.1. Basic shipping description In accordance with TDG TDG UN-No. (TDG) : UN1053 TDG Primary Hazard Classes : 2.3 - Class 2.3 - Toxic Gas. **TDG Subsidiary Classes** : 2.1 Proper shipping name : HYDROGEN SULPHIDE FRAP Index : 500 Explosive Limit and Limited Quantity Index. : 0 Passenger Carrying Ship Index : Forbidden Passenger Carrying Road Vehicle or Passenger : Forbidden Carrying Railway Vehicle Index 14.3. Air and sea transport MDG UN-No. (IMDG) : 1053 : HYDROGEN SULPHIDE Proper Shipping Name (IMDG) Class (IMDG) : 2 - Gases MFAG-No : 117 IATA. UN-No. (IATA) : 1053 Proper Shipping Name (IATA) : Hydrogen sulphide Class (IATA) : 2 SECTION 15: Regulatory information 15.1. National regulations Hydrogen sulfide (7783-06-4) Listed on the Canadian DSL (Domestic Substances List) 15.2. International regulations Hydrogen sulfide (7783-06-4) Listed on the AICS (Australian Inventory of Chemical Substances) Listed on IECSC (Inventory of Existing Chemical Substances Produced or Imported in China) Listed on the EEC inventory EINECS (European Inventory of Existing Commercial Chemical Substances) Listed on the Japanese ENCS (Existing & New Chemical Substances) inventory Listed on the Korean ECL (Existing Chemicals List) Listed on NZIoC (New Zealand Inventory of Chemicals) Listed on PICCS (Philippines Inventory of Chemicals and Chemical Substances) Listed on the United States TSCA (Toxic Substances Control Act) inventory Listed on INSQ (Mexican national Inventory of Chemical Substances) SECTION 16: Other information Date of issue : 15/10/1979 Revision date : 10/08/2016 Supersedes : 15/10/2013 Indication of changes: : Users of breathing apparatus must be trained. Ensure operators understand the toxicity hazard. Training advice Ensure operators understand the flammability hazard. This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

PRAXAIR	Hydrogen sulfide Safety Data Sheet E-4611		
PRAAAIK	Safety Data Sheet E-4011 according to the Hazardous Products Regulation (February 11, 2015)		
	Date of issue 10-15-1979 Revision date: 08-10-2016 Supersedes: 10-15-2013		
Other information	: When you mix two or more chemicals, you can create additional, unexpected hazards. Obtain and evaluate the safety information for each component before you produce the mixture. Consult an industrial hygienist or other trained person when you evaluate the end product. Before using any plastics, confirm their compatibility with this product		
	Praxair asks users of this product to study this SDS and become aware of the product hazards and safety information. To promote safe use of this product, a user should (1) notify employees agents, and contractors of the information in this SDS and of any other known product hazards and safety information, (2) furnish this information to each purchaser of the product, and (3) ash each purchaser to notify its employees and customers of the product hazards and safety information		
	The opinions expressed herein are those of qualified experts within Praxair Canada Inc. We believe that the information contained herein is current as of the date of this Safety Data Sheet. Since the use of this information and the conditions of use are not within the control of Praxair Canada Inc, it is the user's obligation to determine the conditions of safe use of the product. Praxair Canada Inc, SDSs are furnished on sale or delivery by Praxair Canada Inc, or the independent distributors and suppliers who package and sell our products. To obtain current SDSs for these products, contact your Praxair sales representative, local distributor, or supplier, or download from www.praxair.ca. If you have questions regarding Praxair SDSs, would like the document number and date of the latest SDS, or would like the names of the Praxair suppliers in your area, phone or write Praxair Canada Inc. (Phone: 1-888-257-5149; Address: Praxair Canada Inc, 1 City Centre Drive, Suite 1200, Mississauga, Ontario, L5B 1M2)		
	PRAXAIR and the Flowing Airstream design are trademarks or registered trademarks of Praxai Technology, Inc. in the United States and/or other countries.		
NFPA health hazard	: 4 - Very short exposure could cause death or serious residual injury even though prompt medical attention was given.		
NFPA fire hazard	: 4 - Will rapidly or completely vaporize at normal pressure and temperature, or is readily dispersed in air and will burn readily.		
NFPA reactivity	: 0 - Normally stable, even under fire exposure conditions, and are not reactive with water.		
HMIS III Rating			
Health	: 2 Moderate Hazard - Temporary or minor injury may occur		
Flammability	4 Severe Hazard - Flammable gases, or very volatile flammable liquids with flash points below 73 F, and boiling points below 100 F. Materials may ignite spontaneously with air. (Class IA)		
Physical	 2 Moderate Hazard – Materials that are unstable and may undergo violent chemical changes at normal temperature and pressure with low risk for explosion. Materials may react violently with water or form peroxides upon exposure to air. 		

SDS Canada (GHS) - Praxair

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product.

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

EN (English)

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Appendix B SO₂ SDS

•

H ₂ S Contingency Plan	Eddy County, New Mexico
Fred State Com 121H, 111H, 122H,	
112H, 131H, 221H, 421H, 132H, 222H,	
422H	
Gabagool Fed Com 121H, 111H, 122H,	
112H, 131H, 221H, 421H, 132H, 222H,	
422H	
	Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H Gabagool Fed Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H,



Safety Data Sheet

Material Name: SULFUR DIOXIDE

Section 1 - PRODUCT AND COMPANY IDENTIFICATION Material Name SULFUR DIOXIDE Synonyms MTG MSDS 80; SULFUROUS ACID ANHYDRIDE; SULFUROUS OXIDE; SULPHUR DIOXIDE; SULFUROUS ANHYDRIDE; FERMENTICIDE LIQUID; SULFUR DIOXIDE(SO2); SULFUR OXIDE; SULFUR OXIDE(SO2) **Chemical Family** inorganic, gas **Product Description** Classification determined in accordance with Compressed Gas Association standards. Product Use Industrial and Specialty Gas Applications. **Restrictions on Use** None known. Details of the supplier of the safety data sheet MATHESON TRI-GAS, INC. 3 Mountainview Road Warren, NJ 07059 General Information: 1-800-416-2505 Emergency #: 1-800-424-9300 (CHEMTREC) Outside the US: 703-527-3887 (Call collect)

Section 2 - HAZARDS IDENTIFICATION

Classification in accordance with paragraph (d) of 29 CFR 1910,1200. Gases Under Pressure - Liquefied gas Acute Toxicity - Inhalation - Gas - Category 3 Skin Corrosion/Irritation - Category 1B Serious Eye Damage/Eye Irritation - Category 1 Simple Asphyxiant **GHS Label Elements** Symbol(s) Signal Word Danger Hazard Statement(s) Contains gas under pressure; may explode if heated. Toxic if inhaled. Causes severe skin burns and eye damage. May displace oxygen and cause rapid suffocation. Precautionary Statement(s) Prevention Use only outdoors or in a well-ventilated area. Wear protective gloves/protective clothing/eye protection/face protection.

Issue date: 2021-01-30 Revision 8.0

Print date: 2021-01-30

SDS ID: MAT22290

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Safety Data Sheet

Material Name: SULFUR DIOXIDE

Wash thoroughly after handling.

Do not breathe dusts or mists.

Response

IF INHALED: Remove person to fresh air and keep comfortable for breathing.

IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

IF ON SKIN (or hair): Remove/take off immediately all contaminated clothing. Rinse skin with water/shower.

Wash contaminated clothing before reuse.

IF SWALLOWED: Rinse mouth. Do NOT induce vomiting.

Immediately call a POISON CENTER or doctor.

Specific treatment (see label).

Storage

Store in a well-ventilated place. Keep container tightly closed. Store locked up.

Protect from sunlight.

Disposal

Dispose of contents/container in accordance with local/regional/national/international regulations. Other Hazards

Contact with liquified gas may cause frostbite.

CAS	Component Name	Percent
7446-09-5	Sulfur dioxide	100.0

Inhalation

IF INHALED: Remove person to fresh air and keep at rest in a position comfortable for breathing. Get immediate medical attention.

Skin

IF ON SKIN (or hair): Remove/take off immediately all contaminated clothing. Rinse skin with water/shower. Wash contaminated clothing before reuse. If frostbite or freezing occur, immediately flush with plenty of lukewarm water (105-115°F; 41-46°C). If warm water is not available, gently wrap affected parts in blankets. DO NOT induce vomiting. Get immediate medical attention.

Eyes

IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Get immediate medical attention.

Ingestion

IF SWALLOWED: Rinse mouth. Do NOT induce vomiting. Get immediate medical attention.

Most Important Symptoms/Effects

Acute Toxic if inhaled, frostbite, suffocation, respiratory tract burns, skin burns, eye burns

Delayed

No information on significant adverse effects.

Indication of any immediate medical attention and special treatment needed

Treat symptomatically and supportively.

Note to Physicians

For inhalation, consider oxygen.

Print date: 2021-01-30

SDS ID: MAT22290

Permian Resources Corporation	H ₂ S Contingency Plan Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H Gabagool Fed Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H,	Eddy County, New Mexico
	112H, 131H, 221H, 421H, 132H, 222H, 422H	

•

H ₂ S Contingency Plan	Eddy County, New Mexico
Fred State Com 121H, 111H, 122H,	
112H, 131H, 221H, 421H, 132H, 222H,	
422H	
Gabagool Fed Com 121H, 111H, 122H,	
112H, 131H, 221H, 421H, 132H, 222H,	
422H	
	Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H Gabagool Fed Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H,



Material Name: SULFUR DIOXIDE SDS ID: MAT22290 Section 5 - FIRE FIGHTING MEASURES **Extinguishing Media** Suitable Extinguishing Media carbon dioxide, regular dry chemical, Large fires: Use regular foam or flood with fine water spray. **Unsuitable Extinguishing Media** None known. Special Hazards Arising from the Chemical Negligible fire hazard. **Hazardous** Combustion Products sulfur oxides **Fire Fighting Measures** Move container from fire area if it can be done without risk. Cool containers with water spray until well after the fire is out. Stay away from the ends of tanks. Keep unnecessary people away, isolate hazard area and deny entry. Special Protective Equipment and Precautions for Firefighters Wear full protective fire fighting gear including self contained breathing apparatus (SCBA) for protection against possible exposure. Section 6 - ACCIDENTAL RELEASE MEASURES Personal Precautions, Protective Equipment and Emergency Procedures Wear personal protective clothing and equipment, see Section 8. Methods and Materials for Containment and Cleaning Up Keep unnecessary people away, isolate hazard area and deny entry. Stay upwind and keep out of low areas. Ventilate closed spaces before entering. Evacuation radius: 150 feet. Stop leak if possible without personal risk. Reduce vapors with water spray. Do not get water directly on material. **Environmental Precautions** Avoid release to the environment. Section 7 - HANDLING AND STORAGE **Precautions for Safe Handling** Do not get in eyes, on skin, or on clothing. Do not breathe gas, fumes, vapor, or spray. Wash hands thoroughly after handling. Use only outdoors or in a well-ventilated area. Wear protective gloves/protective clothing/eye protection/face protection. Contaminated work clothing should not be allowed out of the workplace. Do not eat, drink or smoke when using this product. Keep only in original container. Avoid release to the environment, Conditions for Safe Storage, Including any Incompatibilities Store in a well-ventilated place. Keep container tightly closed. Store locked up. Protect from sunlight. Store and handle in accordance with all current regulations and standards. Protect from physical damage. Store outside or in a detached building. Keep separated from incompatible substances. **Incompatible Materials** bases, combustible materials, halogens, metal carbide, metal oxides, metals, oxidizing materials, peroxides, reducing agents Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION **Component Exposure Limits** Sulfur dioxide 7446-09-5 ACGIH: 0.25 ppm STEL

Page 3 of 9

Issue date: 2021-01-30 Revision 8.0

Print date: 2021-01-30

Permian Resources Corporation	H₂S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Material Name: SULFUR DIOXIDE

NIOSH:	2 ppm TWA ; 5 mg/m3 TWA
	5 ppm STEL ; 13 mg/m3 STEL
	100 ppm IDLH
OSHA (US):	5 ppm TWA ; 13 mg/m3 TWA
Mexico:	0.25 ppm STEL [PPT-CT]

ACGIH - Threshold Limit Values - Biological Exposure Indices (BEI)

There are no biological limit values for any of this product's components.

Engineering Controls

Provide local exhaust or process enclosure ventilation system. Ensure compliance with applicable exposure limits. Individual Protection Measures, such as Personal Protective Equipment

Eye/face protection

Wear splash resistant safety goggles with a faceshield. Contact lenses should not be worn. Provide an emergency eye wash fountain and quick drench shower in the immediate work area.

Skin Protection

Wear appropriate chemical resistant clothing. Wear chemical resistant clothing to prevent skin contact. Respiratory Protection

Any self-contained breathing apparatus that has a full facepiece and is operated in a pressure-demand or other positive-pressure mode.

Glove Recommendations

Wear appropriate chemical resistant gloves.

Sect	ion 9 - PHYSICAL	AND CHEMICAL PROPERT	TIES
Appearance	colorless gas	Physical State	gas
Odor	irritating odor	Color	colorless
Odor Threshold	3 - 5 ppm	рН	(Acidic in solution)
Melting Point	-73 °C (-99 °F)	Boiling Point	-10 °C (14 °F)
Boiling Point Range	Not available	Freezing point	Not available
Evaporation Rate	>1 (Butyl acetate = 1)	Flammability (solid, gas)	Not available
Autoignition Temperature	Not available	Flash Point	(Not flammable)
Lower Explosive Limit	Not available	Decomposition temperature	Not available
Upper Explosive Limit	Not available	Vapor Pressure	2432 mmHg @ 20 ℃
Vapor Density (air=1)	2.26	Specific Gravity (water=1)	1.462 at -10 °C

Page 4 of 9

Issue date: 2021-01-30 Revision 8.0

Print date: 2021-01-30

SDS ID: MAT22290

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Material Name: SULFUR DIOXIDE

SDS ID: MAT22290

	22.8% (@0°C)	Partition coefficient: n- octanol/water	Not available
Viscosity	Not available	Kinematic viscosity	Not available
Solubility (Other)	Not available	Density	Not available
Physical Form	liquified gas	Molecular Formula	S-02
Molecular Weight	64.06		
Solvent Solubility Soluble alcohol, acetic acid, sulf	uric acid, ether, chloroforn	n, Benzene, sulfuryl chloride, nitrob	oenzenes, Toluene, acetone
	Section 10 - STAI	BILITY AND REACTIVIT	Y
Will not polymerize. Conditions to Avoid			
Incompatible Material bases, combustible mate agents Hazardous decomposit	s rials, halogens, metal carbi	pture or explode if exposed to heat.	
Incompatible Material bases, combustible mate agents	s rials, halogens, metal carbi tion products Section 11 - TOXIC		materials, peroxides, reducin

Page 5 of 9

Issue date: 2021-01-30 Revision 8.0

Print date: 2021-01-30

.

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Material Name: SULFUR DIOXIDE

Toxic if inhaled, frostbite, suffocation, respiratory tract burns, skin burns, eye burns Delayed Effects SDS ID: MAT22290

No information on significant adverse effects. Irritation/Corrosivity Data respiratory tract burns, skin burns, eye burns Respiratory Sensitization No data available. Dermal Sensitization No data available. Component Carcinogenicity

Sulfur dioxide	7446-09-5
ACGIH:	A4 - Not Classifiable as a Human Carcinogen
LARC:	Monograph 54 [1992] (Group 3 (not classifiable))

Germ Cell Mutagenicity No data available. Tumorigenic Data No data available Reproductive Toxicity No data available. Specific Target Organ Toxicity - Single Exposure No target organs identified. Specific Target Organ Toxicity - Repeated Exposure No target organs identified. Aspiration hazard Not applicable. Medical Conditions Aggravated by Exposure

respiratory disorders

Section 12 - ECOLOGICAL INFORMATION

Component Analysis - Aquatic Toxicity No LOLI ecotoxicity data are available for this product's components. Persistence and Degradability No data available. Bioaccumulative Potential No data available. Mobility No data available.

Section 13 - DISPOSAL CONSIDERATIONS

Disposal Methods

Dispose of contents/container in accordance with local/regional/national/international regulations.

Component Waste Numbers

The U.S. EPA has not published waste numbers for this product's components.

Section 14 - TRANSPORT INFORMATION

US DOT Information:

Shipping Name: SULFUR DIOXIDE

Page 6 of 9

Issue date: 2021-01-30 Revision 8.0

Print date: 2021-01-30

Permian Resources Corporation	H₂S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Material Name: SULFUR DIOXIDE

Hazard Class: 2.3 UN/NA #: UN1079 Required Label(s): 2.3 SDS ID: MAT22290

IMDG Information: Shipping Name: SULPHUR DIOXIDE Hazard Class: 2.3 UN#: UN1079 Required Label(s): 2.3

TDG Information: Shipping Name: SULFUR DIOXIDE Hazard Class: 2.3 UN#: UN1079 Required Label(s): 2.3

International Bulk Chemical Code

This material does not contain any chemicals required by the IBC Code to be identified as dangerous chemicals in bulk.

Section 15 - REGULATORY INFORMATION

U.S. Federal Regulations

This material contains one or more of the following chemicals required to be identified under SARA Section 302 (40 CFR 355 Appendix A), SARA Section 313 (40 CFR 372.65), CERCLA (40 CFR 302.4), TSCA 12(b), and/or require an OSHA process safety plan.

Sulfur dioxide	7446-09-5
SARA 302:	500 lb TPQ
OSHA (safety):	1000 lb TQ (Liquid)
SARA 304:	500 lb EPCRA RQ

SARA Section 311/312 (40 CFR 370 Subparts B and C) reporting categories

Gas Under Pressure; Acute toxicity; Skin Corrosion/Irritation; Serious Eye Damage/Eye Irritation; Simple Asphyxiant

U.S. State Regulations

The following components appear on one or more of the following state hazardous substances lists:

Component	CAS	CA	MA	MN	NJ	PA
Sulfur dioxide	7446-09-5	Yes	Yes	Yes	Yes	Yes

California Safe Drinking Water and Toxic Enforcement Act (Proposition 65)



This product can expose you to chemicals including Sulfur dioxide, which is known to the State of California to cause birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.

Issue date: 2021-01-30 Revision 8.0

Print date: 2021-01-30

Permian Resources Corporation	H ₂ S Contingency Plan Fred State Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H, 422H Gabagool Fed Com 121H, 111H, 122H, 112H, 131H, 221H, 421H, 132H, 222H,	Eddy County, New Mexico
	422H	

Permian Resources Corporation	H ₂ S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	



Material Name: SULFUR DIOXIDE

Sulfur dioxide	7446-09-5		
Repro/Dev. Tox	developmental toxicity, 7/29/2011		

Component Analysis - Inventory Sulfur dioxide (7446-09-5)

US	CA	AU	CN	EU	JP - ENCS	JP - ISHL	KR KECI - Annex 1	KR KECI - Annex 2
Yes	DSL	Yes	Yes	EIN	Yes	Yes	Yes	No

KR - REACH CCA	MX	NZ	PH	TH-TECI	TW, CN	VN (Draft)
No	Yes	Yes	Yes	Yes	Yes	Yes

Section 16 - OTHER INFORMATION

NFPA Ratings

Health: 3 Fire: 0 Instability: 0

Hazard Scale: 0 = Minimal 1 = Slight 2 = Moderate 3 = Serious 4 = Severe

Summary of Changes

SDS update: 02/10/2016

Key / Legend

ACGIH - American Conference of Governmental Industrial Hygienists; ADR - European Road Transport; AU -Australia; BOD - Biochemical Oxygen Demand; C - Celsius; CA - Canada; CA/MA/MN/NJ/PA -California/Massachusetts/Minnesota/New Jersey/Pennsylvania*; CAS - Chemical Abstracts Service; CERCLA -Comprehensive Environmental Response, Compensation, and Liability Act; CFR - Code of Federal Regulations (US); CLP - Classification, Labelling, and Packaging; CN - China; CPR - Controlled Products Regulations; DFG -Deutsche Forschungsgemeinschaft; DOT - Department of Transportation; DSD - Dangerous Substance Directive; DSL - Domestic Substances List; EC - European Commission; EEC - European Economic Community; EIN -European Inventory of (Existing Commercial Chemical Substances); EINECS - European Inventory of Existing Commercial Chemical Substances; ENCS - Japan Existing and New Chemical Substance Inventory; EPA -Environmental Protection Agency; EU - European Union; F - Fahrenheit; F - Background (for Venezuela Biological Exposure Indices); IARC - International Agency for Research on Cancer; IATA - International Air Transport Association; ICAO - International Civil Aviation Organization; IDL - Ingredient Disclosure List; IDLH -Immediately Dangerous to Life and Health; IMDG - International Maritime Dangerous Goods; ISHL - Japan Industrial Safety and Health Law; IUCLID - International Uniform Chemical Information Database; JP - Japan; Kow - Octanol/water partition coefficient; KR KECI Annex 1 - Korea Existing Chemicals Inventory (KECI) / Korea Existing Chemicals List (KECL); KR KECI Annex 2 - Korea Existing Chemicals Inventory (KECI) / Korea Existing Chemicals List (KECL), KR - Korea; LD50/LC50 - Lethal Dose/ Lethal Concentration; KR REACH CCA Korea Registration and Evaluation of Chemical Substances Chemical Control Act; LEL - Lower Explosive Limit; LLV - Level Limit Value; LOLI - List Of LIsts™ - ChemADVISOR's Regulatory Database; MAK - Maximum Concentration Value in the Workplace; MEL - Maximum Exposure Limits; MX - Mexico; Ne- Non-specific; NFPA - National Fire Protection Agency; NIOSH - National Institute for Occupational Safety and Health; NJTSR - New Jersey Trade Secret Registry; Nq - Non-quantitative; NSL - Non-Domestic Substance List (Canada); NTP -National Toxicology Program; NZ - New Zealand; OSHA - Occupational Safety and Health Administration; PEL-Permissible Exposure Limit; PH - Philippines; RCRA - Resource Conservation and Recovery Act; REACH-Registration, Evaluation, Authorisation, and restriction of Chemicals; RID - European Rail Transport; SARA -Superfund Amendments and Reauthorization Act; Sc - Semi-quantitative; STEL - Short-term Exposure Limit;

Print date: 2021-01-30

SDS ID: MAT22290

Permian Resources Corporation	H₂S Contingency Plan	Eddy County, New Mexico
	Fred State Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	
	Gabagool Fed Com 121H, 111H, 122H,	
	112H, 131H, 221H, 421H, 132H, 222H,	
	422H	